



August 3, 2009

010-16098-04-022

Mr. Barrett Fowler
Bank of America
13510 Ballantyne Corporate Place
Charlotte, North Carolina 28277

Subject: Phase I Environmental Site Assessment
Bank of America
22W151 Butterfield Road
Glen Ellyn, Illinois 60137
Mail Code: IL4-003

Dear Mr. Fowler:

Attached is the Phase I Environmental Site Assessment report completed for the property located at 22W151 Butterfield Road, Glen Ellyn, DuPage County, Illinois. The conclusions presented in this report are based on the results of a reconnaissance-level site visit conducted by LFR Inc. (LFR) personnel, review of available and pertinent background information and a regulatory file search.

LFR appreciates this opportunity to provide consulting services to you. If you have any questions concerning this project, or would like to discuss other environmental concerns, please contact me at (781) 356-7300.

Sincerely,

A handwritten signature in black ink, appearing to read "Stephen P. McCarthy". The signature is stylized with a large, looping initial "S" and a clear "P" and "M".

Stephen P. McCarthy
Senior Associate

Attachment

Phase I Environmental Site Assessment

**Bank of America
22W151 Butterfield Road
Glen Ellyn, Illinois 60137
Mail Code: IL4-003**


**August 3, 2009
LFR Project No. 010-16098-04-022**

Prepared for
Bank of America
13510 Ballantyne Corporate Place
Charlotte, North Carolina 28277

Prepared by
LFR Inc.
194 Forbes Road
Braintree, Massachusetts 02184
781.356.7300
www.lfr.com

The environmental assessment described herein was conducted by the undersigned of LFR Inc. (LFR). LFR's investigation consisted solely of the activities described in the Introduction of this report, in accordance with the Bank of America Phase I Environmental Site Assessment Standard Scope of Work and Report Outline, and is subject to the Limitations and Service Constraints provided in Section 6.0 and the Terms and Conditions of the Standard Consulting Services Agreement signed prior to initiation of the assessment.

Report Prepared By:



Morgan L. Vogt
Senior Staff Geologist

Report Reviewed By:



Douglas M. Lindsay, PG
Senior Geologist

CONTENTS

EXECUTIVE SUMMARY OF FINDINGS.....	1
1.0 INTRODUCTION	2
1.1 Purpose	2
1.2 Involved Parties	2
1.3 Scope of Work.....	3
2.0 GENERAL SITE CHARACTERISTICS	3
2.1 Site Ownership and Location.....	3
2.2 Adjacent Properties	3
2.3 Site Description and Current Site Uses/Operations.....	4
2.4 Former Site Uses/Operations.....	4
3.0 ENVIRONMENTAL SETTING	4
3.1 Regional Physiographic Conditions	4
3.2 Soil Conditions	4
3.3 Geologic Conditions	5
3.4 Surface Water and Groundwater Characteristics.....	5
4.0 RESULTS OF INVESTIGATION	5
4.1 Site Inspection Observations	5
4.2 Standard Environmental Record Sources.....	7
4.3 Results of Site History/Land Use Review.....	8
4.3.1 Personnel Site Interviews	8
4.3.2 Municipal File Review	9
4.3.3 Aerial Photographs.....	9
4.3.4 Fire Insurance Maps	10
4.3.5 City Directories.....	10
4.3.6 Topographic Maps	10
4.4 Synopsis of Previous Environmental Investigations	11

4.5 User Provided Information	11
4.5.1 Title Records.....	11
4.5.2 Environmental Liens or Activity and Use Limitations	11
4.5.3 Specialized Knowledge.....	11
4.5.4 Commonly Known or Reasonably Ascertainable Information	12
4.5.5 Valuation Reduction for Environmental Issues.....	12
4.5.6 Owner, Property Manager and Occupant Information	12
4.5.7 Reason for Performing Phase I	12
4.5.8 Other Information	12
4.6 Results of Limited ACM Screening	13
4.7 Results of Radon Investigation.....	13
4.8 Results of Mold Investigation	13
5.0 FINDINGS AND CONCLUSIONS.....	13
5.1 Known or Suspect RECs.....	13
5.2 de minimis Conditions.....	13
5.3 Deviations/Data Gaps	14
5.4 Conclusions	14
6.0 LIMITATIONS.....	14
7.0 REFERENCES	16
8.0 STATEMENT OF ENVIRONMENTAL PROFESSIONAL(S)	17

FIGURES

- 1 Site Vicinity Map
- 2 Site Plan

APPENDICES

- A Site Photographs
- B Regulatory Agency Database Information (EDR Report)
- C Historical Resources
- D User Provided Information
- E Asbestos Sample Results
- F Qualifications of Environmental Professionals

EXECUTIVE SUMMARY OF FINDINGS

LFR Inc. (LFR) was retained by Bank of America to conduct a Phase I Environmental Site Assessment of the property located at 22W151 Butterfield Road in the Village of Glen Ellyn, DuPage County, Illinois (the Site). The Site consists of an approximately one-acre parcel of land improved with a one-story, 3,659-square foot bank branch that was constructed in 1976. The interior of the building is comprised of a lobby/teller area, offices, a break room and bathrooms, as well as a basement with a mechanical room and storage area. The remainder of the Site is improved with asphalt-paved parking and driveway areas, concrete walkways and landscaping. Drive-thru teller lanes are located along the southern side of the Site building. The Site building is currently occupied by Bank of America.

From circa 1949 until at least 1972 the Site was either agricultural or undeveloped land. The current building was constructed in 1976. The Site has been occupied by a bank branch from 1976 until the present.

On July 15, 2009, Ms. Morgan Vogt of LFR visited the Site to evaluate the possible presence of petroleum products or hazardous materials/wastes at the Site. LFR's investigation included a reconnaissance of the Site and adjacent properties, background research, and review of available local, state and federal regulatory records regarding the presence of petroleum products or hazardous materials/wastes at or in the vicinity of the Site.

Based on the work completed, the following findings of environmental interest were identified:

- A 2008 asbestos survey identified 12" x 12" off-white floor tile and associated mastic to contain 1-5% Chrysotile asbestos. The tile and associated mastic was located in the janitor's closet on the first floor.

There are three gasoline stations located to the east and northeast of the Site. Based on their regulatory status and inferred hydraulically downgradient location, the facilities are not expected to present an environmental concern for the Site.

Conclusion

LFR has performed a Phase I Environmental Site Assessment (ESA) in general conformance with the scope and limitations of ASTM Practice E 1527 of 22W151 Butterfield Road in Glen Ellyn, DuPage County, Illinois. Any exceptions to, or deletions from, this practice are described in Section 5.3 of this report. This assessment has revealed no evidence of recognized environmental conditions (RECs) in connection with the Site.

1.0 INTRODUCTION

LFR Inc. (LFR) performed a Phase I Environmental Site Assessment (ESA) of the property located at 22W151 Butterfield Road in Glen Ellyn, DuPage County, Illinois (“the Site”). The Site consists of a one-story, 3659-square foot bank branch located on an approximately one-acre parcel of land. This ESA document has been prepared and issued in a format as prescribed by and in accordance with Bank of America requirements.

The Site location is identified on a portion of an annotated topographic map included as Figure 1. The Site layout is detailed on Figure 2. Site photographs are included as Appendix A.

1.1 Purpose

The Phase I ESA has been requested by Bank of America (Client). The purpose of this Phase I ESA is to provide appropriate inquiry into the previous ownership and use of the Site consistent with good commercial and customary practice in an effort to minimize liability. LFR assumes that the information provided by the Client, the site contact, the regulatory database provider, and local government agency is true and reliable.

The objective of the ESA was to identify recognized environmental conditions (RECs) in connection with the property, to the extent feasible pursuant to the processes prescribed in ASTM International E-1527-05 guidelines. The term “REC,” as defined by ASTM, is “the presence or likely presence of any hazardous substances or petroleum products on a property under conditions that indicate an existing release, a past release, or the material threat of a release of any hazardous substances or petroleum products into structures on the property or into the ground, groundwater, or surface water of the property.” The term includes hazardous substances or petroleum products even under conditions in compliance with laws. The term is not intended to include *de minimis* conditions that generally do not present a material risk of harm to public health or the environment and that generally would not be the subject of an enforcement action if brought to the attention of appropriate governmental agencies.

1.2 Involved Parties

This Phase I ESA was conducted for the use and reliance by Bank of America and its successors and assignees, and may be relied upon by such parties. No use of the information contained in this report by others is permissible without receiving prior written authorization to do so from LFR. LFR is not responsible for independent conclusions, opinions, or recommendations made by others or otherwise based on the findings presented in this report.

1.3 Scope of Work

To complete this assessment, LFR's scope of services included the following:

- review of Federal and State regulatory agency databases identified by ASTM for the Site and a selected radius around the Site;
- contact with local environmental regulatory agencies to inquire about environmental conditions at the Site and its vicinity;
- review of the Site history through available ASTM Standard Historical Sources;
- a reconnaissance of the Site to make surficial observations for evidence of recognized environmental conditions;
- a review of adjoining properties to identify the potential use of hazardous materials;
- interviews with people knowledgeable about the Site regarding current and past site usage and facility operations; and,
- preparation of this report.

2.0 GENERAL SITE CHARACTERISTICS

2.1 Site Ownership and Location

The Site is located at 22W151 Butterfield Road, Village of Glen Ellyn, DuPage County, Illinois. According to the DuPage County Assessor's Office, the Site is identified as Parcel Identification number 05-26-404-010 and is owned by Bank of America. Access to the Site is from the north via Butterfield Road and from the east via Illinois 53.

2.2 Adjacent Properties

The Site and surrounding properties are located in a commercial and residential area of Glen Ellyn, Illinois. The Site is zoned "C" for commercial use.

The use of the adjacent properties at the time of LFR's investigation is summarized as follows:

- North: Butterfield Road, beyond which are residences and Mobile Gasoline Station (east side).
- South: McDonalds (east side) and Wal-Mart (west side).
- East: BP Gasoline Station.
- West: Abbington Banquet Hall.

2.3 Site Description and Current Site Uses/Operations

The Site consists of an approximately one-acre parcel of land improved with a one-story, 5,522-square foot bank branch that was constructed in 1976. The Site building is of concrete block construction with a stucco exterior façade, concrete foundation, and flat roof. The interior of the building is comprised of a lobby/teller area, offices, a break room and bathrooms. The building is currently occupied by Bank of America.

The remainder of the Site is improved with asphalt-paved parking and driveway areas, concrete walkways and landscaping. Drive-thru teller lanes are located along the southern side of the building.

The building is heated and cooled by electricity and connected to the municipal water and sewer systems provided by the Village of Glen Ellyn.

2.4 Former Site Uses/Operations

From circa 1949 until at least 1972 the Site was either agricultural or undeveloped land. The current building was constructed in 1976. The Site has been occupied by a bank branch from 1976 until present.

3.0 ENVIRONMENTAL SETTING

3.1 Regional Physiographic Conditions

The United States Geological Survey (USGS) 7.5 Minute Topographic Map of the Wheaton, Illinois Quadrangle depicts the Site elevation as approximately 691 feet above mean sea level. The Site is relatively flat; however, area topography slopes to the southeast towards Hidden Lake and the DuPage River.

3.2 Soil Conditions

According to the Natural Resources Conservation Service (NRCS) Soil Survey data, the soils beneath the Site consist of Orthents loam and Ashkum silty clay loam. The Orthents series consists of deep and moderately deep, and moderately well and well drained silts and clays with moderate infiltration rates. The Ashkum series consists of soils with layers that impede downward movement of water and have moderately fine or fine textures.

3.3 Geologic Conditions

The surficial sediments within the area of the Site consist of ground moraines, stream terraces, and washout plains. DuPage County bedrock consists of 200 feet of Pleistocene age glacial drift deposits and alluvial silts and sands along streams. Below the glacial drifts is bedrock belonging to the Silurian System, which consist of 260 feet of Silurian age dolomite and shale.

Depth to bedrock at the Site is unknown and no outcrops were observed on the Site.

3.4 Surface Water and Groundwater Characteristics

There are no surface water bodies on or adjacent to the Site. The nearest surface water body is Hidden Lake, which is located approximately 600 feet southeast of the Site and the DuPage River, which is located approximately 1,000 feet south-southeast of the Site.

Based on topography and nearby surface water features, groundwater is inferred to flow to the south-southeast. Pending site-specific hydrogeologic data to the contrary, groundwater at the Site is anticipated to be Class I Potable Resource Groundwater as listed in 35 Illinois Administrative Code Part 640 *Groundwater Quality*.

4.0 RESULTS OF INVESTIGATION

Ms. Morgan Vogt of LFR conducted a site inspection on July 15, 2009. The weather at the time of the investigation was cloudy and a temperature of approximately 75 degrees Fahrenheit. LFR was provided access to accessible interior and exterior areas of the Site.

4.1 Site Inspection Observations

Underground Storage Tanks (USTs) and Aboveground Storage Tanks (ASTs)

LFR did not observe visual evidence of USTs (fill pipes, vent pipes, etc.) or ASTs at the Site.

Hazardous substances and petroleum products

LFR did not observe the use or storage of hazardous substances or petroleum products at the Site.

Unlabeled Drums/Containers

LFR did not observe unlabeled drums or containers at the Site.

Staining/Corrosion

LFR did not observe any stained or corroded surfaces at the Site.

Stressed Vegetation

LFR did not observe evidence of stressed vegetation at the Site.

Electrical Transformers/Equipment

LFR observed one pad-mounted transformer at the west corner of the Site. The transformer was not labeled as being classified as “Non-PCB.” LFR did not observe evidence of leaks or staining on or beneath the transformer.

LFR did not observe other electrical transformers or hydraulic equipment at the Site.

Drywells, Sumps, Catch Basins and Floor Drains

LFR observed one sump in the basement mechanical room of the Site building which is likely connected to the municipal sewer system. LFR did not observe drywells, catch basins or floor drains at the Site.

Pits, Ponds, Lagoons and Pools of Liquid

LFR did not observe pits, ponds, lagoons or pools of liquid at the Site.

Wells

LFR did not observe evidence of monitoring wells, water supply wells, irrigation wells, or other wells at the Site.

Solid Waste

Solid waste is collected in a dumpster located on the northeast side of the Site and is picked-up by the Village of Glen Ellyn.

LFR did not observe dumping of solid waste or construction debris on the Site.

Process Wastewater

LFR did not observe the generation or discharge of process wastewater at the Site.

Septic Systems/Sewer

The Site is connected to the Village of Glen Ellyn sanitary sewer system. LFR did not observe evidence of an on-site septic system.

Source of Potable Water

The Site is connected to the public water system supplied and maintained by the Village of Glen Ellyn.

Heating and Cooling Systems

The Site building is heated and cooled by roof-mounted package units powered by electricity.

Other Observations

No other significant interior or exterior observations were noted during the site inspection.

4.2 Standard Environmental Record Sources

LFR contracted with Environmental Data Resources, Inc. (EDR) to conduct a search of state and federal regulatory databases that provide information on the regulatory status of a property and incidents involving the use, storage, spills or transportation of hazardous materials and petroleum products at properties located within the radii specified by ASTM E 1527-05. A compilation of Federal and State database listings is provided in the EDR Radius Map Report in Appendix B.

The Site was not listed in the databases searched by EDR. Based upon their distance, regulatory status and/or inferred direction of groundwater flow, none of the off-site properties identified by the database search represent an issue of environmental concern, except for the following:

- Amoco SS #15868 (currently BP gasoline station) at 2S780 Route 53 abuts the Site to the east and is inferred to be hydraulically downgradient. The facility is identified as a registered underground storage tank (UST) facility. Two 10,000-gallon gasoline USTs and one 12,000-gallon gasoline UST were installed in 1985 and are currently in use. One 1,000-gallon waste oil UST was installed in 1977 and is listed as "exempt from registration." There are no reported leaking underground storage tank (LUST) incidents for the facility. During the Site visit, it was noted that the USTs are located approximately 100 feet east of the Site. Based on its inferred hydraulically downgradient location, the facility is not expected to adversely affect the environmental condition of the Site.

- Mobil SS 05-J7M at 22W70 Butterfield Road is located to the east-northeast across Butterfield Road approximately 250 feet from the Site. The facility is inferred to be hydraulically downgradient of the Site. This facility is identified as a registered UST, LUST and Resource Conservation and Recovery Act (RCRA) small quantity generator of hazardous waste facility. One 4,000-gallon diesel UST, one 8,000-gallon gasoline UST, one 12,000-gallon gasoline UST, and one 6,000-gallon gasoline UST were installed in 1973 and were removed in 1991. One 550-gallon heating oil UST was installed in 1981 and another was installed in 1985, and they were removed in 1985 and 1994, respectively. One 8,000-gallon diesel UST, one 12,000-gallon gasoline UST, and two 10,000-gallon gasoline USTs were installed in 1991 and are currently in use. All active USTs have a Self Service Permit and passed inspections in 2007. The facility has four reported LUST incidents from 1990 (gasoline), 1994 (“other petro”), 2001 (diesel), and 2002 (gasoline). The facility is also listed as a small quantity generator with no known violations. Because the facility is inferred to be hydraulically downgradient to the Site, this property is not expected to adversely affect the environmental condition of the subject Site.
- Shell Oil Company at 22W030 Butterfield Road is located approximately 820 feet northeast of the Site (across Butterfield Road) and is inferred to be hydraulically downgradient of the Site. The facility has one reported unleaded gasoline LUST incident from 2002. The facility was granted a No Further Action letter in 2004. Based on its regulatory status and its hydraulically downgradient location, this property is not expected to adversely affect the Site.

4.3 Results of Site History/Land Use Review

4.3.1 Personnel Site Interviews

Interview with Owner/Key Site Manager

LFR has not yet interviewed Ms. Erin Bergin, the site property manager and owner representative.

Interviews with Local Government Officials

LFR visited various municipal offices to review available records on file for the Site. Refer to the section below for additional information.

4.3.2 Municipal File Review

LFR submitted a FOIA request for information on the Site on July 13, 2009 and requested documents on file for the Site in the following departments: Village of Glen Ellyn Building Department, Health Department, Fire Department, and Public Works. Additionally, LFR submitted a FOIA request on July 13, 2009 to the DuPage County Health and Building Department, the Illinois Environmental Protection Agency (IEPA) Bureau of Land, Bureau of Air, Bureau of Water, and Office of Emergency Response, and the Office of the State Fire Marshal (OSFM) for information on file for the Site. The DuPage Building Department records have a Building Permit dated 1975 for the construction of the Site building, and a Building Permit dated 2000 for renovation of the interior of the Site building. The IEPA and OSFM did not have any records pertaining to the Site. At the time of this report, DuPage County and the Village of Glen Ellyn have not submitted a response.

4.3.3 Aerial Photographs

LFR reviewed aerial photographs provided by EDR for the years 1952, 1971, 1983, 1988, 1993, 1994, 2005 and 2006. The review of these aerial photographs identified the following information:

1952: The Site appears to be agricultural land. Abutting the Site on all sides appears to be agricultural land.

1971: The Site appears to be partially graded. North of the Site appears to be undeveloped and residential properties. South of the Site appears to be developed land (potentially an asphalt parking area). East and west of the Site are developed land with a building.

1983: Due to the poor quality of the aerial photograph, details of the Site and surrounding properties are difficult to determine. The Site appears to be developed with a building. Surrounding the Site appears to be developed areas with buildings.

1988: The Site appears to be occupied by the current bank building. Adjacent properties to the northeast, east, southeast and west appear to be utilized for commercial purposes. Residences are located to the north across Butterfield Road.

1993: Similar to the 1988 photograph except the property to the south of the bank is graded.

1994: Similar to the 1993 photograph except the property to the south of the bank is occupied by a commercial building.

2005: The Site and adjacent properties generally appear to be as observed during LFR's recent Site reconnaissance.

2006: The Site and adjacent properties generally appear to be as observed during LFR's recent Site reconnaissance.

Refer to Appendix C for copies of the foregoing aerial photographs obtained from EDR.

4.3.4 Fire Insurance Maps

LFR contracted EDR to conduct a search for historic Sanborn Fire Insurance maps for the Site. However, EDR provided LFR with a letter stating that Sanborn coverage is not available for the Site (Appendix C).

4.3.5 City Directories

LFR contracted EDR to conduct a city directory search for the Site. EDR reviewed city directories for the Site for the years 1976, 1986, 1990, 1995, 2000 and 2007. According to the EDR report, the Site address was first listed in 1976. A summary of the city directory information follows:

1976: The Site is occupied by Talman Federal Savings and Loan. Surrounding listings are residential.

1986: The Site is not listed. Surrounding listings are residential.

1990: The Site is not listed. Surrounding listings are a mix of residential and commercial uses.

1995: The Site is occupied by LaSalle-Talman Bank. Surrounding listings are a mix of residential and commercial uses.

2000: The Site is occupied by LaSalle Bank. Surrounding listings are a mix of residential and commercial uses.

2007: The Site is occupied by LaSalle Bank. Surrounding listings are a mix of residential and commercial uses.

The EDR City Directory Abstract is included in Appendix C.

4.3.6 Topographic Maps

Topographic maps were obtained from EDR for the years 1949, 1954, 1962, 1972, 1980, 1993 and 1998. The 1949, 1954, and 1962 maps show the Site and adjoining properties to be undeveloped. The Site area is shown to be primarily residential. The 1972 map shows a building adjacent to the east and west of the Site. The Site is depicted as undeveloped. The 1980 and 1993 maps show a building occupying the Site, as well as buildings to the east, south and west of the Site. North of the Site is depicted as being an urban area. The 1998 map depicts the Site and surrounding properties as being in an urban area.

The EDR Topographic Map report is included in Appendix C.

4.4 Synopsis of Previous Environmental Investigations

LFR was not provided with prior ESA reports for the Site.

4.5 User Provided Information

Ms. Erin Bergin, property manager and representative of the Client, completed a User Questionnaire on behalf of Bank of America. The User Questionnaire is provided in Appendix D.

4.5.1 Title Records

Title records were not provided to LFR for review.

4.5.2 Environmental Liens or Activity and Use Limitations

The representative of the client was asked the following questions as part of the assessment:

- Are you aware of any environmental cleanup liens that have been filed or recorded against the Site under federal, tribal, state, or local law? **Answer:** No
- Are you aware of any activity or land use limitations, such as engineering controls, land use restrictions, or institutional controls, that are in place at the Site and/or have been filed or recorded against the Site in a registry under federal, tribal, state, or local law? **Answer:** No

4.5.3 Specialized Knowledge

The representative of the Client was asked the following questions as part of the assessment:

- Do you have any specialized knowledge or experience related to the Site or nearby properties? For example, are you involved in the same line of business as the current or former occupants of the Site or an adjoining property so that you would have specialized knowledge of the chemicals and processes used by this type of business? **Answer:** No.
- Are you aware of commonly known or reasonably ascertainable information about the Site that would help the environmental professional to identify conditions indicative of releases or threatened releases? **Answer:** No
- Do you know the past uses of the Site? **Answer:** No

- Do you know of spills or other chemical releases that have occurred at the Site?
Answer: No
- Do you know of any environmental cleanups that have occurred at the Site?
Answer: No
- Do you know of any pending, threatened, or past litigation relevant to hazardous substances or petroleum products in, on, or from the Site? **Answer:** No
- Do you know of any pending, threatened, or past administrative proceedings relevant to hazardous substances or petroleum products in, on, or from the Site?
Answer: No
- Do you know of any notices from any governmental entity regarding any possible violation of environmental laws or possible liability relating to hazardous substances or petroleum products? **Answer:** No

4.5.4 Commonly Known or Reasonably Ascertainable Information

The representative of the Client was asked the following question as part of the assessment:

- Based on your knowledge and experience related to the Site, are there any obvious indicators that point to the presence or likely presence of contamination at the Site?
Answer: No.

4.5.5 Valuation Reduction for Environmental Issues

Since Bank of America or related subsidiary is the current owner of the Site, Bank of America has not conducted an analysis of a hypothetical prospective purchase price.

4.5.6 Owner, Property Manager and Occupant Information

According to the DuPage County Assessor's Office, the Site is owned by Bank of America. The site is currently occupied by Bank of America.

4.5.7 Reason for Performing Phase I

The Phase I ESA is being performed to evaluate the present environmental status of the Site.

4.5.8 Other Information

No other pertinent information is available.

4.6 Results of Limited ACM Screening

LFR reviewed a Comprehensive Asbestos Survey Report completed by LFR dated March 3, 2008 that summarized the collection of suspect ACM taken prior to installation of new equipment within the banking center. A total of 29 samples of terrazzo floor tile, textured paint, 2' x 2' suspended ceiling tile, wallpaper, drywall, joint compound, cove base mastic, vapor barrier attached to the fiberglass thermal system insulation, 1" x 1" brown brick ceramic floor tile, 4" x 4" white ceramic tile, fiberglass pipe wrap, 9" x 9" brick ceramic floor tile, 12" x 12" off-white floor tile and mastic, 18" x 18" dark beige floor tile and mastic, stair treads and mastic, and canopy material were collected and sent for analysis. The 12" x 12" off-white floor tile and associated mastic were found to contain 1-5% Chrysotile asbestos. The floor tile is located in the janitor's closet on the first floor. None of the other materials sampled and analyzed contained asbestos.

A copy of the asbestos survey report is included in Appendix E.

4.7 Results of Radon Investigation

The Site building is used for commercial purposes and testing for radon was not conducted as part of this assessment.

4.8 Results of Mold Investigation

LFR did not conduct a mold investigation as part of this assessment.

5.0 FINDINGS AND CONCLUSIONS

5.1 Known or Suspect RECs

Based upon the information obtained during the Phase I ESA, this assessment has revealed no environmental concerns in connection with the Site, except for the ACM.

5.2 de minimis Conditions

No *de minimis* conditions were identified during this assessment.

5.3 Deviations/Data Gaps

The report deviates from the ASTM E1527-05 standard in that it has been prepared in accordance with a table of contents recommended by Bank of America. The informational content of the report and the objective of the Phase I ESA generally conform to the standard.

Not being able to trace the use of the property back to 1940, or its first developed use, whichever is earlier represents a data gap as defined by ASTM E1527-05. However, LFR opines that such data gaps do not prevent the ability of LFR to render the following conclusion.

5.4 Conclusions

LFR has performed a Phase I Environmental Site Assessment (ESA) in general conformance with the scope and limitations of ASTM Practice E 1527 of 22W151 Butterfield Road in Glen Ellyn, DuPage County, Illinois. Any exceptions to, or deletions from, this practice are described in Section 5.3 of this report. This assessment has revealed no evidence of RECs in connection with the Site, except for the ACM.

6.0 LIMITATIONS

The opinions and recommendations presented in this report are based upon the scope of services, information obtained through the performance of the services, and the schedule as agreed upon by LFR and the original party for whom this report was originally prepared. This report is an instrument of professional service and was prepared in accordance with the generally accepted standards and level of skill and care under similar conditions and circumstances established by the environmental consulting industry. To the extent that LFR relied upon any information prepared by other parties not under contract to LFR, LFR makes no representation as to the accuracy or completeness of such information. Only the party for whom this report was originally prepared, and other specifically named parties, may make use of and rely upon the information in this report, in its entirety, for a period not to exceed 180 days in accordance with the American Society for Testing and Materials' (ASTM's) "Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process" ASTM Designation E 1527-00 dated May 10, 2000, ASTM's "Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process" ASTM Designation E 1527-05 dated November 1, 2005, and/or the Code of Federal Regulations (CFR) 40CFR Part 312 "Standards and Practices for All Appropriate Inquiries: Final Rule" dated November 1, 2005. After 180 days and prior to using the information contained herein, the report should be updated in accordance with ASTM Standards and Federal regulations.

The findings presented in this report apply solely to site conditions existing at the time when LFR's assessment was performed. It must be recognized, however, that an Environmental Site Assessment ("ESA") is intended for the purpose of evaluating the potential for contamination through limited research and investigative activities and in no way represents a conclusive or complete site characterization. Conditions in other parts of the project site may vary from those at the locations where data were collected. LFR's ability to interpret investigation results is related to the availability of the data and the extent of the investigation activities. As such, 100% confidence in ESA conclusions cannot reasonably be achieved.

LFR, therefore, does not provide any guarantees, certifications, or warranties (express or implied) that a property is free from environmental contamination. Furthermore, nothing contained in this document shall relieve any other party of its responsibility to abide by contract documents and all applicable laws, codes, regulations, or standards.

7.0 REFERENCES

Record of Personal Communications

Site:

- Ms. Erin Bergin, representing Bank of America property management

Village of Glen Ellyn:

- Building Department
- Planning/Engineering Department
- Fire Department
- Utility Department
- Health Department

DuPage County:

- Building Department
- Health Department

State of Illinois:

- Illinois Environmental Protection Agency
 - o Bureau of Land, Water, and Air
 - o Office of Emergency Response
- Office of the State Fire Marshal

Map, Aerial Photo and Other Geographic References

Environmental Data Resources, Inc. - The EDR Radius Map with GeoCheck®, 22W151 Butterfield Road, Glen Ellyn, Illinois, July 10, 2009.

Environmental Data Resources, Inc. - The EDR Aerial Photo Decade Package - 1952, 1971, 1983, 1988, 1993, 1994, 2005 and 2006, 22W151 Butterfield Road, Glen Ellyn, Illinois, July 10, 2009.


Environmental Data Resources, Inc. - Certified Sanborn Map Report - No Coverage Available, 22W151 Butterfield Road, Glen Ellyn, Illinois, July 10, 2009.

Environmental Data Resources, Inc. - EDR Historical Topographic Map Report - 1949, 1954, 1962, 1972, 1980, 1993 and 1998, 22W151 Butterfield Road, Glen Ellyn, Illinois, July 10, 2009.

Environmental Data Resources, Inc. - EDR City Directory Abstract- 1976, 1986, 1990, 1995, 2000, and 2007, 22W151 Butterfield Road, Glen Ellyn, Illinois, July 14, 2009.

8.0 STATEMENT OF ENVIRONMENTAL PROFESSIONAL(S)

We declare that, to the best of our professional knowledge and belief, we meet the definition of environmental professional as defined in §312.10 of 40 C.F.R. 312. We have the specific qualifications based on education, training, and experience to assess a property of the nature, history, and setting of the subject property. We have developed and performed the all appropriate inquiries in conformance with the standards and practices set forth in 40 C.F.R. Part 312.




Morgan L. Vogt
Senior Staff Geologist




Douglas M. Lindsay, PG
Senior Geologist

FIGURES

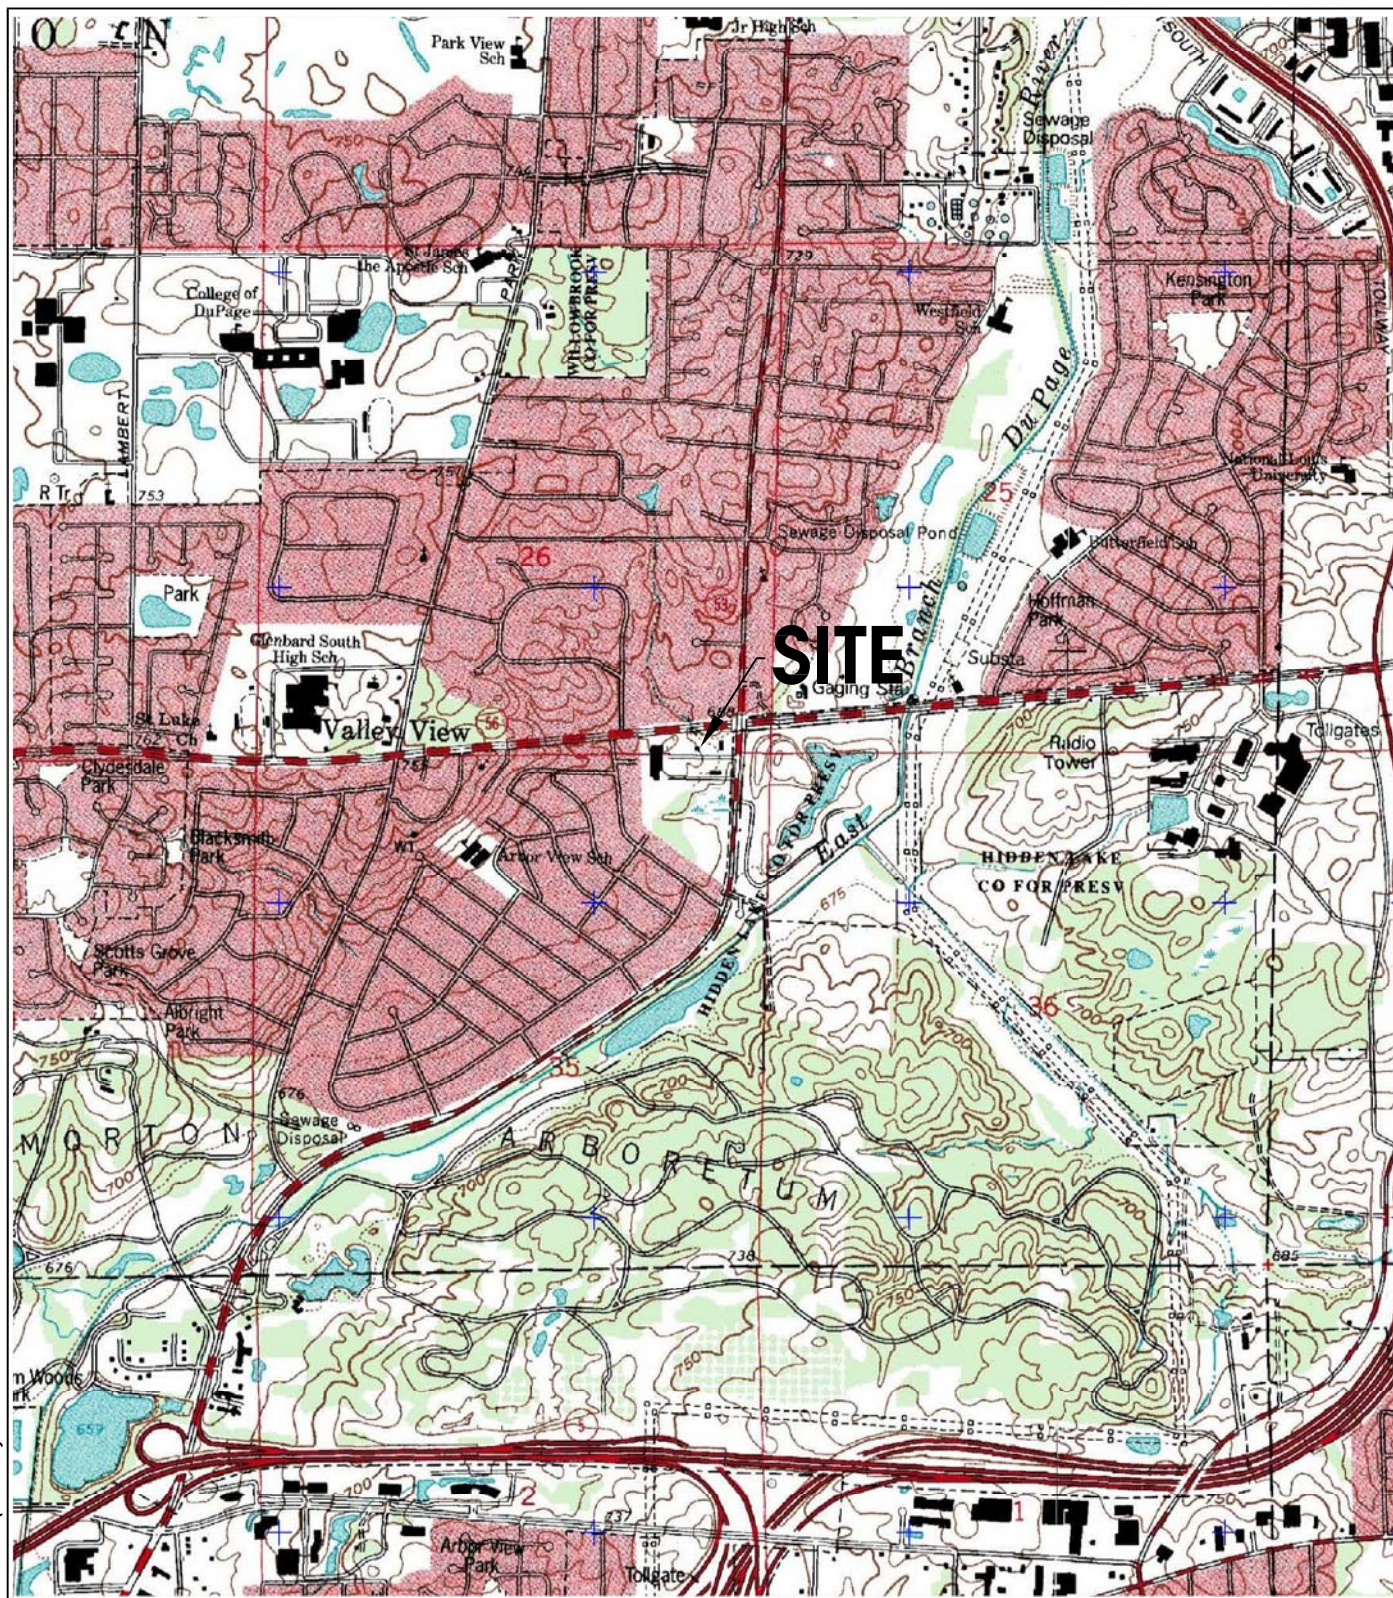


Source:
Wheaton, Illinois (1993)
USGS 7.5 Minute Series
Quadrangle Map

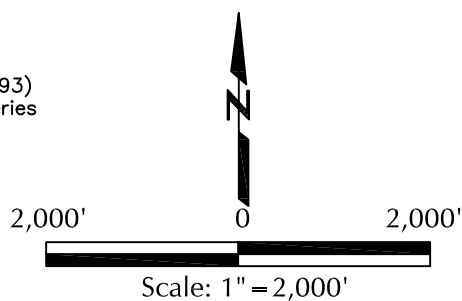

Site Location Map

22W151 Butterfield Road
Glen Ellyn, Illinois

Figure 1

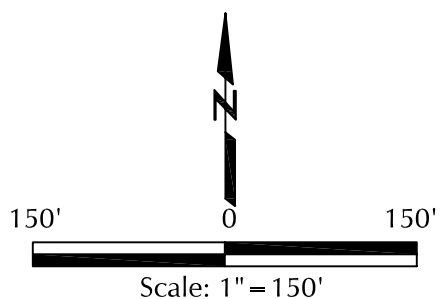

Site Plan

22W151 Butterfield Road
Glen Ellyn, Illinois

Figure 2

APPENDIX A

Site Photographs



Photograph #1

Description of Photograph:

View of the Site building from the southeast.

Site Location:

22W151 Butterfield Road
Glen Ellyn, Illinois

Photograph Taken By:

Morgan Vogt

Date of Photograph:

July 15, 2009



Photograph #2

Description of Photograph:

View of the Site building from the west.

Site Location:

22W151 Butterfield Road
Glen Ellyn, Illinois

Photograph Taken By:

Morgan Vogt

Date of Photograph:

July 15, 2009



Photograph #3

Description of Photograph:

View of the Site building from the north.

Site Location:

22W151 Butterfield Road
Glen Ellyn, Illinois

Photograph Taken By:

Morgan Vogt

Date of Photograph:

July 15, 2009



Photograph #4

Description of Photograph:

View of the Site from the west.

Site Location:

22W151 Butterfield Road
Glen Ellyn, Illinois

Photograph Taken By:

Morgan Vogt

Date of Photograph:

July 15, 2009



Photograph #5

Description of Photograph:

View of the northeasterly adjacent property.

Site Location:

22W151 Butterfield Road
Glen Ellyn, Illinois

Photograph Taken By:

Morgan Vogt

Date of Photograph:

July 15, 2009



Photograph #6

Description of Photograph:

View of the easterly adjacent property.

Site Location:

22W151 Butterfield Road
Glen Ellyn, Illinois

Photograph Taken By:

Morgan Vogt

Date of Photograph:

July 15, 2009



Photograph #7

Description of Photograph:
View of the southerly adjoining property.

Site Location:
22W151 Butterfield Road
Glen Ellyn, Illinois

Photograph Taken By:
Morgan Vogt

Date of Photograph:
July 15, 2009



Photograph #8

Description of Photograph:
View of the westerly adjacent property.

Site Location:
22W151 Butterfield Road
Glen Ellyn, Illinois

Photograph Taken By:
Morgan Vogt

Date of Photograph:
July 15, 2009



Photograph #9

Description of Photograph:
Water heater room in the basement.

Site Location:
22W151 Butterfield Road
Glen Ellyn, Illinois

Photograph Taken By:
Morgan Vogt

Date of Photograph:
July 15, 2009



Photograph #10

Description of Photograph:
Storage area in the basement.

Site Location:
22W151 Butterfield Road
Glen Ellyn, Illinois

Photograph Taken By:
Morgan Vogt

Date of Photograph:
July 15, 2009



Photograph #11

Description of Photograph:
Sump room in the basement.

Site Location:
22W151 Butterfield Road
Glen Ellyn, Illinois

Photograph Taken By:
Morgan Vogt

Date of Photograph:
July 15, 2009

APPENDIX B


Regulatory Agency Database Information (EDR Report)

Bank of America

22W151 Butterfield Rd
Glen Ellyn, IL 60137

Inquiry Number: 2537497.32s
July 10, 2009

The EDR Radius Map™ Report with GeoCheck®

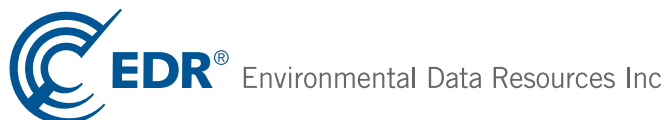

440 Wheelers Farms Road
Milford, CT 06461
Toll Free: 800.352.0050
www.edrnet.com

TABLE OF CONTENTS

<u>SECTION</u>	<u>PAGE</u>
Executive Summary	ES1
Overview Map	2
Detail Map	3
Map Findings Summary	4
Map Findings	7
Orphan Summary	19
Government Records Searched/Data Currency Tracking	GR-1
 <u>GEOCHECK ADDENDUM</u>	
Physical Setting Source Addendum	A-1
Physical Setting Source Summary	A-2
Physical Setting SSURGO Soil Map	A-5
Physical Setting Source Map	A-19
Physical Setting Source Map Findings	A-20
Physical Setting Source Records Searched	A-85

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2009 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

A search of available environmental records was conducted by Environmental Data Resources, Inc (EDR). The report was designed to assist parties seeking to meet the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E 1527-05) or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

TARGET PROPERTY INFORMATION

ADDRESS

22W151 BUTTERFIELD RD
GLEN ELLYN, IL 60137

COORDINATES

Latitude (North):	41.831200 - 41° 49' 52.3"
Longitude (West):	88.055200 - 88° 3' 18.7"
Universal Transverse Mercator:	Zone 16
UTM X (Meters):	412377.3
UTM Y (Meters):	4631359.5
Elevation:	691 ft. above sea level

USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property Map:	41088-G1 WHEATON, IL
Most Recent Revision:	1998

AERIAL PHOTOGRAPHY IN THIS REPORT

Portions of Photo from:	2005, 2006
Source:	USDA

TARGET PROPERTY SEARCH RESULTS

The target property was not listed in any of the databases searched by EDR.

DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable ") government records either on the target property or within the search radius around the target property for the following databases:

STANDARD ENVIRONMENTAL RECORDS

Federal NPL site list

NPL..... National Priority List

EXECUTIVE SUMMARY

Proposed NPL..... Proposed National Priority List Sites
NPL LIENS..... Federal Superfund Liens

Federal Delisted NPL site list

Delisted NPL..... National Priority List Deletions

Federal CERCLIS list

CERCLIS..... Comprehensive Environmental Response, Compensation, and Liability Information System

Federal CERCLIS NFRAP site List

CERC-NFRAP..... CERCLIS No Further Remedial Action Planned

Federal RCRA CORRACTS facilities list

CORRACTS..... Corrective Action Report

Federal RCRA non-CORRACTS TSD facilities list

RCRA-TSDF..... RCRA - Transporters, Storage and Disposal

Federal RCRA generators list

RCRA-LQG..... RCRA - Large Quantity Generators
RCRA-CESQG..... RCRA - Conditionally Exempt Small Quantity Generator

Federal institutional controls / engineering controls registries

US ENG CONTROLS..... Engineering Controls Sites List
US INST CONTROL..... Sites with Institutional Controls

Federal ERNS list

ERNS..... Emergency Response Notification System

State- and tribal - equivalent NPL

CAT..... Category List

State- and tribal - equivalent CERCLIS

SHWS..... State Oversight List

State and tribal landfill and/or solid waste disposal site lists

SWF/LF..... Available Disposal for Solid Waste in Illinois - Solid Waste Landfills Subject to
State Surcharge
IL NIPC..... Solid Waste Landfill Inventory

State and tribal leaking storage tank lists

LUST TRUST..... Underground Storage Tank Fund Payment Priority List
INDIAN LUST..... Leaking Underground Storage Tanks on Indian Land

EXECUTIVE SUMMARY

State and tribal registered storage tank lists

INDIAN UST..... Underground Storage Tanks on Indian Land

State and tribal institutional control / engineering control registries

ENG CONTROLS..... Sites with Engineering Controls

INST CONTROL..... Institutional Controls

State and tribal voluntary cleanup sites

INDIAN VCP..... Voluntary Cleanup Priority Listing

SRP..... Site Remediation Program Database

State and tribal Brownfields sites

BROWNFIELDS..... Municipal Brownfields Redevelopment Grant Program Project Descriptions

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS..... A Listing of Brownfields Sites

Local Lists of Landfill / Solid Waste Disposal Sites

ODI..... Open Dump Inventory

DEBRIS REGION 9..... Torres Martinez Reservation Illegal Dump Site Locations

INDIAN ODI..... Report on the Status of Open Dumps on Indian Lands

Local Lists of Hazardous waste / Contaminated Sites

US CDL..... Clandestine Drug Labs

CDL..... Meth Drug Lab Site Listing

Local Land Records

LIENS 2..... CERCLA Lien Information

LUCIS..... Land Use Control Information System

Records of Emergency Release Reports

HMIRS..... Hazardous Materials Information Reporting System

SPILLS..... State spills

Other Ascertainable Records

DOT OPS..... Incident and Accident Data

DOD..... Department of Defense Sites

FUDS..... Formerly Used Defense Sites

CONSENT..... Superfund (CERCLA) Consent Decrees

ROD..... Records Of Decision

UMTRA..... Uranium Mill Tailings Sites

EXECUTIVE SUMMARY

MINES.....	Mines Master Index File
TRIS.....	Toxic Chemical Release Inventory System
TSCA.....	Toxic Substances Control Act
FTTS.....	FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)
HIST FTTS.....	FIFRA/TSCA Tracking System Administrative Case Listing
SSTS.....	Section 7 Tracking Systems
ICIS.....	Integrated Compliance Information System
PADS.....	PCB Activity Database System
MLTS.....	Material Licensing Tracking System
RADINFO.....	Radiation Information Database
FINDS.....	Facility Index System/Facility Registry System
RAATS.....	RCRA Administrative Action Tracking System
UIC.....	Underground Injection Wells
NPDES.....	A Listing of Active Permits
DRYCLEANERS.....	Illinois Licensed Drycleaners
IMPDMNT.....	Surface Impoundment Inventory
AIRS.....	AIRS
INDIAN RESERV.....	Indian Reservations
SCRD DRYCLEANERS.....	State Coalition for Remediation of Drycleaners Listing

EDR PROPRIETARY RECORDS

EDR Proprietary Records

Manufactured Gas Plants.....	EDR Proprietary Manufactured Gas Plants
EDR Historical Auto Stations..	EDR Proprietary Historic Gas Stations
EDR Historical Cleaners.....	EDR Proprietary Historic Dry Cleaners

SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified in the following databases.

Elevations have been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property. Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in ***bold italics*** are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

STANDARD ENVIRONMENTAL RECORDS

Federal RCRA generators list

RCRA-SQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or

EXECUTIVE SUMMARY

dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

A review of the RCRA-SQG list, as provided by EDR, and dated 11/12/2008 has revealed that there is 1 RCRA-SQG site within approximately 0.25 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
MOBIL OIL CORP SS J7M	22W070 BUTTERFIELD RD	ESE 0 - 1/8 (0.052 mi.)	A4	12

State and tribal leaking storage tank lists

LUST: The Leaking Underground Storage Tank Incident Reports contain an inventory of reported leaking underground storage tank incidents. The data come from the Illinois Environmental Protection Agency's LUST Incident Report.

A review of the LUST list, as provided by EDR, and dated 05/15/2009 has revealed that there are 5 LUST sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
AMOCO OIL CO.	22W 555 BUTTERFIELD RD.	W 1/4 - 1/2 (0.465 mi.)	10	18
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
SHELL OIL PRODUCTS U.S. NFA/NFR Letter: 12/6/2004	22 WEST 030 BUTTERFIELD	E 1/8 - 1/4 (0.155 mi.)	B6	15
MOBIL OIL CORP.	22W070 BUTTERFIELD RD.	E 1/8 - 1/4 (0.155 mi.)	B7	16
MOBIL OIL CORP.	22 WEST 070 BUTTERFIELD	E 1/8 - 1/4 (0.155 mi.)	B8	17
EXXON MOBIL	22W070 BUTTERFIELD RD.	E 1/8 - 1/4 (0.155 mi.)	B9	17

State and tribal registered storage tank lists

UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the Illinois State Fire Marshal's STC Facility List.

A review of the UST list, as provided by EDR, and dated 05/19/2009 has revealed that there are 3 UST sites within approximately 0.25 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
SHELL SERVICE STATION	22 W 030 BUTTERFIELD	E 0 - 1/8 (0.047 mi.)	A2	8
MOBIL SS 05-J7M	22 WEST 70 BUTTERFIELD	E 0 - 1/8 (0.047 mi.)	A3	10
AMOCO SS#15868 FAC#26972	2 S 780 RT 53 & BUTTERF	SSW 0 - 1/8 (0.103 mi.)	5	14

ADDITIONAL ENVIRONMENTAL RECORDS

Other Ascertainable Records

EXECUTIVE SUMMARY

RCRA-NonGen: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

A review of the RCRA-NonGen list, as provided by EDR, and dated 11/12/2008 has revealed that there is 1 RCRA-NonGen site within approximately 0.25 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
<i>SHELL OIL CO</i>	<i>22 W 030 BUTTERFIELD AN</i>	<i>E 0 - 1/8 (0.047 mi.)</i>	<i>A1</i>	<i>7</i>

EXECUTIVE SUMMARY

Due to poor or inadequate address information, the following sites were not mapped:


Site Name

BRUSS NURSERY
PARK BUTTERFIELD AMOCO
IDOT ROUTE #83

Database(s)

FINDS, SWF/LF
FINDS, RCRA-CESQG
SRP

OVERVIEW MAP - 2537497.32s

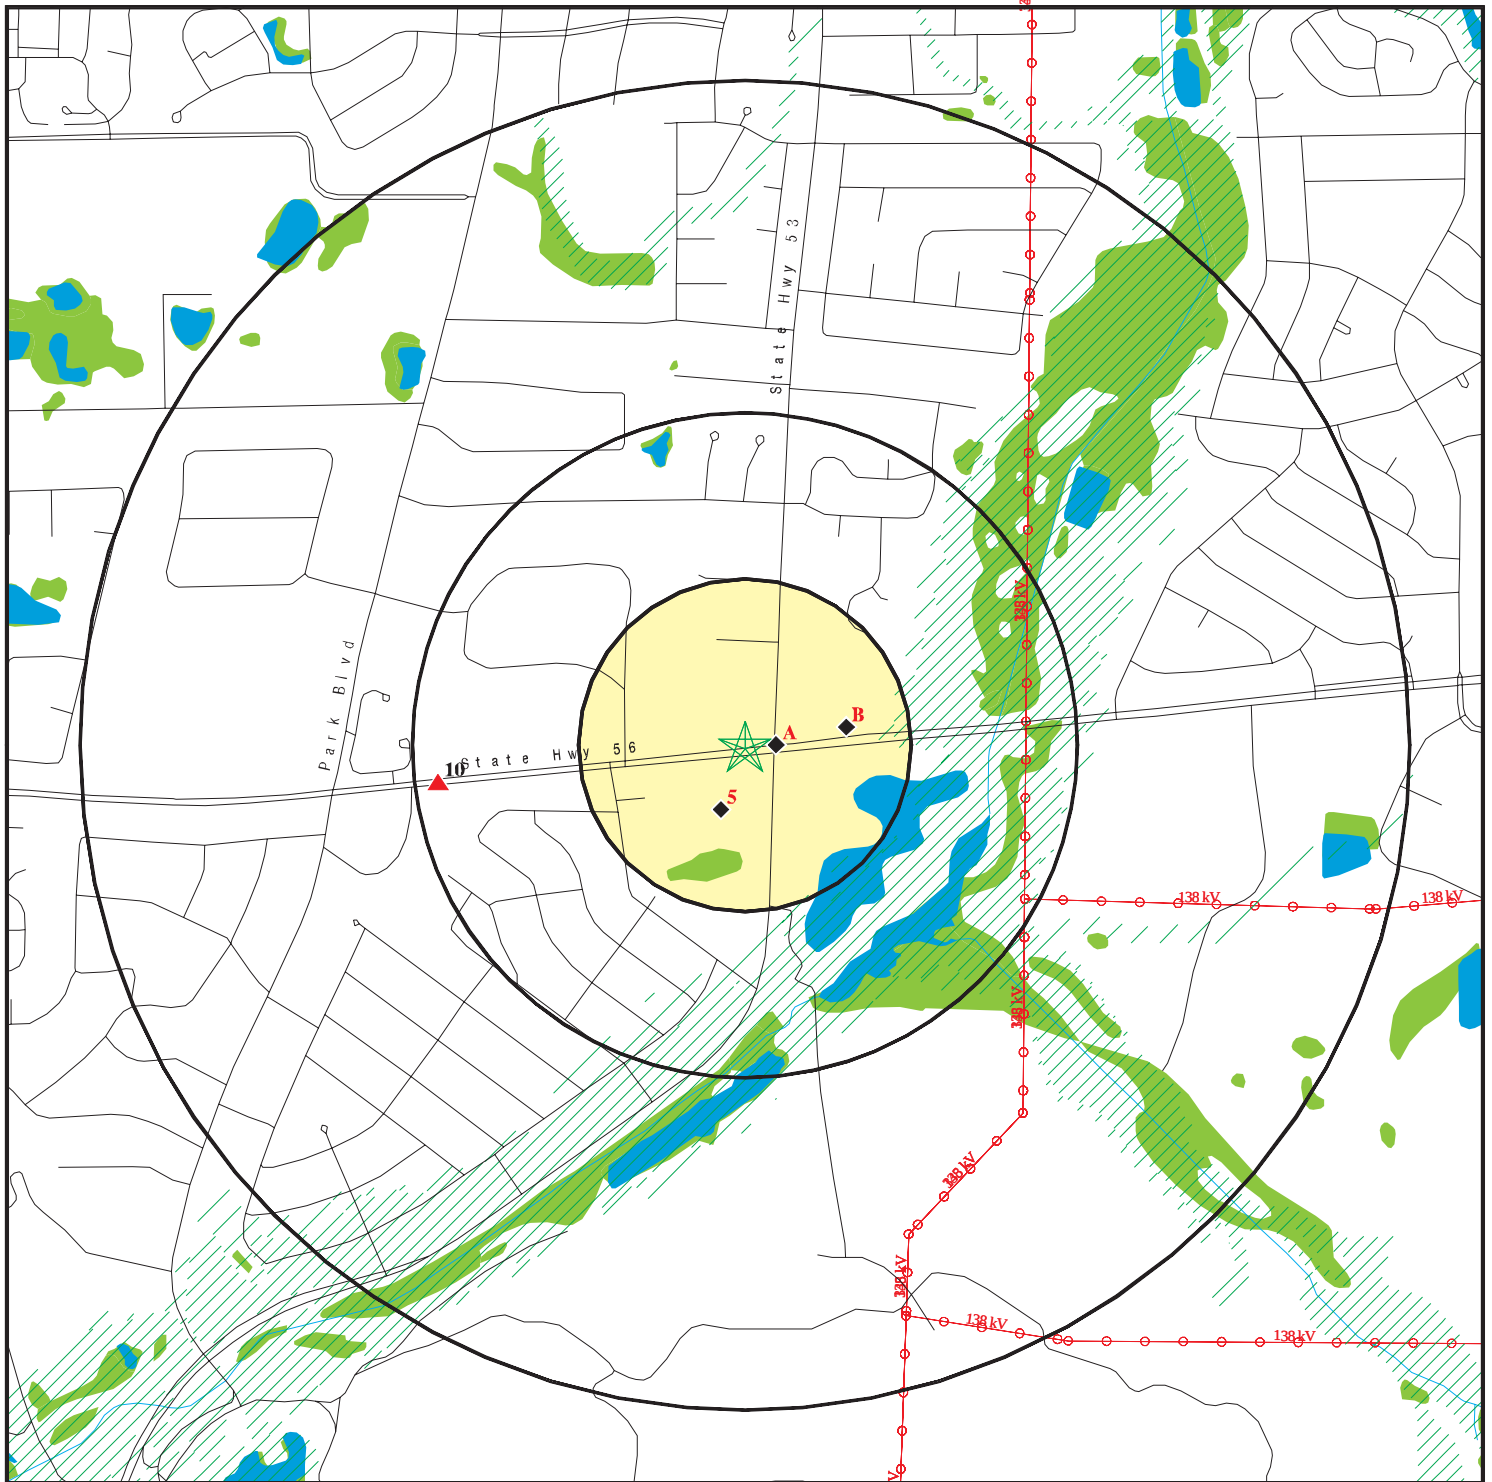

- ★ Target Property
- ▲ Sites at elevations higher than or equal to the target property
- ◆ Sites at elevations lower than the target property
- ▲ Manufactured Gas Plants
- National Priority List Sites
- Dept. Defense Sites
- Indian Reservations BIA
- Power transmission lines
- Oil & Gas pipelines
- ▨ 100-year flood zone
- ▨ 500-year flood zone
- National Wetland Inventory

0 1/4 1/2 1 Miles



This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME: Bank of America
 ADDRESS: 22W151 Butterfield Rd
 Glen Ellyn IL 60137
 LAT/LONG: 41.8312 / 88.0552

CLIENT: LFR Inc
 CONTACT: Morgan Vogt
 INQUIRY #: 2537497.32s
 DATE: July 10, 2009 11:46 am

DETAIL MAP - 2537497.32s



- ★ Target Property
- ▲ Sites at elevations higher than or equal to the target property
- ◆ Sites at elevations lower than the target property
- ⚙ Manufactured Gas Plants
- ⚠ Sensitive Receptors
- 🏠 National Priority List Sites
- 🏠 Dept. Defense Sites

- Indian Reservations BIA
- Oil & Gas pipelines
- 100-year flood zone
- 500-year flood zone
- National Wetland Inventory

0 1/16 1/8 1/4 Miles



This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME: Bank of America
 ADDRESS: 22W151 Butterfield Rd
 Glen Ellyn IL 60137
 LAT/LONG: 41.8312 / 88.0552

CLIENT: LFR Inc
 CONTACT: Morgan Vogt
 INQUIRY #: 2537497.32s
 DATE: July 10, 2009 11:47 am

MAP FINDINGS SUMMARY

Database	Target Property	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
<u>STANDARD ENVIRONMENTAL RECORDS</u>								
<i>Federal NPL site list</i>								
NPL		1.000	0	0	0	0	NR	0
Proposed NPL		1.000	0	0	0	0	NR	0
NPL LIENS		TP	NR	NR	NR	NR	NR	0
<i>Federal Delisted NPL site list</i>								
Delisted NPL		1.000	0	0	0	0	NR	0
<i>Federal CERCLIS list</i>								
CERCLIS		0.500	0	0	0	NR	NR	0
<i>Federal CERCLIS NFRAP site List</i>								
CERC-NFRAP		0.500	0	0	0	NR	NR	0
<i>Federal RCRA CORRACTS facilities list</i>								
CORRACTS		1.000	0	0	0	0	NR	0
<i>Federal RCRA non-CORRACTS TSD facilities list</i>								
RCRA-TSDF		0.500	0	0	0	NR	NR	0
<i>Federal RCRA generators list</i>								
RCRA-LQG		0.250	0	0	NR	NR	NR	0
RCRA-SQG		0.250	1	0	NR	NR	NR	1
RCRA-CESQG		0.250	0	0	NR	NR	NR	0
<i>Federal institutional controls / engineering controls registries</i>								
US ENG CONTROLS		0.500	0	0	0	NR	NR	0
US INST CONTROL		0.500	0	0	0	NR	NR	0
<i>Federal ERNS list</i>								
ERNS		TP	NR	NR	NR	NR	NR	0
<i>State- and tribal - equivalent NPL</i>								
CAT		1.000	0	0	0	0	NR	0
<i>State- and tribal - equivalent CERCLIS</i>								
SHWS		1.000	0	0	0	0	NR	0
<i>State and tribal landfill and/or solid waste disposal site lists</i>								
SWF/LF		0.500	0	0	0	NR	NR	0
IL NIPC		0.500	0	0	0	NR	NR	0
<i>State and tribal leaking storage tank lists</i>								
LUST		0.500	0	4	1	NR	NR	5
LUST TRUST		0.500	0	0	0	NR	NR	0

MAP FINDINGS SUMMARY

Database	Target Property	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
INDIAN LUST		0.500	0	0	0	NR	NR	0
State and tribal registered storage tank lists								
UST		0.250	3	0	NR	NR	NR	3
INDIAN UST		0.250	0	0	NR	NR	NR	0
State and tribal institutional control / engineering control registries								
ENG CONTROLS		0.500	0	0	0	NR	NR	0
INST CONTROL		0.500	0	0	0	NR	NR	0
State and tribal voluntary cleanup sites								
INDIAN VCP		0.500	0	0	0	NR	NR	0
SRP		0.500	0	0	0	NR	NR	0
State and tribal Brownfields sites								
BROWNFIELDS		0.500	0	0	0	NR	NR	0
<u>ADDITIONAL ENVIRONMENTAL RECORDS</u>								
Local Brownfield lists								
US BROWNFIELDS		0.500	0	0	0	NR	NR	0
Local Lists of Landfill / Solid Waste Disposal Sites								
ODI		0.500	0	0	0	NR	NR	0
DEBRIS REGION 9		0.500	0	0	0	NR	NR	0
INDIAN ODI		0.500	0	0	0	NR	NR	0
Local Lists of Hazardous waste / Contaminated Sites								
US CDL		TP	NR	NR	NR	NR	NR	0
CDL		TP	NR	NR	NR	NR	NR	0
Local Land Records								
LIENS 2		TP	NR	NR	NR	NR	NR	0
LUCIS		0.500	0	0	0	NR	NR	0
Records of Emergency Release Reports								
HMIRS		TP	NR	NR	NR	NR	NR	0
SPILLS		TP	NR	NR	NR	NR	NR	0
Other Ascertainable Records								
RCRA-NonGen		0.250	1	0	NR	NR	NR	1
DOT OPS		TP	NR	NR	NR	NR	NR	0
DOD		1.000	0	0	0	0	NR	0
FUDS		1.000	0	0	0	0	NR	0
CONSENT		1.000	0	0	0	0	NR	0
ROD		1.000	0	0	0	0	NR	0
UMTRA		0.500	0	0	0	NR	NR	0

MAP FINDINGS SUMMARY

Database	Target Property	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
MINES		0.250	0	0	NR	NR	NR	0
TRIS		TP	NR	NR	NR	NR	NR	0
TSCA		TP	NR	NR	NR	NR	NR	0
FTTS		TP	NR	NR	NR	NR	NR	0
HIST FTTS		TP	NR	NR	NR	NR	NR	0
SSTS		TP	NR	NR	NR	NR	NR	0
ICIS		TP	NR	NR	NR	NR	NR	0
PADS		TP	NR	NR	NR	NR	NR	0
MLTS		TP	NR	NR	NR	NR	NR	0
RADINFO		TP	NR	NR	NR	NR	NR	0
FINDS		TP	NR	NR	NR	NR	NR	0
RAATS		TP	NR	NR	NR	NR	NR	0
UIC		TP	NR	NR	NR	NR	NR	0
NPDES		TP	NR	NR	NR	NR	NR	0
DRYCLEANERS		0.250	0	0	NR	NR	NR	0
IMPDMENT		0.500	0	0	0	NR	NR	0
AIRS		TP	NR	NR	NR	NR	NR	0
INDIAN RESERV		1.000	0	0	0	0	NR	0
SCRD DRYCLEANERS		0.500	0	0	0	NR	NR	0

EDR PROPRIETARY RECORDS

EDR Proprietary Records

Manufactured Gas Plants	1.000	0	0	0	0	NR	0
EDR Historical Auto Stations	0.250	0	0	NR	NR	NR	0
EDR Historical Cleaners	0.250	0	0	NR	NR	NR	0

NOTES:

TP = Target Property

NR = Not Requested at this Search Distance

Sites may be listed in more than one database

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

A1
East
< 1/8
0.047 mi.
248 ft.
SHELL OIL CO
22 W 030 BUTTERFIELD AND I53
GLEN ELLYN, IL 60137
Site 1 of 4 in cluster A

FINDS **1000824833**
RCRA-NonGen **ILD984912121**

Relative: FINDS:
Lower Other Pertinent Environmental Activity Identified at Site

Actual: Registry ID: 110007549144
689 ft.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

RCRA-NonGen:

Date form received by agency: 07/18/2002
Facility name: SHELL OIL CO
Facility address: 22 W 030 BUTTERFIELD AND I53
GLEN ELLYN, IL 60137
EPA ID: ILD984912121
Mailing address: 1415 W 22ND ST
OAK BROOK, IL 60522
Contact: EDWARD FEELY
Contact address: 1415 W 22ND ST
OAK BROOK, IL 60522
Contact country: US
Contact telephone: (708) 572-5727
Contact email: Not reported
EPA Region: 05
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: SHELL OIL CO
Owner/operator address: 1415 W 22ND ST
OAK BROOK, IL 60522
Owner/operator country: Not reported
Owner/operator telephone: (708) 572-5500
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 01/01/0001
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: Unknown
Mixed waste (haz. and radioactive): Unknown
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: Unknown
Furnace exemption: Unknown
Used oil fuel burner: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHELL OIL CO (Continued)

1000824833

Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No
Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 03/01/2000
Facility name: SHELL OIL CO
Site name: GLEN BRIAR SHELL
Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 02/08/1993
Facility name: SHELL OIL CO
Classification: Small Quantity Generator

Hazardous Waste Summary:

Waste code: D000
Waste name: Not Defined

Waste code: D001
Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Waste code: D008
Waste name: LEAD

Waste code: D018
Waste name: BENZENE

Violation Status: No violations found

A2
East
< 1/8
0.047 mi.
248 ft.

SHELL SERVICE STATION
22 W 030 BUTTERFIELD
GLEN ELLYN, IL 60137
Site 2 of 4 in cluster A

UST U001144347
N/A

Relative:
Lower

UST:
Facility ID: 2021188
Facility Status: Closed
Facility Type: Golf Course
Owner Name: Equilon Enterprises, LLC
Owner Id: U0027449
Owner Address: 603 Diehl Road, Suite 103
Owner City, St, Zip: Naperville, IL 60563

Actual:
689 ft.

Tank Number: 1
Tank Capacity: 10000
Tank Substance: Gasoline
Last Used Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHELL SERVICE STATION (Continued)

U001144347

OSFM First Notify Date: 5/5/1986
Tank Status: **Removed**
Red Tag Issue Date: Not reported
Install Date: 1/1/1972
Green Tag Decal: **B001623**
Green Tag Issue Date: **4/28/2000**
Green Tag Expire Date: **12/31/2003**
Self Service Permit Inspection Date: **Not reported**
Self Service Permit Expire Date: **Not reported**

Tank Number: 2
Tank Capacity: 10000
Tank Substance: Gasoline
Last Used Date: Not reported
OSFM First Notify Date: 5/5/1986
Tank Status: **Removed**
Red Tag Issue Date: Not reported
Install Date: 1/1/1972
Green Tag Decal: **B001623**
Green Tag Issue Date: **4/28/2000**
Green Tag Expire Date: **12/31/2003**
Self Service Permit Inspection Date: **Not reported**
Self Service Permit Expire Date: **Not reported**

Tank Number: 3
Tank Capacity: 8000
Tank Substance: Gasoline
Last Used Date: Not reported
OSFM First Notify Date: 5/5/1986
Tank Status: **Removed**
Red Tag Issue Date: Not reported
Install Date: 1/1/1972
Green Tag Decal: **B001623**
Green Tag Issue Date: **4/28/2000**
Green Tag Expire Date: **12/31/2003**
Self Service Permit Inspection Date: **Not reported**
Self Service Permit Expire Date: **Not reported**

Tank Number: 4
Tank Capacity: 1000
Tank Substance: Used Oil
Last Used Date: Not reported
OSFM First Notify Date: 5/5/1986
Tank Status: **Removed**
Red Tag Issue Date: Not reported
Install Date: 1/1/1985
Green Tag Decal: **B001623**
Green Tag Issue Date: **4/28/2000**
Green Tag Expire Date: **12/31/2003**
Self Service Permit Inspection Date: **Not reported**
Self Service Permit Expire Date: **Not reported**

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

A3
East
< 1/8
0.047 mi.
248 ft.

MOBIL SS 05-J7M
22 WEST 70 BUTTERFIELD ROAD, ROUTE 53
GLEN ELLYN, IL 60137

UST U001144342
N/A

Site 3 of 4 in cluster A

Relative:
Lower

UST:

Actual:
689 ft.

Facility ID: 2009149
Facility Status: Active
Facility Type: Self-Service Station
Owner Name: Exxon Mobil Oil Corporation
Owner Id: U0010471
Owner Address: 7300 West Friendly Avenue, P.O. Box 22087 CMS Mailstop F-76
Owner City,St,Zip: Greensboro, NC 274202087

Tank Number: 1
Tank Capacity: 4000
Tank Substance: Diesel Fuel
Last Used Date: 9/1/1991
OSFM First Notify Date: 5/5/1986
Tank Status: Removed
Red Tag Issue Date: Not reported
Install Date: 6/1/1973
Green Tag Decal: I000741
Green Tag Issue Date: 10/2/2007
Green Tag Expire Date: 12/31/2009
Self Service Permit Inspection Date: 11/30/2007
Self Service Permit Expire Date: 12/31/2009

Tank Number: 10
Tank Capacity: 8000
Tank Substance: Diesel Fuel
Last Used Date: Not reported
OSFM First Notify Date: 5/7/1992
Tank Status: Currently in use
Red Tag Issue Date: Not reported
Install Date: 10/1/1991
Green Tag Decal: I000741
Green Tag Issue Date: 10/2/2007
Green Tag Expire Date: 12/31/2009
Self Service Permit Inspection Date: 11/30/2007
Self Service Permit Expire Date: 12/31/2009

Tank Number: 11
Tank Capacity: 550
Tank Substance: Heating Oil
Last Used Date: 11/1/1994
OSFM First Notify Date: 10/22/1991
Tank Status: Removed
Red Tag Issue Date: Not reported
Install Date: 1/1/1985
Green Tag Decal: I000741
Green Tag Issue Date: 10/2/2007
Green Tag Expire Date: 12/31/2009
Self Service Permit Inspection Date: 11/30/2007
Self Service Permit Expire Date: 12/31/2009

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL SS 05-J7M (Continued)

U001144342

Tank Number: 2
Tank Capacity: 8000
Tank Substance: Gasoline
Last Used Date: 9/1/1991
OSFM First Notify Date: 5/5/1986
Tank Status: Removed
Red Tag Issue Date: Not reported
Install Date: 6/1/1973
Green Tag Decal: I000741
Green Tag Issue Date: 10/2/2007
Green Tag Expire Date: 12/31/2009
Self Service Permit Inspection Date: 11/30/2007
Self Service Permit Expire Date: 12/31/2009

Tank Number: 3
Tank Capacity: 12000
Tank Substance: Gasoline
Last Used Date: 9/1/1991
OSFM First Notify Date: 5/5/1986
Tank Status: Removed
Red Tag Issue Date: Not reported
Install Date: 6/1/1973
Green Tag Decal: I000741
Green Tag Issue Date: 10/2/2007
Green Tag Expire Date: 12/31/2009
Self Service Permit Inspection Date: 11/30/2007
Self Service Permit Expire Date: 12/31/2009

Tank Number: 4
Tank Capacity: 6000
Tank Substance: Gasoline
Last Used Date: 9/1/1991
OSFM First Notify Date: 5/5/1986
Tank Status: Removed
Red Tag Issue Date: Not reported
Install Date: 6/1/1973
Green Tag Decal: I000741
Green Tag Issue Date: 10/2/2007
Green Tag Expire Date: 12/31/2009
Self Service Permit Inspection Date: 11/30/2007
Self Service Permit Expire Date: 12/31/2009

Tank Number: 5
Tank Capacity: 550
Tank Substance: Used Oil
Last Used Date: 10/1/1985
OSFM First Notify Date: 5/5/1986
Tank Status: Removed
Red Tag Issue Date: Not reported
Install Date: 6/1/1981
Green Tag Decal: I000741
Green Tag Issue Date: 10/2/2007
Green Tag Expire Date: 12/31/2009
Self Service Permit Inspection Date: 11/30/2007

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL SS 05-J7M (Continued)

U001144342

Self Service Permit Expire Date: 12/31/2009

Tank Number: 7
Tank Capacity: 12000
Tank Substance: Gasoline
Last Used Date: Not reported
OSFM First Notify Date: 5/7/1992
Tank Status: **Currently in use**
Red Tag Issue Date: Not reported
Install Date: 10/1/1991
Green Tag Decal: **I000741**
Green Tag Issue Date: **10/2/2007**
Green Tag Expire Date: **12/31/2009**
Self Service Permit Inspection Date:11/30/2007
Self Service Permit Expire Date: 12/31/2009

Tank Number: 8
Tank Capacity: 10000
Tank Substance: Gasoline
Last Used Date: Not reported
OSFM First Notify Date: 5/7/1992
Tank Status: **Currently in use**
Red Tag Issue Date: Not reported
Install Date: 10/1/1991
Green Tag Decal: **I000741**
Green Tag Issue Date: **10/2/2007**
Green Tag Expire Date: **12/31/2009**
Self Service Permit Inspection Date:11/30/2007
Self Service Permit Expire Date: 12/31/2009

Tank Number: 9
Tank Capacity: 10000
Tank Substance: Gasoline
Last Used Date: Not reported
OSFM First Notify Date: 5/7/1992
Tank Status: **Currently in use**
Red Tag Issue Date: Not reported
Install Date: 10/1/1991
Green Tag Decal: **I000741**
Green Tag Issue Date: **10/2/2007**
Green Tag Expire Date: **12/31/2009**
Self Service Permit Inspection Date:11/30/2007
Self Service Permit Expire Date: 12/31/2009

A4
ESE
< 1/8
0.052 mi.
276 ft.

MOBIL OIL CORP SS J7M
22W070 BUTTERFIELD RD
GLEN ELLYN, IL 60137
Site 4 of 4 in cluster A

RCRA-SQG **1000612231**
FINDS **ILD984824540**

Relative:
Lower

RCRA-SQG:
Date form received by agency: 03/01/2000
Facility name: MOBIL OIL CORP SS J7M
Site name: RED WINGS AUTO REPAIR-MOBIL
Facility address: 22W070 BUTTERFIELD RD

Actual:
687 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL OIL CORP SS J7M (Continued)

1000612231

GLEN ELLYN, IL 60137
EPA ID: ILD984824540
Mailing address: 181 HAWKINS CIR
WHEATON, IL 60187
Contact: HUSAM TILLAWI
Contact address: Not reported
Not reported
Contact country: Not reported
Contact telephone: (630) 665-6002
Contact email: Not reported
EPA Region: 05
Classification: Small Small Quantity Generator
Description: Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:

Owner/operator name: MOBIL OIL CORP
Owner/operator address: Not reported
Not reported
Owner/operator country: Not reported
Owner/operator telephone: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: Unknown
Mixed waste (haz. and radioactive): Unknown
Recycler of hazardous waste: Unknown
Transporter of hazardous waste: Unknown
Treater, storer or disposer of HW: No
Underground injection activity: Unknown
On-site burner exemption: Unknown
Furnace exemption: Unknown
Used oil fuel burner: Unknown
Used oil processor: Unknown
Used oil refiner: Unknown
Used oil fuel marketer to burner: Unknown
Used oil Specification marketer: Unknown
Used oil transfer facility: Unknown
Used oil transporter: Unknown
Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 05/10/1991
Facility name: MOBIL OIL CORP SS J7M
Classification: Small Quantity Generator

Hazardous Waste Summary:

Waste code: D000
Waste name: Not Defined

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL OIL CORP SS J7M (Continued)

1000612231

Waste code: D001
Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Waste code: D008
Waste name: LEAD

Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site

Registry ID: 110007542613

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

5
SSW
< 1/8
0.103 mi.
544 ft.

AMOCO SS#15868 FAC#26972
2 S 780 RT 53 & BUTTERFIELD RD
GLEN ELLYN, IL 60137

UST U001144320
N/A

Relative:
Lower

UST:

Facility ID: 2022790
Facility Status: Active
Facility Type: Self-Service Station
Owner Name: BP Products North America, Inc.
Owner Id: U0000552
Owner Address: P. O. Box 6038 Environmental Compliance Department
Owner City,St,Zip: Artesia, CA 90702

Actual:
689 ft.

Tank Number: 1
Tank Capacity: 1000
Tank Substance: Used Oil
Last Used Date: 1/1/1985
OSFM First Notify Date: 4/25/1986
Tank Status: Exempt from registration
Red Tag Issue Date: Not reported
Install Date: 1/1/1977
Green Tag Decal: J000685
Green Tag Issue Date: 7/17/2008
Green Tag Expire Date: 12/31/2010
Self Service Permit Inspection Date: 7/17/2008
Self Service Permit Expire Date: 12/31/2010

Tank Number: 2

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AMOCO SS#15868 FAC#26972 (Continued)

U001144320

Tank Capacity: 10000
Tank Substance: Gasoline
Last Used Date: Not reported
OSFM First Notify Date: 4/25/1986
Tank Status: Currently in use
Red Tag Issue Date: Not reported
Install Date: 1/1/1985
Green Tag Decal: J000685
Green Tag Issue Date: 7/17/2008
Green Tag Expire Date: 12/31/2010
Self Service Permit Inspection Date: 7/17/2008
Self Service Permit Expire Date: 12/31/2010

Tank Number: 3
Tank Capacity: 10000
Tank Substance: Gasoline
Last Used Date: Not reported
OSFM First Notify Date: 4/25/1986
Tank Status: Currently in use
Red Tag Issue Date: Not reported
Install Date: 1/1/1985
Green Tag Decal: J000685
Green Tag Issue Date: 7/17/2008
Green Tag Expire Date: 12/31/2010
Self Service Permit Inspection Date: 7/17/2008
Self Service Permit Expire Date: 12/31/2010

Tank Number: 4
Tank Capacity: 12000
Tank Substance: Gasoline
Last Used Date: Not reported
OSFM First Notify Date: 4/25/1986
Tank Status: Currently in use
Red Tag Issue Date: Not reported
Install Date: 1/1/1985
Green Tag Decal: J000685
Green Tag Issue Date: 7/17/2008
Green Tag Expire Date: 12/31/2010
Self Service Permit Inspection Date: 7/17/2008
Self Service Permit Expire Date: 12/31/2010

B6
East
1/8-1/4
0.155 mi.
819 ft.

SHELL OIL PRODUCTS U.S.
22 WEST 030 BUTTERFIELD RD.
GLEN ELLYN, IL 60137

Site 1 of 4 in cluster B

LUST S105743902
N/A

Relative:
Lower

LUST:
Incident Num: 20021692
IL EPA Id: 0430455057
Product: Unleaded Gas
IEMA Date: 11/21/2002
Project Manager: Hale
Project Manager Phone: (217) 782-1803
Email: Sam.Hale@illinois.gov
PRP Name: Shell Oil Products U.S.

Actual:
680 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHELL OIL PRODUCTS U.S. (Continued)

S105743902

PRP Contact: John Robbins
PRP Address: 603 Diehl Rd., Suite 103
PRP City,St,Zip: Naperville, IL 60563
PRP Phone: 6302764206
Site Classification: High
Section 57.5(g) Letter: P.A.
Non LUST Determination Letter: Not reported
20 Report Received: 12/4/2002
45 Report Received: 1/6/2003
Section 57.5(g) Letter: Not reported
NFA/NFR Letter: 12/6/2004
NFR Date Recorded: 12/27/2004

B7
East
1/8-1/4
0.155 mi.
819 ft.

MOBIL OIL CORP.
22W070 BUTTERFIELD RD.
GLEN ELLYN, IL 60137

LUST S105428225
N/A

Site 2 of 4 in cluster B

Relative:
Lower

LUST:

Actual:
680 ft.

Incident Num: 900273
IL EPA Id: 0430455059
Product: Not reported
IEMA Date: 1/31/1990
Project Manager: Davis
Project Manager Phone: (217) 785-7492
Email: Valerie.A.Davis@illinois.gov
PRP Name: Mobil Oil Corp.
PRP Contact: Mike Holland
PRP Address: P.O. Box 874
PRP City,St,Zip: Joliet, IL 60434-0874
PRP Phone: Not reported
Site Classification: Not reported
Section 57.5(g) Letter: P.A.
Non LUST Determination Letter: Not reported
20 Report Received: Not reported
45 Report Received: Not reported
Section 57.5(g) Letter: Not reported
NFA/NFR Letter: Not reported
NFR Date Recorded: Not reported

Incident Num: 891567
IL EPA Id: 0430455059
Product: Gasoline
IEMA Date: 8/21/1989
Project Manager: Davis
Project Manager Phone: (217) 785-7492
Email: Valerie.A.Davis@illinois.gov
PRP Name: Mobil Oil Corp.
PRP Contact: Mike Holland
PRP Address: P.O. Box 874
PRP City,St,Zip: Joliet, IL 60434-0874
PRP Phone: Not reported
Site Classification: Not reported
Section 57.5(g) Letter: P.A.
Non LUST Determination Letter: Not reported
20 Report Received: Not reported
45 Report Received: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOBIL OIL CORP. (Continued)

S105428225

Section 57.5(g) Letter: Not reported
NFA/NFR Letter: Not reported
NFR Date Recorded: Not reported

B8
East
1/8-1/4
0.155 mi.
819 ft.

MOBIL OIL CORP.
22 WEST 070 BUTTERFIELD RD.
GLEN ELLYN, IL 60137

LUST S103690920
N/A

Site 3 of 4 in cluster B

Relative:
Lower

LUST:

Actual:
680 ft.

Incident Num: 942888
IL EPA Id: 0430455059
Product: Other Petro
IEMA Date: 12/22/1994
Project Manager: Davis
Project Manager Phone: (217) 785-7492
Email: Valerie.A.Davis@illinois.gov
PRP Name: Mobil Oil Corp.
PRP Contact: Mark White
PRP Address: P.O. Box 874
PRP City,St,Zip: Joliet, IL 60434-0874
PRP Phone: Not reported
Site Classification: Not reported
Section 57.5(g) Letter: P.A.
Non LUST Determination Letter: Not reported
20 Report Received: Not reported
45 Report Received: Not reported
Section 57.5(g) Letter: Not reported
NFA/NFR Letter: Not reported
NFR Date Recorded: Not reported

B9
East
1/8-1/4
0.155 mi.
819 ft.

EXXON MOBIL
22W070 BUTTERFIELD RD.
GLEN ELLYN, IL 60137

LUST S105155392
N/A

Site 4 of 4 in cluster B

Relative:
Lower

LUST:

Actual:
680 ft.

Incident Num: 20021199
IL EPA Id: 0430455059
Product: Gasoline
IEMA Date: 8/22/2002
Project Manager: Davis
Project Manager Phone: (217) 785-7492
Email: Valerie.A.Davis@illinois.gov
PRP Name: Exxon Mobil
PRP Contact: Maya Shah
PRP Address: I-55 & Arsenal Rd., Rm. 258
PRP City,St,Zip: Joliet, IL 60434
PRP Phone: 8155217367
Site Classification: Not reported
Section 57.5(g) Letter: P.A.
Non LUST Determination Letter: Not reported
20 Report Received: 9/12/2002
45 Report Received: 10/7/2002

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

EXXON MOBIL (Continued)

S105155392

Section 57.5(g) Letter: Not reported
NFA/NFR Letter: **Not reported**
NFR Date Recorded: Not reported

Incident Num: 20011675
IL EPA Id: 0430455059
Product: Deisel
IEMA Date: 10/8/2001
Project Manager: Davis
Project Manager Phone: (217) 785-7492
Email: Valerie.A.Davis@illinois.gov
PRP Name: Exxon Mobil
PRP Contact: Terry Jagiello
PRP Address: P.O. Box 874
PRP City,St,Zip: Joliet, IL 60434
PRP Phone: 8154237732
Site Classification: Not reported
Section 57.5(g) Letter: P.A.
Non LUST Determination Letter: Not reported
20 Report Received: 10/22/2001
45 Report Received: 11/26/2001
Section 57.5(g) Letter: Not reported
NFA/NFR Letter: **Not reported**
NFR Date Recorded: Not reported

10
West
1/4-1/2
0.465 mi.
2454 ft.

AMOCO OIL CO.
22W 555 BUTTERFIELD RD.
GLEN ELLYN, IL 60137

LUST S104564283
N/A

Relative:
Higher

LUST:
Incident Num: 20000341
IL EPA Id: 0430455056
Product: Gasoline, Uset Oil
IEMA Date: 3/1/2000
Project Manager: Friedel
Project Manager Phone: (217) 785-5736
Email: Melinda.Friedel@illinois.gov
PRP Name: BP Products North America, Inc.
PRP Contact: Harold Primack
PRP Address: 28100 Torch Parkway, 2S
PRP City,St,Zip: Warrenville, IL 60555
PRP Phone: 6308367139
Site Classification: Not reported
Section 57.5(g) Letter: 732
Non LUST Determination Letter: Not reported
20 Report Received: 3/10/2000
45 Report Received: 4/14/2000
Section 57.5(g) Letter: Not reported
NFA/NFR Letter: **Not reported**
NFR Date Recorded: Not reported

Actual:
744 ft.

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
CLARENDON HILLS	S106635190	IDOT ROUTE #83	SW CORNER ROUTE 83 / 55TH ST	60515	SRP
GLEN ELLYN	1004693410	PARK BUTTERFIELD AMOCO	22 W 555 BUTTERFIELD RD	60137	FINDS, RCRA-CESQG
LOMBARD	1008141257	BRUSS NURSERY	21W360 ROOSEVELT	60148	FINDS, SWF/LF

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

Number of Days to Update: Provides confirmation that EDR is reporting records that have been updated within 90 days from the date the government agency made the information available to the public.

STANDARD ENVIRONMENTAL RECORDS

Federal NPL site list

NPL: National Priority List

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices.

Date of Government Version: 02/02/2009	Source: EPA
Date Data Arrived at EDR: 02/12/2009	Telephone: N/A
Date Made Active in Reports: 03/30/2009	Last EDR Contact: 04/20/2009
Number of Days to Update: 46	Next Scheduled EDR Contact: 07/27/2009
	Data Release Frequency: Quarterly

NPL Site Boundaries

Sources:

EPA's Environmental Photographic Interpretation Center (EPIC)
Telephone: 202-564-7333

EPA Region 1
Telephone 617-918-1143

EPA Region 6
Telephone: 214-655-6659

EPA Region 3
Telephone 215-814-5418

EPA Region 7
Telephone: 913-551-7247

EPA Region 4
Telephone 404-562-8033

EPA Region 8
Telephone: 303-312-6774

EPA Region 5
Telephone 312-886-6686

EPA Region 9
Telephone: 415-947-4246

EPA Region 10
Telephone 206-553-8665

Proposed NPL: Proposed National Priority List Sites

A site that has been proposed for listing on the National Priorities List through the issuance of a proposed rule in the Federal Register. EPA then accepts public comments on the site, responds to the comments, and places on the NPL those sites that continue to meet the requirements for listing.

Date of Government Version: 04/23/2009	Source: EPA
Date Data Arrived at EDR: 04/28/2009	Telephone: N/A
Date Made Active in Reports: 05/19/2009	Last EDR Contact: 04/20/2009
Number of Days to Update: 21	Next Scheduled EDR Contact: 07/27/2009
	Data Release Frequency: Quarterly

NPL LIENS: Federal Superfund Liens

Federal Superfund Liens. Under the authority granted the USEPA by CERCLA of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner received notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

Date of Government Version: 10/15/1991	Source: EPA
Date Data Arrived at EDR: 02/02/1994	Telephone: 202-564-4267
Date Made Active in Reports: 03/30/1994	Last EDR Contact: 05/17/2009
Number of Days to Update: 56	Next Scheduled EDR Contact: 08/17/2009
	Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Federal Delisted NPL site list

DELISTED NPL: National Priority List Deletions

The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425(e), sites may be deleted from the NPL where no further response is appropriate.

Date of Government Version: 02/02/2009	Source: EPA
Date Data Arrived at EDR: 02/12/2009	Telephone: N/A
Date Made Active in Reports: 03/30/2009	Last EDR Contact: 04/20/2009
Number of Days to Update: 46	Next Scheduled EDR Contact: 07/27/2009
	Data Release Frequency: Quarterly

Federal CERCLIS list

CERCLIS: Comprehensive Environmental Response, Compensation, and Liability Information System

CERCLIS contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). CERCLIS contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL.

Date of Government Version: 01/09/2009	Source: EPA
Date Data Arrived at EDR: 01/30/2009	Telephone: 703-412-9810
Date Made Active in Reports: 05/11/2009	Last EDR Contact: 05/29/2009
Number of Days to Update: 101	Next Scheduled EDR Contact: 07/13/2009
	Data Release Frequency: Quarterly

Federal CERCLIS NFRAP site List

CERCLIS-NFRAP: CERCLIS No Further Remedial Action Planned

Archived sites are sites that have been removed and archived from the inventory of CERCLIS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list this site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. This decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be a potential NPL site.

Date of Government Version: 12/03/2007	Source: EPA
Date Data Arrived at EDR: 12/06/2007	Telephone: 703-412-9810
Date Made Active in Reports: 02/20/2008	Last EDR Contact: 06/15/2009
Number of Days to Update: 76	Next Scheduled EDR Contact: 09/14/2009
	Data Release Frequency: Quarterly

Federal RCRA CORRACTS facilities list

CORRACTS: Corrective Action Report

CORRACTS identifies hazardous waste handlers with RCRA corrective action activity.

Date of Government Version: 03/25/2009	Source: EPA
Date Data Arrived at EDR: 04/02/2009	Telephone: 800-424-9346
Date Made Active in Reports: 05/11/2009	Last EDR Contact: 06/01/2009
Number of Days to Update: 39	Next Scheduled EDR Contact: 08/31/2009
	Data Release Frequency: Quarterly

Federal RCRA non-CORRACTS TSD facilities list

RCRA-TSDF: RCRA - Transporters, Storage and Disposal

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 11/12/2008
Date Data Arrived at EDR: 11/18/2008
Date Made Active in Reports: 03/16/2009
Number of Days to Update: 118

Source: Environmental Protection Agency
Telephone: 312-886-6186
Last EDR Contact: 04/23/2009
Next Scheduled EDR Contact: 07/20/2009
Data Release Frequency: Quarterly

Federal RCRA generators list

RCRA-LQG: RCRA - Large Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month.

Date of Government Version: 11/12/2008
Date Data Arrived at EDR: 11/18/2008
Date Made Active in Reports: 03/16/2009
Number of Days to Update: 118

Source: Environmental Protection Agency
Telephone: 312-886-6186
Last EDR Contact: 04/23/2009
Next Scheduled EDR Contact: 07/20/2009
Data Release Frequency: Quarterly

RCRA-SQG: RCRA - Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

Date of Government Version: 11/12/2008
Date Data Arrived at EDR: 11/18/2008
Date Made Active in Reports: 03/16/2009
Number of Days to Update: 118

Source: Environmental Protection Agency
Telephone: 312-886-6186
Last EDR Contact: 04/23/2009
Next Scheduled EDR Contact: 07/20/2009
Data Release Frequency: Quarterly

RCRA-CESQG: RCRA - Conditionally Exempt Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

Date of Government Version: 11/12/2008
Date Data Arrived at EDR: 11/18/2008
Date Made Active in Reports: 03/16/2009
Number of Days to Update: 118

Source: Environmental Protection Agency
Telephone: 312-886-6186
Last EDR Contact: 04/23/2009
Next Scheduled EDR Contact: 07/20/2009
Data Release Frequency: Varies

Federal institutional controls / engineering controls registries

US ENG CONTROLS: Engineering Controls Sites List

A listing of sites with engineering controls in place. Engineering controls include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health.

Date of Government Version: 03/31/2009
Date Data Arrived at EDR: 04/22/2009
Date Made Active in Reports: 05/05/2009
Number of Days to Update: 13

Source: Environmental Protection Agency
Telephone: 703-603-0695
Last EDR Contact: 06/29/2009
Next Scheduled EDR Contact: 09/28/2009
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

US INST CONTROL: Sites with Institutional Controls

A listing of sites with institutional controls in place. Institutional controls include administrative measures, such as groundwater use restrictions, construction restrictions, property use restrictions, and post remediation care requirements intended to prevent exposure to contaminants remaining on site. Deed restrictions are generally required as part of the institutional controls.

Date of Government Version: 03/31/2009
Date Data Arrived at EDR: 04/22/2009
Date Made Active in Reports: 05/05/2009
Number of Days to Update: 13

Source: Environmental Protection Agency
Telephone: 703-603-0695
Last EDR Contact: 06/29/2009
Next Scheduled EDR Contact: 09/28/2009
Data Release Frequency: Varies

Federal ERNS list

ERNS: Emergency Response Notification System

Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances.

Date of Government Version: 12/31/2008
Date Data Arrived at EDR: 01/30/2009
Date Made Active in Reports: 05/19/2009
Number of Days to Update: 109

Source: National Response Center, United States Coast Guard
Telephone: 202-267-2180
Last EDR Contact: 05/12/2009
Next Scheduled EDR Contact: 07/20/2009
Data Release Frequency: Annually

State- and tribal - equivalent NPL

CAT: Category List

Sites on this list are: Notice of Response Action, NPL, Pre/proposed NPL, Completed Remedial Action, Site Remediation Program, Federal Facilities, and Cleanup Started and/or Completed Sites.

Date of Government Version: 06/01/1997
Date Data Arrived at EDR: 07/07/1997
Date Made Active in Reports: 08/14/1997
Number of Days to Update: 38

Source: Illinois EPA
Telephone: N/A
Last EDR Contact: 02/26/2001
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

State- and tribal - equivalent CERCLIS

SHWS: State Oversight List

State Hazardous Waste Sites. State hazardous waste site records are the states' equivalent to CERCLIS. These sites may or may not already be listed on the federal CERCLIS list. Priority sites planned for cleanup using state funds (state equivalent of Superfund) are identified along with sites where cleanup will be paid for by potentially responsible parties. Available information varies by state.

Date of Government Version: 03/05/2009
Date Data Arrived at EDR: 03/20/2009
Date Made Active in Reports: 03/30/2009
Number of Days to Update: 10

Source: Illinois Environmental Protection Agency
Telephone: 217-524-4863
Last EDR Contact: 05/17/2009
Next Scheduled EDR Contact: 08/17/2009
Data Release Frequency: Semi-Annually

State and tribal landfill and/or solid waste disposal site lists

LF WMRC: Waste Management & Research Center Landfill Database

The Waste Management & Research Center Landfill Database includes records from the Department of Public Health, Department of Mines & Minerals, Illinois Environmental Protection Agency, State Geological Survey, Northeastern Illinois Planning Commission and Pollution Control Board.

Date of Government Version: 12/31/2001
Date Data Arrived at EDR: 10/06/2006
Date Made Active in Reports: 11/06/2006
Number of Days to Update: 31

Source: Department of Natural Resources
Telephone: 217-333-8940
Last EDR Contact: 07/01/2009
Next Scheduled EDR Contact: 09/28/2009
Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

SWF/LF: Available Disposal for Solid Waste in Illinois - Solid Waste Landfills Subject to State Surcharge

Solid Waste Facilities/Landfill Sites. SWF/LF type records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. Depending on the state, these may be active or inactive facilities or open dumps that failed to meet RCRA Subtitle D Section 4004 criteria for solid waste landfills or disposal sites.

Date of Government Version: 12/01/2007
Date Data Arrived at EDR: 04/18/2008
Date Made Active in Reports: 04/30/2008
Number of Days to Update: 12

Source: Illinois Environmental Protection Agency
Telephone: 217-785-8604
Last EDR Contact: 05/22/2009
Next Scheduled EDR Contact: 08/17/2009
Data Release Frequency: Annually

IL NIPC: Solid Waste Landfill Inventory

Solid Waste Landfill Inventory. NIPC is an inventory of active and inactive solid waste disposal sites, based on state, local government and historical archive data. Included are numerous sites which previously had never been identified largely because there was no obligation to register such sites prior to 1971.

Date of Government Version: 08/01/1988
Date Data Arrived at EDR: 08/01/1994
Date Made Active in Reports: 08/12/1994
Number of Days to Update: 11

Source: Northeastern Illinois Planning Commission
Telephone: 312-454-0400
Last EDR Contact: 05/23/2006
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

State and tribal leaking storage tank lists

LUST: Leaking Underground Storage Tank Sites

Leaking Underground Storage Tank Incident Reports. LUST records contain an inventory of reported leaking underground storage tank incidents. Not all states maintain these records, and the information stored varies by state.

Date of Government Version: 05/15/2009
Date Data Arrived at EDR: 05/19/2009
Date Made Active in Reports: 06/12/2009
Number of Days to Update: 24

Source: Illinois Environmental Protection Agency
Telephone: 217-782-6762
Last EDR Contact: 05/19/2009
Next Scheduled EDR Contact: 08/17/2009
Data Release Frequency: Semi-Annually

LUST TRUST: Underground Storage Tank Fund Payment Priority List

In case sufficient funds are not available in the Underground Storage Tank Fund, requests for payment are entered on the Payment Priority List by "queue date" order. As required by the Environmental Protection Act, the queue date is the date that a complete request for partial or final payment was received by the Agency. The queue date is "officially" confirmed at the end of the payment review process when a Final Decision Letter is sent to the site owner.

Date of Government Version: 05/15/2009
Date Data Arrived at EDR: 05/19/2009
Date Made Active in Reports: 06/12/2009
Number of Days to Update: 24

Source: Illinois EPA
Telephone: 217-782-6762
Last EDR Contact: 05/19/2009
Next Scheduled EDR Contact: 08/17/2009
Data Release Frequency: Varies

INDIAN LUST R1: Leaking Underground Storage Tanks on Indian Land

A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 02/19/2009
Date Data Arrived at EDR: 02/19/2009
Date Made Active in Reports: 03/16/2009
Number of Days to Update: 25

Source: EPA Region 1
Telephone: 617-918-1313
Last EDR Contact: 05/17/2009
Next Scheduled EDR Contact: 08/17/2009
Data Release Frequency: Varies

INDIAN LUST R4: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Florida, Mississippi and North Carolina.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 02/24/2009
Date Data Arrived at EDR: 03/03/2009
Date Made Active in Reports: 05/05/2009
Number of Days to Update: 63

Source: EPA Region 4
Telephone: 404-562-8677
Last EDR Contact: 05/17/2009
Next Scheduled EDR Contact: 08/17/2009
Data Release Frequency: Semi-Annually

INDIAN LUST R6: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in New Mexico and Oklahoma.

Date of Government Version: 05/20/2009
Date Data Arrived at EDR: 05/20/2009
Date Made Active in Reports: 05/29/2009
Number of Days to Update: 9

Source: EPA Region 6
Telephone: 214-665-6597
Last EDR Contact: 05/17/2009
Next Scheduled EDR Contact: 08/17/2009
Data Release Frequency: Varies

INDIAN LUST R7: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Iowa, Kansas, and Nebraska

Date of Government Version: 03/24/2009
Date Data Arrived at EDR: 05/20/2009
Date Made Active in Reports: 06/17/2009
Number of Days to Update: 28

Source: EPA Region 7
Telephone: 913-551-7003
Last EDR Contact: 05/20/2009
Next Scheduled EDR Contact: 08/17/2009
Data Release Frequency: Varies

INDIAN LUST R8: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Colorado, Montana, North Dakota, South Dakota, Utah and Wyoming.

Date of Government Version: 06/01/2009
Date Data Arrived at EDR: 06/03/2009
Date Made Active in Reports: 06/17/2009
Number of Days to Update: 14

Source: EPA Region 8
Telephone: 303-312-6271
Last EDR Contact: 05/17/2009
Next Scheduled EDR Contact: 08/17/2009
Data Release Frequency: Quarterly

INDIAN LUST R9: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Arizona, California, New Mexico and Nevada

Date of Government Version: 12/15/2008
Date Data Arrived at EDR: 12/16/2008
Date Made Active in Reports: 03/16/2009
Number of Days to Update: 90

Source: Environmental Protection Agency
Telephone: 415-972-3372
Last EDR Contact: 05/17/2009
Next Scheduled EDR Contact: 08/17/2009
Data Release Frequency: Quarterly

INDIAN LUST R10: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Alaska, Idaho, Oregon and Washington.

Date of Government Version: 06/04/2009
Date Data Arrived at EDR: 06/05/2009
Date Made Active in Reports: 06/17/2009
Number of Days to Update: 12

Source: EPA Region 10
Telephone: 206-553-2857
Last EDR Contact: 05/17/2009
Next Scheduled EDR Contact: 08/17/2009
Data Release Frequency: Quarterly

State and tribal registered storage tank lists

UST: Underground Storage Tank Facility List
Registered Underground Storage Tanks. UST's are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA) and must be registered with the state department responsible for administering the UST program. Available information varies by state program.

Date of Government Version: 05/19/2009
Date Data Arrived at EDR: 05/20/2009
Date Made Active in Reports: 06/17/2009
Number of Days to Update: 28

Source: Illinois State Fire Marshal
Telephone: 217-785-0969
Last EDR Contact: 05/20/2009
Next Scheduled EDR Contact: 08/17/2009
Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

INDIAN UST R5: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 5 (Michigan, Minnesota and Wisconsin and Tribal Nations).

Date of Government Version: 09/08/2008	Source: EPA Region 5
Date Data Arrived at EDR: 09/19/2008	Telephone: 312-886-6136
Date Made Active in Reports: 10/16/2008	Last EDR Contact: 05/17/2009
Number of Days to Update: 27	Next Scheduled EDR Contact: 08/17/2009
	Data Release Frequency: Varies

INDIAN UST R9: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 9 (Arizona, California, Hawaii, Nevada, the Pacific Islands, and Tribal Nations).

Date of Government Version: 12/15/2008	Source: EPA Region 9
Date Data Arrived at EDR: 12/16/2008	Telephone: 415-972-3368
Date Made Active in Reports: 03/16/2009	Last EDR Contact: 05/17/2009
Number of Days to Update: 90	Next Scheduled EDR Contact: 08/17/2009
	Data Release Frequency: Quarterly

INDIAN UST R1: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 1 (Connecticut, Maine, Massachusetts, New Hampshire, Rhode Island, Vermont and ten Tribal Nations).

Date of Government Version: 02/19/2009	Source: EPA, Region 1
Date Data Arrived at EDR: 02/19/2009	Telephone: 617-918-1313
Date Made Active in Reports: 03/16/2009	Last EDR Contact: 05/17/2009
Number of Days to Update: 25	Next Scheduled EDR Contact: 08/17/2009
	Data Release Frequency: Varies

INDIAN UST R4: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 4 (Alabama, Florida, Georgia, Kentucky, Mississippi, North Carolina, South Carolina, Tennessee and Tribal Nations)

Date of Government Version: 02/24/2009	Source: EPA Region 4
Date Data Arrived at EDR: 03/03/2009	Telephone: 404-562-9424
Date Made Active in Reports: 05/05/2009	Last EDR Contact: 05/17/2009
Number of Days to Update: 63	Next Scheduled EDR Contact: 08/17/2009
	Data Release Frequency: Semi-Annually

INDIAN UST R10: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 10 (Alaska, Idaho, Oregon, Washington, and Tribal Nations).

Date of Government Version: 06/04/2009	Source: EPA Region 10
Date Data Arrived at EDR: 06/05/2009	Telephone: 206-553-2857
Date Made Active in Reports: 06/17/2009	Last EDR Contact: 05/17/2009
Number of Days to Update: 12	Next Scheduled EDR Contact: 08/17/2009
	Data Release Frequency: Quarterly

INDIAN UST R6: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 6 (Louisiana, Arkansas, Oklahoma, New Mexico, Texas and 65 Tribes).

Date of Government Version: 05/20/2009	Source: EPA Region 6
Date Data Arrived at EDR: 05/20/2009	Telephone: 214-665-7591
Date Made Active in Reports: 05/29/2009	Last EDR Contact: 05/17/2009
Number of Days to Update: 9	Next Scheduled EDR Contact: 08/17/2009
	Data Release Frequency: Semi-Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

INDIAN UST R7: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 7 (Iowa, Kansas, Missouri, Nebraska, and 9 Tribal Nations).

Date of Government Version: 04/01/2008	Source: EPA Region 7
Date Data Arrived at EDR: 12/30/2008	Telephone: 913-551-7003
Date Made Active in Reports: 03/16/2009	Last EDR Contact: 05/22/2009
Number of Days to Update: 76	Next Scheduled EDR Contact: 08/17/2009
	Data Release Frequency: Varies

INDIAN UST R8: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 8 (Colorado, Montana, North Dakota, South Dakota, Utah, Wyoming and 27 Tribal Nations).

Date of Government Version: 06/01/2009	Source: EPA Region 8
Date Data Arrived at EDR: 06/03/2009	Telephone: 303-312-6137
Date Made Active in Reports: 06/17/2009	Last EDR Contact: 05/17/2009
Number of Days to Update: 14	Next Scheduled EDR Contact: 08/17/2009
	Data Release Frequency: Quarterly

State and tribal institutional control / engineering control registries

ENG CONTROLS: Sites with Engineering Controls

Sites using of engineered barriers (e.g., asphalt or concrete paving).

Date of Government Version: 05/09/2009	Source: Illinois Environmental Protection Agency
Date Data Arrived at EDR: 05/12/2009	Telephone: 217-782-6761
Date Made Active in Reports: 05/20/2009	Last EDR Contact: 05/12/2009
Number of Days to Update: 8	Next Scheduled EDR Contact: 08/10/2009
	Data Release Frequency: Quarterly

Inst Control: Institutional Controls

Legal or administrative restrictions on land use and/or other activities (e.g., groundwater use restrictions) which effectively limit exposure to contamination may be employed as alternatives to removal or treatment of contamination.

Date of Government Version: 05/09/2009	Source: Illinois Environmental Protection Agency
Date Data Arrived at EDR: 05/12/2009	Telephone: 217-782-6761
Date Made Active in Reports: 05/20/2009	Last EDR Contact: 05/12/2009
Number of Days to Update: 8	Next Scheduled EDR Contact: 08/10/2009
	Data Release Frequency: Quarterly

State and tribal voluntary cleanup sites

INDIAN VCP R7: Voluntary Cleanup Priority Listing

A listing of voluntary cleanup priority sites located on Indian Land located in Region 7.

Date of Government Version: 03/20/2008	Source: EPA, Region 7
Date Data Arrived at EDR: 04/22/2008	Telephone: 913-551-7365
Date Made Active in Reports: 05/19/2008	Last EDR Contact: 04/20/2009
Number of Days to Update: 27	Next Scheduled EDR Contact: 07/20/2009
	Data Release Frequency: Varies

INDIAN VCP R1: Voluntary Cleanup Priority Listing

A listing of voluntary cleanup priority sites located on Indian Land located in Region 1.

Date of Government Version: 04/02/2008	Source: EPA, Region 1
Date Data Arrived at EDR: 04/22/2008	Telephone: 617-918-1102
Date Made Active in Reports: 05/19/2008	Last EDR Contact: 04/20/2009
Number of Days to Update: 27	Next Scheduled EDR Contact: 07/20/2009
	Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

SRP: Site Remediation Program Database

The database identifies the status of all voluntary remediation projects administered through the pre-notice site cleanup program (1989 to 1995) and the site remediation program (1996 to the present).

Date of Government Version: 05/09/2009
Date Data Arrived at EDR: 05/12/2009
Date Made Active in Reports: 05/20/2009
Number of Days to Update: 8

Source: Illinois Environmental Protection Agency
Telephone: 217-785-9407
Last EDR Contact: 05/12/2009
Next Scheduled EDR Contact: 08/10/2009
Data Release Frequency: Semi-Annually

State and tribal Brownfields sites

BROWNFIELDS: Municipal Brownfields Redevelopment Grant Program Project Descriptions

The Illinois Municipal Brownfields Redevelopment Grant Program (MBRGP) offers grants worth a maximum of \$240,000 each to municipalities to assist in site investigation activities, development of cleanup objectives, and performance of cleanup activities. Brownfields are abandoned or underused industrial and/or commercial properties that are contaminated (or thought to be contaminated) and have an active potential for redevelopment.

Date of Government Version: 04/13/2009
Date Data Arrived at EDR: 04/14/2009
Date Made Active in Reports: 05/20/2009
Number of Days to Update: 36

Source: Illinois Environmental Protection Agency
Telephone: 217-785-3486
Last EDR Contact: 06/15/2009
Next Scheduled EDR Contact: 08/17/2009
Data Release Frequency: Varies

BROWNFIELDS: Redevelopment Assessment Database

The Office of Site Evaluations Redevelopment Assessment database identifies the status of all properties within the State in which the Illinois EPA's Office of Site Evaluation has conducted a municipal Brownfield Redevelopment Assessment.

Date of Government Version: 05/19/2009
Date Data Arrived at EDR: 05/19/2009
Date Made Active in Reports: 06/12/2009
Number of Days to Update: 24

Source: Illinois Environmental Protection Agency
Telephone: 217-524-1658
Last EDR Contact: 05/19/2009
Next Scheduled EDR Contact: 08/17/2009
Data Release Frequency: Varies

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS: A Listing of Brownfields Sites

Included in the listing are brownfields properties addresses by Cooperative Agreement Recipients and brownfields properties addressed by Targeted Brownfields Assessments. Targeted Brownfields Assessments-EPA's Targeted Brownfields Assessments (TBA) program is designed to help states, tribes, and municipalities--especially those without EPA Brownfields Assessment Demonstration Pilots--minimize the uncertainties of contamination often associated with brownfields. Under the TBA program, EPA provides funding and/or technical assistance for environmental assessments at brownfields sites throughout the country. Targeted Brownfields Assessments supplement and work with other efforts under EPA's Brownfields Initiative to promote cleanup and redevelopment of brownfields. Cooperative Agreement Recipients-States, political subdivisions, territories, and Indian tribes become Brownfields Cleanup Revolving Loan Fund (BCRLF) cooperative agreement recipients when they enter into BCRLF cooperative agreements with the U.S. EPA. EPA selects BCRLF cooperative agreement recipients based on a proposal and application process. BCRLF cooperative agreement recipients must use EPA funds provided through BCRLF cooperative agreement for specified brownfields-related cleanup activities.

Date of Government Version: 10/01/2008
Date Data Arrived at EDR: 11/14/2008
Date Made Active in Reports: 12/23/2008
Number of Days to Update: 39

Source: Environmental Protection Agency
Telephone: 202-566-2777
Last EDR Contact: 05/20/2009
Next Scheduled EDR Contact: 07/13/2009
Data Release Frequency: Semi-Annually

Local Lists of Landfill / Solid Waste Disposal Sites

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

ODI: Open Dump Inventory

An open dump is defined as a disposal facility that does not comply with one or more of the Part 257 or Part 258 Subtitle D Criteria.

Date of Government Version: 06/30/1985
Date Data Arrived at EDR: 08/09/2004
Date Made Active in Reports: 09/17/2004
Number of Days to Update: 39

Source: Environmental Protection Agency
Telephone: 800-424-9346
Last EDR Contact: 06/09/2004
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

DEBRIS REGION 9: Torres Martinez Reservation Illegal Dump Site Locations

A listing of illegal dump sites location on the Torres Martinez Indian Reservation located in eastern Riverside County and northern Imperial County, California.

Date of Government Version: 03/25/2008
Date Data Arrived at EDR: 04/17/2008
Date Made Active in Reports: 05/15/2008
Number of Days to Update: 28

Source: EPA, Region 9
Telephone: 415-972-3336
Last EDR Contact: 06/21/2009
Next Scheduled EDR Contact: 09/21/2009
Data Release Frequency: Varies

INDIAN ODI: Report on the Status of Open Dumps on Indian Lands

Location of open dumps on Indian land.

Date of Government Version: 12/31/1998
Date Data Arrived at EDR: 12/03/2007
Date Made Active in Reports: 01/24/2008
Number of Days to Update: 52

Source: Environmental Protection Agency
Telephone: 703-308-8245
Last EDR Contact: 05/26/2009
Next Scheduled EDR Contact: 08/24/2009
Data Release Frequency: Varies

Local Lists of Hazardous waste / Contaminated Sites

CDL: Clandestine Drug Labs

A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

Date of Government Version: 07/01/2008
Date Data Arrived at EDR: 10/31/2008
Date Made Active in Reports: 12/23/2008
Number of Days to Update: 53

Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 03/26/2009
Next Scheduled EDR Contact: 06/22/2009
Data Release Frequency: Quarterly

CDL: Meth Drug Lab Site Listing

A listing of clandestine/meth drug lab locations.

Date of Government Version: 05/05/2009
Date Data Arrived at EDR: 05/06/2009
Date Made Active in Reports: 05/20/2009
Number of Days to Update: 14

Source: Department of Public Health
Telephone: 217-782-5750
Last EDR Contact: 05/04/2009
Next Scheduled EDR Contact: 08/03/2009
Data Release Frequency: Varies

Local Land Records

LIENS 2: CERCLA Lien Information

A Federal CERCLA ('Superfund') lien can exist by operation of law at any site or property at which EPA has spent Superfund monies. These monies are spent to investigate and address releases and threatened releases of contamination. CERCLIS provides information as to the identity of these sites and properties.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 05/29/2009
Date Data Arrived at EDR: 06/03/2009
Date Made Active in Reports: 06/17/2009
Number of Days to Update: 14

Source: Environmental Protection Agency
Telephone: 202-564-6023
Last EDR Contact: 05/18/2009
Next Scheduled EDR Contact: 08/17/2009
Data Release Frequency: Varies

LUCIS: Land Use Control Information System

LUCIS contains records of land use control information pertaining to the former Navy Base Realignment and Closure properties.

Date of Government Version: 12/09/2005
Date Data Arrived at EDR: 12/11/2006
Date Made Active in Reports: 01/11/2007
Number of Days to Update: 31

Source: Department of the Navy
Telephone: 843-820-7326
Last EDR Contact: 06/08/2009
Next Scheduled EDR Contact: 09/07/2009
Data Release Frequency: Varies

Records of Emergency Release Reports

HMIRS: Hazardous Materials Information Reporting System

Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

Date of Government Version: 03/31/2009
Date Data Arrived at EDR: 04/16/2009
Date Made Active in Reports: 05/29/2009
Number of Days to Update: 43

Source: U.S. Department of Transportation
Telephone: 202-366-4555
Last EDR Contact: 04/16/2009
Next Scheduled EDR Contact: 07/13/2009
Data Release Frequency: Annually

SPILLS: State spills

A listing of incidents reported to the Office of Emergency Response.

Date of Government Version: 05/05/2009
Date Data Arrived at EDR: 05/19/2009
Date Made Active in Reports: 06/12/2009
Number of Days to Update: 24

Source: Illinois EPA
Telephone: 217-558-1677
Last EDR Contact: 05/04/2009
Next Scheduled EDR Contact: 08/03/2009
Data Release Frequency: Varies

Other Ascertainable Records

RCRA-NonGen: RCRA - Non Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

Date of Government Version: 11/12/2008
Date Data Arrived at EDR: 11/18/2008
Date Made Active in Reports: 03/16/2009
Number of Days to Update: 118

Source: Environmental Protection Agency
Telephone: 312-886-6186
Last EDR Contact: 04/23/2009
Next Scheduled EDR Contact: 07/20/2009
Data Release Frequency: Varies

DOT OPS: Incident and Accident Data

Department of Transportation, Office of Pipeline Safety Incident and Accident data.

Date of Government Version: 05/14/2008
Date Data Arrived at EDR: 05/28/2008
Date Made Active in Reports: 08/08/2008
Number of Days to Update: 72

Source: Department of Transportation, Office of Pipeline Safety
Telephone: 202-366-4595
Last EDR Contact: 05/27/2009
Next Scheduled EDR Contact: 08/24/2009
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

DOD: Department of Defense Sites

This data set consists of federally owned or administered lands, administered by the Department of Defense, that have any area equal to or greater than 640 acres of the United States, Puerto Rico, and the U.S. Virgin Islands.

Date of Government Version: 12/31/2005	Source: USGS
Date Data Arrived at EDR: 11/10/2006	Telephone: 703-692-8801
Date Made Active in Reports: 01/11/2007	Last EDR Contact: 05/08/2009
Number of Days to Update: 62	Next Scheduled EDR Contact: 08/03/2009
	Data Release Frequency: Semi-Annually

FUDS: Formerly Used Defense Sites

The listing includes locations of Formerly Used Defense Sites properties where the US Army Corps of Engineers is actively working or will take necessary cleanup actions.

Date of Government Version: 12/31/2007	Source: U.S. Army Corps of Engineers
Date Data Arrived at EDR: 09/05/2008	Telephone: 202-528-4285
Date Made Active in Reports: 09/23/2008	Last EDR Contact: 07/01/2009
Number of Days to Update: 18	Next Scheduled EDR Contact: 09/28/2009
	Data Release Frequency: Varies

CONSENT: Superfund (CERCLA) Consent Decrees

Major legal settlements that establish responsibility and standards for cleanup at NPL (Superfund) sites. Released periodically by United States District Courts after settlement by parties to litigation matters.

Date of Government Version: 01/27/2009	Source: Department of Justice, Consent Decree Library
Date Data Arrived at EDR: 04/23/2009	Telephone: Varies
Date Made Active in Reports: 05/11/2009	Last EDR Contact: 04/21/2009
Number of Days to Update: 18	Next Scheduled EDR Contact: 07/20/2009
	Data Release Frequency: Varies

ROD: Records Of Decision

Record of Decision. ROD documents mandate a permanent remedy at an NPL (Superfund) site containing technical and health information to aid in the cleanup.

Date of Government Version: 04/23/2009	Source: EPA
Date Data Arrived at EDR: 04/28/2009	Telephone: 703-416-0223
Date Made Active in Reports: 05/19/2009	Last EDR Contact: 06/29/2009
Number of Days to Update: 21	Next Scheduled EDR Contact: 09/28/2009
	Data Release Frequency: Annually

UMTRA: Uranium Mill Tailings Sites

Uranium ore was mined by private companies for federal government use in national defense programs. When the mills shut down, large piles of the sand-like material (mill tailings) remain after uranium has been extracted from the ore. Levels of human exposure to radioactive materials from the piles are low; however, in some cases tailings were used as construction materials before the potential health hazards of the tailings were recognized.

Date of Government Version: 01/05/2009	Source: Department of Energy
Date Data Arrived at EDR: 05/07/2009	Telephone: 505-845-0011
Date Made Active in Reports: 05/08/2009	Last EDR Contact: 06/15/2009
Number of Days to Update: 1	Next Scheduled EDR Contact: 09/14/2009
	Data Release Frequency: Varies

MINES: Mines Master Index File

Contains all mine identification numbers issued for mines active or opened since 1971. The data also includes violation information.

Date of Government Version: 02/19/2009	Source: Department of Labor, Mine Safety and Health Administration
Date Data Arrived at EDR: 03/24/2009	Telephone: 303-231-5959
Date Made Active in Reports: 05/05/2009	Last EDR Contact: 06/23/2009
Number of Days to Update: 42	Next Scheduled EDR Contact: 09/21/2009
	Data Release Frequency: Semi-Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

TRIS: Toxic Chemical Release Inventory System

Toxic Release Inventory System. TRIS identifies facilities which release toxic chemicals to the air, water and land in reportable quantities under SARA Title III Section 313.

Date of Government Version: 12/31/2007	Source: EPA
Date Data Arrived at EDR: 04/09/2009	Telephone: 202-566-0250
Date Made Active in Reports: 06/17/2009	Last EDR Contact: 06/16/2009
Number of Days to Update: 69	Next Scheduled EDR Contact: 09/14/2009
	Data Release Frequency: Annually

TSCA: Toxic Substances Control Act

Toxic Substances Control Act. TSCA identifies manufacturers and importers of chemical substances included on the TSCA Chemical Substance Inventory list. It includes data on the production volume of these substances by plant site.

Date of Government Version: 12/31/2002	Source: EPA
Date Data Arrived at EDR: 04/14/2006	Telephone: 202-260-5521
Date Made Active in Reports: 05/30/2006	Last EDR Contact: 04/14/2009
Number of Days to Update: 46	Next Scheduled EDR Contact: 07/13/2009
	Data Release Frequency: Every 4 Years

FTTS: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

FTTS tracks administrative cases and pesticide enforcement actions and compliance activities related to FIFRA, TSCA and EPCRA (Emergency Planning and Community Right-to-Know Act). To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 04/09/2009	Source: EPA/Office of Prevention, Pesticides and Toxic Substances
Date Data Arrived at EDR: 04/16/2009	Telephone: 202-566-1667
Date Made Active in Reports: 05/11/2009	Last EDR Contact: 06/15/2009
Number of Days to Update: 25	Next Scheduled EDR Contact: 09/14/2009
	Data Release Frequency: Quarterly

FTTS INSP: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

A listing of FIFRA/TSCA Tracking System (FTTS) inspections and enforcements.

Date of Government Version: 04/09/2009	Source: EPA
Date Data Arrived at EDR: 04/16/2009	Telephone: 202-566-1667
Date Made Active in Reports: 05/11/2009	Last EDR Contact: 06/15/2009
Number of Days to Update: 25	Next Scheduled EDR Contact: 09/14/2009
	Data Release Frequency: Quarterly

HIST FTTS: FIFRA/TSCA Tracking System Administrative Case Listing

A complete administrative case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/01/2007	Telephone: 202-564-2501
Date Made Active in Reports: 04/10/2007	Last EDR Contact: 12/17/2007
Number of Days to Update: 40	Next Scheduled EDR Contact: 03/17/2008
	Data Release Frequency: No Update Planned

HIST FTTS INSP: FIFRA/TSCA Tracking System Inspection & Enforcement Case Listing

A complete inspection and enforcement case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 10/19/2006
Date Data Arrived at EDR: 03/01/2007
Date Made Active in Reports: 04/10/2007
Number of Days to Update: 40

Source: Environmental Protection Agency
Telephone: 202-564-2501
Last EDR Contact: 12/17/2008
Next Scheduled EDR Contact: 03/17/2008
Data Release Frequency: No Update Planned

SSTS: Section 7 Tracking Systems

Section 7 of the Federal Insecticide, Fungicide and Rodenticide Act, as amended (92 Stat. 829) requires all registered pesticide-producing establishments to submit a report to the Environmental Protection Agency by March 1st each year. Each establishment must report the types and amounts of pesticides, active ingredients and devices being produced, and those having been produced and sold or distributed in the past year.

Date of Government Version: 12/31/2006
Date Data Arrived at EDR: 03/14/2008
Date Made Active in Reports: 04/18/2008
Number of Days to Update: 35

Source: EPA
Telephone: 202-564-4203
Last EDR Contact: 05/18/2009
Next Scheduled EDR Contact: 07/13/2009
Data Release Frequency: Annually

ICIS: Integrated Compliance Information System

The Integrated Compliance Information System (ICIS) supports the information needs of the national enforcement and compliance program as well as the unique needs of the National Pollutant Discharge Elimination System (NPDES) program.

Date of Government Version: 03/20/2009
Date Data Arrived at EDR: 03/20/2009
Date Made Active in Reports: 05/05/2009
Number of Days to Update: 46

Source: Environmental Protection Agency
Telephone: 202-564-5088
Last EDR Contact: 04/13/2009
Next Scheduled EDR Contact: 07/13/2009
Data Release Frequency: Quarterly

PADS: PCB Activity Database System

PCB Activity Database. PADS identifies generators, transporters, commercial storers and/or brokers and disposers of PCB's who are required to notify the EPA of such activities.

Date of Government Version: 02/26/2009
Date Data Arrived at EDR: 05/20/2009
Date Made Active in Reports: 05/29/2009
Number of Days to Update: 9

Source: EPA
Telephone: 202-566-0500
Last EDR Contact: 05/04/2009
Next Scheduled EDR Contact: 08/03/2009
Data Release Frequency: Annually

MLTS: Material Licensing Tracking System

MLTS is maintained by the Nuclear Regulatory Commission and contains a list of approximately 8,100 sites which possess or use radioactive materials and which are subject to NRC licensing requirements. To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 04/02/2009
Date Data Arrived at EDR: 04/24/2009
Date Made Active in Reports: 05/19/2009
Number of Days to Update: 25

Source: Nuclear Regulatory Commission
Telephone: 301-415-7169
Last EDR Contact: 06/29/2009
Next Scheduled EDR Contact: 09/28/2009
Data Release Frequency: Quarterly

RADINFO: Radiation Information Database

The Radiation Information Database (RADINFO) contains information about facilities that are regulated by U.S. Environmental Protection Agency (EPA) regulations for radiation and radioactivity.

Date of Government Version: 04/28/2009
Date Data Arrived at EDR: 04/29/2009
Date Made Active in Reports: 05/11/2009
Number of Days to Update: 12

Source: Environmental Protection Agency
Telephone: 202-343-9775
Last EDR Contact: 04/29/2009
Next Scheduled EDR Contact: 07/27/2009
Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

FINDS: Facility Index System/Facility Registry System

Facility Index System. FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

Date of Government Version: 04/28/2009	Source: EPA
Date Data Arrived at EDR: 05/01/2009	Telephone: (312) 353-2000
Date Made Active in Reports: 05/19/2009	Last EDR Contact: 06/29/2009
Number of Days to Update: 18	Next Scheduled EDR Contact: 09/28/2009
	Data Release Frequency: Quarterly

RAATS: RCRA Administrative Action Tracking System

RCRA Administration Action Tracking System. RAATS contains records based on enforcement actions issued under RCRA pertaining to major violators and includes administrative and civil actions brought by the EPA. For administration actions after September 30, 1995, data entry in the RAATS database was discontinued. EPA will retain a copy of the database for historical records. It was necessary to terminate RAATS because a decrease in agency resources made it impossible to continue to update the information contained in the database.

Date of Government Version: 04/17/1995	Source: EPA
Date Data Arrived at EDR: 07/03/1995	Telephone: 202-564-4104
Date Made Active in Reports: 08/07/1995	Last EDR Contact: 06/02/2008
Number of Days to Update: 35	Next Scheduled EDR Contact: 09/01/2008
	Data Release Frequency: No Update Planned

BRS: Biennial Reporting System

The Biennial Reporting System is a national system administered by the EPA that collects data on the generation and management of hazardous waste. BRS captures detailed data from two groups: Large Quantity Generators (LQG) and Treatment, Storage, and Disposal Facilities.

Date of Government Version: 12/31/2007	Source: EPA/NTIS
Date Data Arrived at EDR: 02/19/2009	Telephone: 800-424-9346
Date Made Active in Reports: 05/22/2009	Last EDR Contact: 06/08/2009
Number of Days to Update: 92	Next Scheduled EDR Contact: 09/07/2009
	Data Release Frequency: Biennially

NPDES: A Listing of Active Permits

A listing of facilities currently active in the state. The types of permits are public, private, federal and state.

Date of Government Version: 05/05/2009	Source: Illinois EPA
Date Data Arrived at EDR: 05/06/2009	Telephone: 217-782-0610
Date Made Active in Reports: 05/20/2009	Last EDR Contact: 04/27/2009
Number of Days to Update: 14	Next Scheduled EDR Contact: 07/27/2009
	Data Release Frequency: Varies

UIC: Underground Injection Wells

Injection wells are used for disposal of fluids by "injection" into the subsurface. The construction of injection wells range from very technical designs with twenty-four hour monitoring to simply a hole dug in the ground to control runoff. As a result of this diversity, the UIC Program divides injection wells into five different classes.

Date of Government Version: 03/25/2009	Source: Illinois EPA
Date Data Arrived at EDR: 04/02/2009	Telephone: 217-782-9878
Date Made Active in Reports: 05/20/2009	Last EDR Contact: 06/15/2009
Number of Days to Update: 48	Next Scheduled EDR Contact: 09/14/2009
	Data Release Frequency: Varies

DRYCLEANERS: Illinois Licensed Drycleaners

Any retail drycleaning facility in Illinois must apply for a license through the Illinois Drycleaner Environmental Response Trust Fund. Drycleaner Environmental Response Trust Fund of Illinois.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 05/01/2009
Date Data Arrived at EDR: 05/14/2009
Date Made Active in Reports: 05/20/2009
Number of Days to Update: 6

Source: Drycleaner Environmental Response Trust Fund of Illinois
Telephone: 800-765-4041
Last EDR Contact: 06/16/2009
Next Scheduled EDR Contact: 09/14/2009
Data Release Frequency: Varies

IMPDMNT: Surface Impoundment Inventory

Statewide inventory of industrial, municipal, mining, oil & gas, and large agricultural impoundment. This study was conducted by the Illinois EPA to assess potential for contamination of shallow aquifers. This was a one-time study. Although many of the impoundments may no longer be present, the sites may be contaminated.

Date of Government Version: 12/31/1980
Date Data Arrived at EDR: 03/08/2002
Date Made Active in Reports: 06/03/2002
Number of Days to Update: 87

Source: Illinois Waste Management & Research Center
Telephone: 217-333-8940
Last EDR Contact: 02/20/2002
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

AIRS: AIRS

A listing of air permits and emissions information.

Date of Government Version: 12/31/2008
Date Data Arrived at EDR: 02/12/2009
Date Made Active in Reports: 02/27/2009
Number of Days to Update: 15

Source: Illinois EPA
Telephone: 217-557-0314
Last EDR Contact: 04/27/2009
Next Scheduled EDR Contact: 07/27/2009
Data Release Frequency: Varies

INDIAN RESERV: Indian Reservations

This map layer portrays Indian administered lands of the United States that have any area equal to or greater than 640 acres.

Date of Government Version: 12/31/2005
Date Data Arrived at EDR: 12/08/2006
Date Made Active in Reports: 01/11/2007
Number of Days to Update: 34

Source: USGS
Telephone: 202-208-3710
Last EDR Contact: 05/08/2009
Next Scheduled EDR Contact: 08/03/2009
Data Release Frequency: Semi-Annually

SCRD DRYCLEANERS: State Coalition for Remediation of Drycleaners Listing

The State Coalition for Remediation of Drycleaners was established in 1998, with support from the U.S. EPA Office of Superfund Remediation and Technology Innovation. It is comprised of representatives of states with established drycleaner remediation programs. Currently the member states are Alabama, Connecticut, Florida, Illinois, Kansas, Minnesota, Missouri, North Carolina, Oregon, South Carolina, Tennessee, Texas, and Wisconsin.

Date of Government Version: 04/13/2009
Date Data Arrived at EDR: 04/14/2009
Date Made Active in Reports: 06/17/2009
Number of Days to Update: 64

Source: Environmental Protection Agency
Telephone: 615-532-8599
Last EDR Contact: 06/22/2009
Next Scheduled EDR Contact: 08/10/2009
Data Release Frequency: Varies

FEDLAND: Federal and Indian Lands

Federally and Indian administered lands of the United States. Lands included are administered by: Army Corps of Engineers, Bureau of Reclamation, National Wild and Scenic River, National Wildlife Refuge, Public Domain Land, Wilderness, Wilderness Study Area, Wildlife Management Area, Bureau of Indian Affairs, Bureau of Land Management, Department of Justice, Forest Service, Fish and Wildlife Service, National Park Service.

Date of Government Version: 12/31/2005
Date Data Arrived at EDR: 02/06/2006
Date Made Active in Reports: 01/11/2007
Number of Days to Update: 339

Source: U.S. Geological Survey
Telephone: 888-275-8747
Last EDR Contact: 05/08/2009
Next Scheduled EDR Contact: 08/03/2009
Data Release Frequency: N/A

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

EDR PROPRIETARY RECORDS

EDR Proprietary Records

Manufactured Gas Plants: EDR Proprietary Manufactured Gas Plants

The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

EDR Historical Auto Stations: EDR Proprietary Historic Gas Stations

EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

EDR Historical Cleaners: EDR Proprietary Historic Dry Cleaners

EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

CT MANIFEST: Hazardous Waste Manifest Data

Facility and manifest data. Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a tsd facility.

Date of Government Version: 12/31/2006
Date Data Arrived at EDR: 12/11/2008
Date Made Active in Reports: 03/19/2009
Number of Days to Update: 98

Source: Department of Environmental Protection
Telephone: 860-424-3375
Last EDR Contact: 06/12/2009
Next Scheduled EDR Contact: 09/07/2009
Data Release Frequency: Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

NJ MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2008
Date Data Arrived at EDR: 05/05/2009
Date Made Active in Reports: 05/22/2009
Number of Days to Update: 17

Source: Department of Environmental Protection
Telephone: N/A
Last EDR Contact: 05/05/2009
Next Scheduled EDR Contact: 08/03/2009
Data Release Frequency: Annually

NY MANIFEST: Facility and Manifest Data

Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

Date of Government Version: 05/22/2009
Date Data Arrived at EDR: 05/27/2009
Date Made Active in Reports: 07/01/2009
Number of Days to Update: 35

Source: Department of Environmental Conservation
Telephone: 518-402-8651
Last EDR Contact: 05/27/2009
Next Scheduled EDR Contact: 08/24/2009
Data Release Frequency: Annually

PA MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2007
Date Data Arrived at EDR: 09/11/2008
Date Made Active in Reports: 10/02/2008
Number of Days to Update: 21

Source: Department of Environmental Protection
Telephone: N/A
Last EDR Contact: 06/08/2009
Next Scheduled EDR Contact: 09/07/2009
Data Release Frequency: Annually

RI MANIFEST: Manifest information

Hazardous waste manifest information

Date of Government Version: 06/01/2009
Date Data Arrived at EDR: 06/12/2009
Date Made Active in Reports: 06/29/2009
Number of Days to Update: 17

Source: Department of Environmental Management
Telephone: 401-222-2797
Last EDR Contact: 06/15/2009
Next Scheduled EDR Contact: 09/14/2009
Data Release Frequency: Annually

WI MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2007
Date Data Arrived at EDR: 08/22/2008
Date Made Active in Reports: 09/08/2008
Number of Days to Update: 17

Source: Department of Natural Resources
Telephone: N/A
Last EDR Contact: 07/06/2009
Next Scheduled EDR Contact: 10/05/2009
Data Release Frequency: Annually

Oil/Gas Pipelines: This data was obtained by EDR from the USGS in 1994. It is referred to by USGS as GeoData Digital Line Graphs from 1:100,000-Scale Maps. It was extracted from the transportation category including some oil, but primarily gas pipelines.

Electric Power Transmission Line Data

Source: PennWell Corporation
Telephone: (800) 823-6277

This map includes information copyrighted by PennWell Corporation. This information is provided on a best effort basis and PennWell Corporation does not guarantee its accuracy nor warrant its fitness for any particular purpose. Such information has been reprinted with the permission of PennWell.

Sensitive Receptors: There are individuals deemed sensitive receptors due to their fragile immune systems and special sensitivity to environmental discharges. These sensitive receptors typically include the elderly, the sick, and children. While the location of all sensitive receptors cannot be determined, EDR indicates those buildings and facilities - schools, daycares, hospitals, medical centers, and nursing homes - where individuals who are sensitive receptors are likely to be located.

AHA Hospitals:

Source: American Hospital Association, Inc.
Telephone: 312-280-5991

The database includes a listing of hospitals based on the American Hospital Association's annual survey of hospitals.

Medical Centers: Provider of Services Listing

Source: Centers for Medicare & Medicaid Services

Telephone: 410-786-3000

A listing of hospitals with Medicare provider number, produced by Centers of Medicare & Medicaid Services, a federal agency within the U.S. Department of Health and Human Services.

Nursing Homes

Source: National Institutes of Health

Telephone: 301-594-6248

Information on Medicare and Medicaid certified nursing homes in the United States.

Public Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on elementary and secondary public education in the United States. It is a comprehensive, annual, national statistical database of all public elementary and secondary schools and school districts, which contains data that are comparable across all states.

Private Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on private school locations in the United States.

Daycare Centers: Homes & Centers Listing

Source: Department of Children & Family Services

Telephone: 312-814-4150

Flood Zone Data: This data, available in select counties across the country, was obtained by EDR in 1999 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002 and 2005 from the U.S. Fish and Wildlife Service.

Scanned Digital USGS 7.5' Topographic Map (DRG)

Source: United States Geologic Survey

A digital raster graphic (DRG) is a scanned image of a U.S. Geological Survey topographic map. The map images are made by scanning published paper maps on high-resolution scanners. The raster image is georeferenced and fit to the Universal Transverse Mercator (UTM) projection.

STREET AND ADDRESS INFORMATION

© 2009 Tele Atlas North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

GEOCHECK[®] - PHYSICAL SETTING SOURCE ADDENDUM

TARGET PROPERTY ADDRESS

BANK OF AMERICA
22W151 BUTTERFIELD RD
GLEN ELLYN, IL 60137

TARGET PROPERTY COORDINATES

Latitude (North):	41.83120 - 41° 49' 52.3"
Longitude (West):	88.0552 - 88° 3' 18.7"
Universal Transverse Mercator:	Zone 16
UTM X (Meters):	412377.3
UTM Y (Meters):	4631359.5
Elevation:	691 ft. above sea level

USGS TOPOGRAPHIC MAP

Target Property Map:	41088-G1 WHEATON, IL
Most Recent Revision:	1998

EDR's GeoCheck Physical Setting Source Addendum is provided to assist the environmental professional in forming an opinion about the impact of potential contaminant migration.

Assessment of the impact of contaminant migration generally has two principle investigative components:

1. Groundwater flow direction, and
2. Groundwater flow velocity.

Groundwater flow direction may be impacted by surface topography, hydrology, hydrogeology, characteristics of the soil, and nearby wells. Groundwater flow velocity is generally impacted by the nature of the geologic strata.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW DIRECTION INFORMATION

Groundwater flow direction for a particular site is best determined by a qualified environmental professional using site-specific well data. If such data is not reasonably ascertainable, it may be necessary to rely on other sources of information, such as surface topographic information, hydrologic information, hydrogeologic data collected on nearby properties, and regional groundwater flow information (from deep aquifers).


TOPOGRAPHIC INFORMATION

Surface topography may be indicative of the direction of surficial groundwater flow. This information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

TARGET PROPERTY TOPOGRAPHY

General Topographic Gradient: General SE

SURROUNDING TOPOGRAPHY: ELEVATION PROFILES

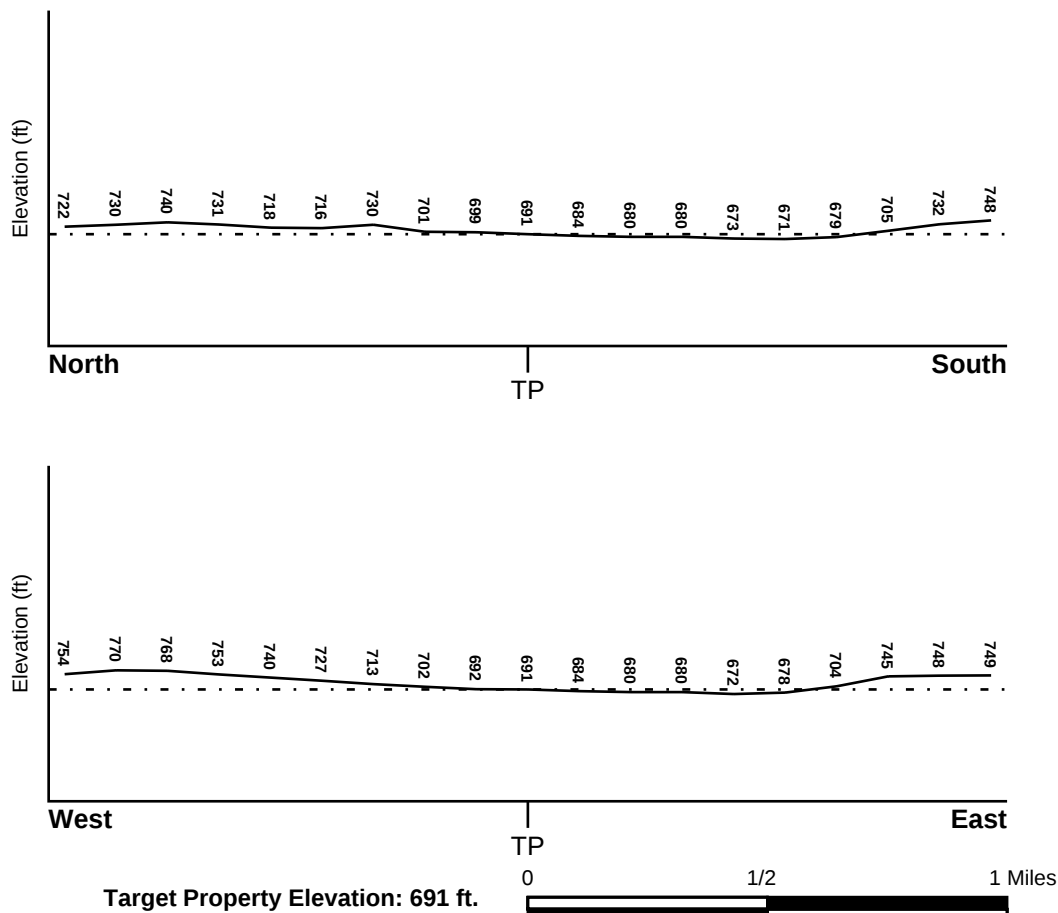

Source: Topography has been determined from the USGS 7.5' Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

HYDROLOGIC INFORMATION

Surface water can act as a hydrologic barrier to groundwater flow. Such hydrologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Refer to the Physical Setting Source Map following this summary for hydrologic information (major waterways and bodies of water).

FEMA FLOOD ZONE

<u>Target Property County</u> DUPAGE, IL	FEMA Flood <u>Electronic Data</u> YES - refer to the Overview Map and Detail Map
Flood Plain Panel at Target Property:	1701970040B
Additional Panels in search area:	1702070005C 1702040003C

NATIONAL WETLAND INVENTORY

<u>NWI Quad at Target Property</u> WHEATON	NWI Electronic <u>Data Coverage</u> YES - refer to the Overview Map and Detail Map
---	--

HYDROGEOLOGIC INFORMATION

Hydrogeologic information obtained by installation of wells on a specific site can often be an indicator of groundwater flow direction in the immediate area. Such hydrogeologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Site-Specific Hydrogeological Data*:

Search Radius:	1.25 miles
Status:	Not found

AQUIFLOW®

Search Radius: 1.000 Mile.

EDR has developed the AQUIFLOW Information System to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted by environmental professionals to regulatory authorities at select sites and has extracted the date of the report, groundwater flow direction as determined hydrogeologically, and the depth to water table.

<u>MAP ID</u>	<u>LOCATION</u>	<u>GENERAL DIRECTION</u>
Not Reported	<u>FROM TP</u>	<u>GROUNDWATER FLOW</u>

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW VELOCITY INFORMATION

Groundwater flow velocity information for a particular site is best determined by a qualified environmental professional using site specific geologic and soil strata data. If such data are not reasonably ascertainable, it may be necessary to rely on other sources of information, including geologic age identification, rock stratigraphic unit and soil characteristics data collected on nearby properties and regional soil information. In general, contaminant plumes move more quickly through sandy-gravelly types of soils than silty-clayey types of soils.

GEOLOGIC INFORMATION IN GENERAL AREA OF TARGET PROPERTY

Geologic information can be used by the environmental professional in forming an opinion about the relative speed at which contaminant migration may be occurring.

ROCK STRATIGRAPHIC UNIT


Era:	Paleozoic
System:	Silurian
Series:	Middle Silurian (Niagoaran)
Code:	S2 (decoded above as Era, System & Series)

GEOLOGIC AGE IDENTIFICATION

Category: Stratified Sequence

Geologic Age and Rock Stratigraphic Unit Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - a digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

SSURGO SOIL MAP - 2537497.32s

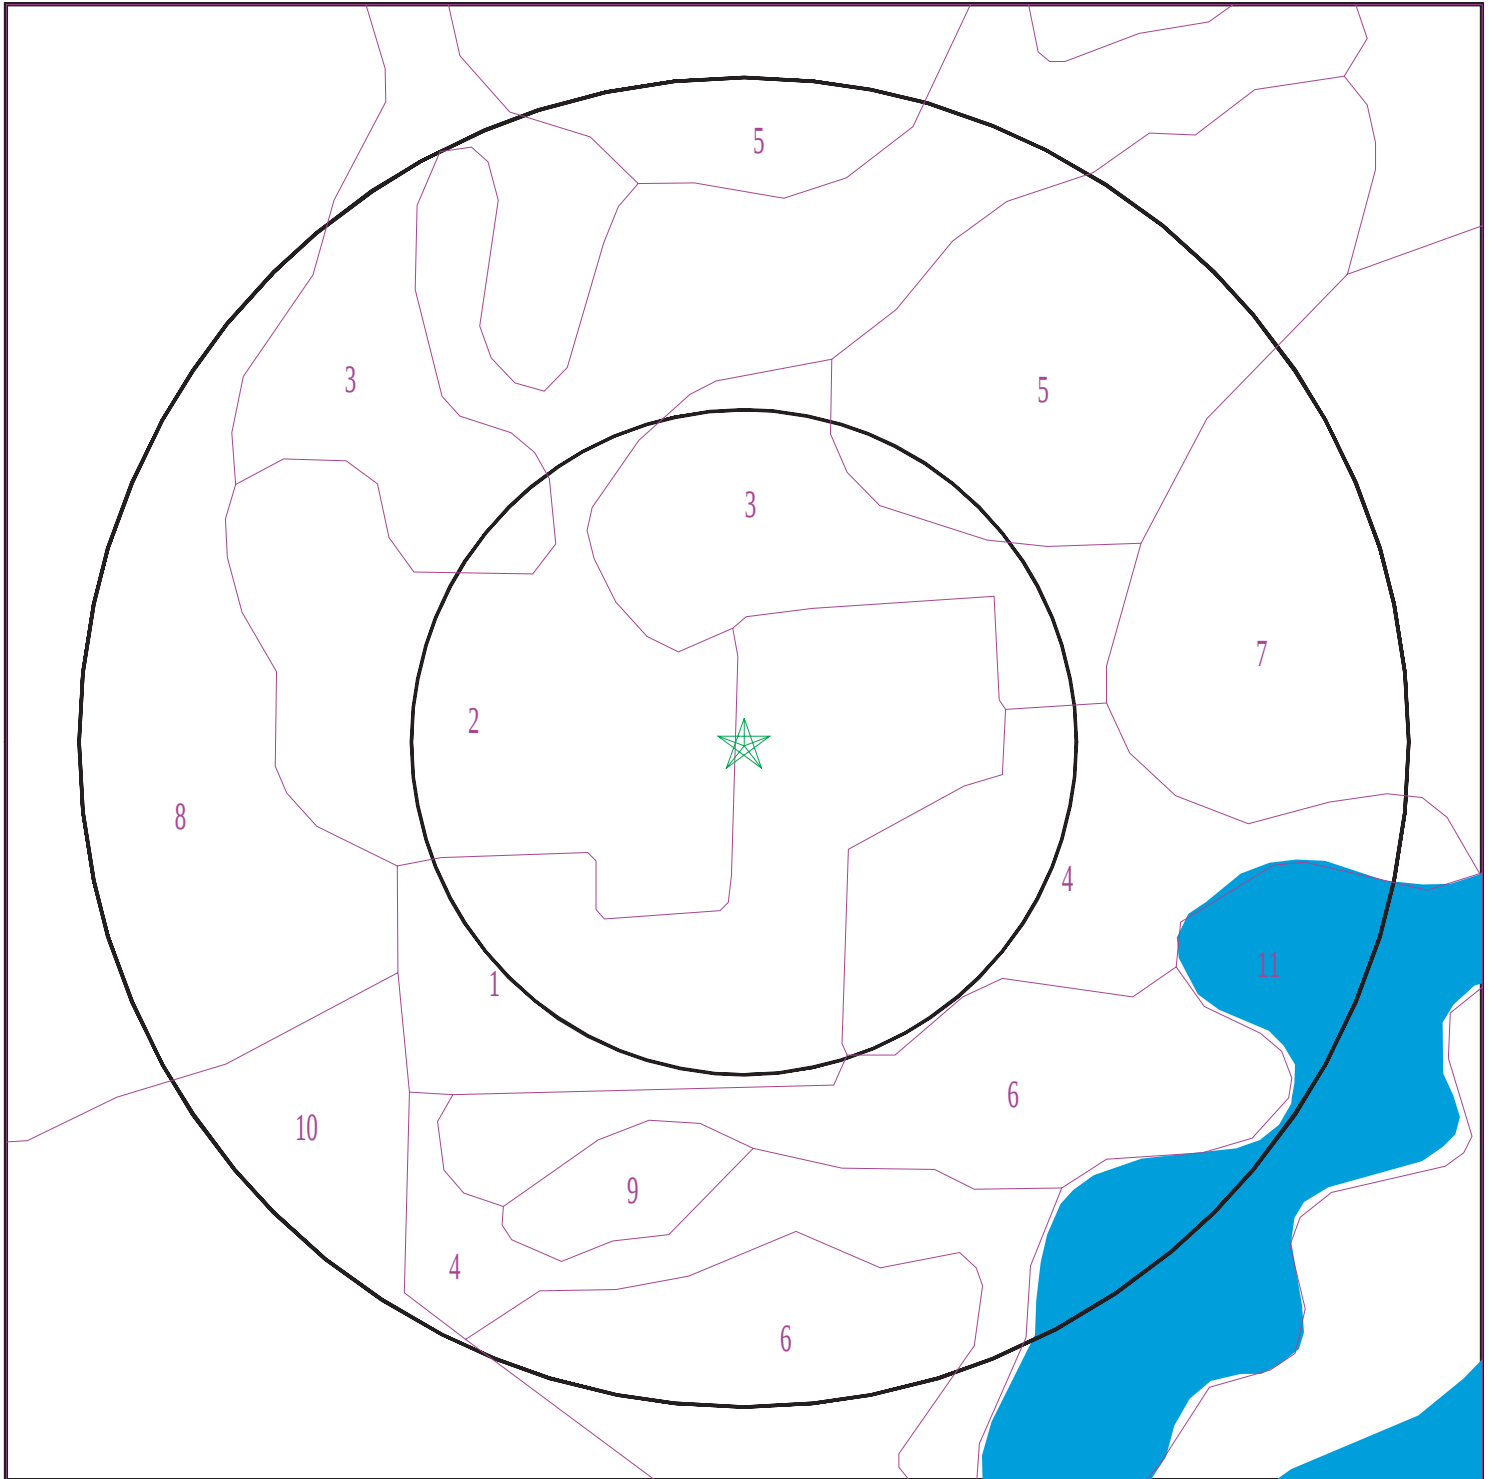

- ★ Target Property
- SSURGO Soil
- Water



SITE NAME: Bank of America
ADDRESS: 22W151 Butterfield Rd
Glen Ellyn IL 60137
LAT/LONG: 41.8312 / 88.0552

CLIENT: LFR Inc
CONTACT: Morgan Vogt
INQUIRY #: 2537497.32s
DATE: July 10, 2009 11:47 am

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

DOMINANT SOIL COMPOSITION IN GENERAL AREA OF TARGET PROPERTY

The U.S. Department of Agriculture's (USDA) Soil Conservation Service (SCS) leads the National Cooperative Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. The following information is based on Soil Conservation Service SSURGO data.

Soil Map ID: 1

Soil Component Name: Orthents, loamy

Soil Surface Texture: loam

Hydrologic Group: Class B - Moderate infiltration rates. Deep and moderately deep, moderately well and well drained soils with moderately coarse textures.

Soil Drainage Class: Well drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Moderate

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 130 inches

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	5 inches	loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 4.23 Min: 1.41	Max: 8.4 Min: 5.6
2	5 inches	59 inches	loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 4.23 Min: 1.41	Max: 8.4 Min: 5.6

Soil Map ID: 2

Soil Component Name: Ashkum

Soil Surface Texture: silty clay loam

Hydrologic Group: Class C - Slow infiltration rates. Soils with layers impeding downward movement of water, or soils with moderately fine or fine textures.

Soil Drainage Class: Poorly drained

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Hydric Status: All hydric

Corrosion Potential - Uncoated Steel: High

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 15 inches

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	53 inches	59 inches	silty clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 4.23 Min: 1.41	Max: 7.8 Min: 6.6
2	0 inches	11 inches	silty clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 4.23 Min: 1.41	Max: 7.8 Min: 6.6
3	11 inches	29 inches	silty clay	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 4.23 Min: 1.41	Max: 7.8 Min: 6.6
4	29 inches	53 inches	silty clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 4.23 Min: 1.41	Max: 7.8 Min: 6.6

Soil Map ID: 3

Soil Component Name: Ashkum

Soil Surface Texture: silty clay loam

Hydrologic Group: Class C - Slow infiltration rates. Soils with layers impeding downward movement of water, or soils with moderately fine or fine textures.

Soil Drainage Class: Somewhat poorly drained

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: High

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 33 inches

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	11 inches	silty clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 4.23 Min: 1.41	Max: 8.4 Min: 7.4
2	11 inches	29 inches	silty clay	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 4.23 Min: 1.41	Max: 8.4 Min: 7.4
3	29 inches	53 inches	silty clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 4.23 Min: 1.41	Max: 8.4 Min: 7.4
4	53 inches	59 inches	silty clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 4.23 Min: 1.41	Max: 8.4 Min: 7.4

Soil Map ID: 4

Soil Component Name: Dunham

Soil Surface Texture: silty clay loam

Hydrologic Group: Class B - Moderate infiltration rates. Deep and moderately deep, moderately well and well drained soils with moderately coarse textures.

Soil Drainage Class: Poorly drained

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Hydric Status: All hydric

Corrosion Potential - Uncoated Steel: High

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 15 inches

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	11 inches	silty clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	COARSE-GRAINED SOILS, Sands, Clean Sands, Poorly graded sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 705 Min: 141.14	Max: 8.4 Min: 7.4
2	11 inches	31 inches	silty clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	COARSE-GRAINED SOILS, Sands, Clean Sands, Poorly graded sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 705 Min: 141.14	Max: 8.4 Min: 7.4
3	31 inches	42 inches	clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	COARSE-GRAINED SOILS, Sands, Clean Sands, Poorly graded sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 705 Min: 141.14	Max: 8.4 Min: 7.4
4	42 inches	59 inches	stratified gravelly sandy loam to extremely gravelly coarse sand	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	COARSE-GRAINED SOILS, Sands, Clean Sands, Poorly graded sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 705 Min: 141.14	Max: 8.4 Min: 7.4

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Map ID: 5

Soil Component Name: Markham

Soil Surface Texture: silty clay loam

Hydrologic Group: Class C - Slow infiltration rates. Soils with layers impeding downward movement of water, or soils with moderately fine or fine textures.

Soil Drainage Class: Moderately well drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: High

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 76 inches

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	20 inches	31 inches	silty clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 1.41 Min: 0.42	Max: 8.4 Min: 7.9
2	0 inches	7 inches	silt loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 1.41 Min: 0.42	Max: 8.4 Min: 7.9
3	7 inches	20 inches	silty clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 1.41 Min: 0.42	Max: 8.4 Min: 7.9
4	31 inches	59 inches	silty clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 1.41 Min: 0.42	Max: 8.4 Min: 7.9

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Map ID: 6

Soil Component Name: Fox

Soil Surface Texture: silt loam

Hydrologic Group: Class B - Moderate infiltration rates. Deep and moderately deep, moderately well and well drained soils with moderately coarse textures.

Soil Drainage Class: Well drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Moderate

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	3 inches	silt loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Clean Sands, Poorly graded sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 705 Min: 141.14	Max: 8.4 Min: 7.4
2	3 inches	7 inches	silt loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Clean Sands, Poorly graded sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 705 Min: 141.14	Max: 8.4 Min: 7.4
3	7 inches	12 inches	silty clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Clean Sands, Poorly graded sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 705 Min: 141.14	Max: 8.4 Min: 7.4

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
4	12 inches	27 inches	clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Clean Sands, Poorly graded sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 705 Min: 141.14	Max: 8.4 Min: 7.4
5	27 inches	59 inches	stratified gravelly sand to extremely gravelly coarse sand	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Clean Sands, Poorly graded sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 705 Min: 141.14	Max: 8.4 Min: 7.4

Soil Map ID: 7

Soil Component Name: Dunham

Soil Surface Texture: silty clay loam

Hydrologic Group: Class B - Moderate infiltration rates. Deep and moderately deep, moderately well and well drained soils with moderately coarse textures.

Soil Drainage Class: Somewhat poorly drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: High

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 46 inches

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	11 inches	silty clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	COARSE-GRAINED SOILS, Sands, Clean Sands, Poorly graded sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 705 Min: 141.14	Max: 8.4 Min: 7.4
2	11 inches	31 inches	silty clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	COARSE-GRAINED SOILS, Sands, Clean Sands, Poorly graded sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 705 Min: 141.14	Max: 8.4 Min: 7.4
3	31 inches	42 inches	clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	COARSE-GRAINED SOILS, Sands, Clean Sands, Poorly graded sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 705 Min: 141.14	Max: 8.4 Min: 7.4
4	42 inches	59 inches	stratified gravelly sandy loam to extremely gravelly coarse sand	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	COARSE-GRAINED SOILS, Sands, Clean Sands, Poorly graded sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 705 Min: 141.14	Max: 8.4 Min: 7.4

Soil Map ID: 8

Soil Component Name: Markham

Soil Surface Texture: silt loam

Hydrologic Group: Class C - Slow infiltration rates. Soils with layers impeding downward movement of water, or soils with moderately fine or fine textures.

Soil Drainage Class: Moderately well drained

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Hydric Status: Partially hydric

Corrosion Potential - Uncoated Steel: Moderate

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 15 inches

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	7 inches	silt loam	Not reported	Not reported	Max: 1.41 Min: 0.42	Max: 8.4 Min: 7.4
2	7 inches	31 inches		Not reported	Not reported	Max: 1.41 Min: 0.42	Max: 8.4 Min: 7.4
3	31 inches	59 inches		Not reported	Not reported	Max: 1.41 Min: 0.42	Max: 8.4 Min: 7.4

Soil Map ID: 9

Soil Component Name: Peotone

Soil Surface Texture: silty clay loam

Hydrologic Group: Class C - Slow infiltration rates. Soils with layers impeding downward movement of water, or soils with moderately fine or fine textures.

Soil Drainage Class: Very poorly drained

Hydric Status: All hydric

Corrosion Potential - Uncoated Steel: High

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 15 inches

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	12 inches	silty clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay Soils.	Max: 4.23 Min: 1.41	Max: 8.4 Min: 6.6

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
2	12 inches	50 inches	silty clay	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 4.23 Min: 1.41	Max: 8.4 Min: 6.6
3	50 inches	59 inches	silty clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 4.23 Min: 1.41	Max: 8.4 Min: 6.6

Soil Map ID: 10

Soil Component Name: Waupecan

Soil Surface Texture: silt loam

Hydrologic Group: Class B - Moderate infiltration rates. Deep and moderately deep, moderately well and well drained soils with moderately coarse textures.

Soil Drainage Class: Well drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Moderate

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	11 inches	silt loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	COARSE-GRAINED SOILS, Sands, Clean Sands, Poorly graded sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 705 Min: 141.14	Max: 8.4 Min: 7.4

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
2	11 inches	38 inches	silty clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	COARSE-GRAINED SOILS, Sands, Clean Sands, Poorly graded sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 705 Min: 141.14	Max: 8.4 Min: 7.4
3	38 inches	44 inches	stratified gravelly loamy sand to sandy clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	COARSE-GRAINED SOILS, Sands, Clean Sands, Poorly graded sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 705 Min: 141.14	Max: 8.4 Min: 7.4
4	44 inches	59 inches	stratified gravelly loamy sand to extremely gravelly coarse sand	Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils.	COARSE-GRAINED SOILS, Sands, Clean Sands, Poorly graded sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 705 Min: 141.14	Max: 8.4 Min: 7.4

Soil Map ID: 11

Soil Component Name: Water

Soil Surface Texture: silt loam

Hydrologic Group: Class B - Moderate infiltration rates. Deep and moderately deep, moderately well and well drained soils with moderately coarse textures.

Soil Drainage Class:
Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Not Reported

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

No Layer Information available.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

LOCAL / REGIONAL WATER AGENCY RECORDS

EDR Local/Regional Water Agency records provide water well information to assist the environmental professional in assessing sources that may impact ground water flow direction, and in forming an opinion about the impact of contaminant migration on nearby drinking water wells.

WELL SEARCH DISTANCE INFORMATION

<u>DATABASE</u>	<u>SEARCH DISTANCE (miles)</u>
Federal USGS	1.000
Federal FRDS PWS	Nearest PWS within 1 mile
State Database	1.000

FEDERAL USGS WELL INFORMATION

<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>
E24	USGS2383230	1/2 - 1 Mile WSW
H57	USGS2383231	1/2 - 1 Mile WSW

FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION

<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>
H58	IL0437350	1/2 - 1 Mile WSW

Note: PWS System location is not always the same as well location.

STATE DATABASE WELL INFORMATION

<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>
1	IL10184603	0 - 1/8 Mile West
2	IL10184923	1/8 - 1/4 Mile NW
3	IL10184819	1/8 - 1/4 Mile WNW
4	IL10185045	1/4 - 1/2 Mile NNE
A5	IL10184877	1/4 - 1/2 Mile WNW
A6	IL10184814	1/4 - 1/2 Mile WNW
7	IL10185246	1/4 - 1/2 Mile North
B8	IL10185029	1/4 - 1/2 Mile NW
B9	IL10185027	1/4 - 1/2 Mile NW
B10	IL10185028	1/4 - 1/2 Mile NW
11	IL10184752	1/4 - 1/2 Mile East
12	IL10184311	1/4 - 1/2 Mile ESE
13	IL10185411	1/2 - 1 Mile North
C14	IL10185416	1/2 - 1 Mile North
C15	IL10185417	1/2 - 1 Mile North
C16	IL10185418	1/2 - 1 Mile North
17	P18935	1/2 - 1 Mile WNW
C18	IL10185461	1/2 - 1 Mile North
19	IL10185422	1/2 - 1 Mile NNE

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

STATE DATABASE WELL INFORMATION


MAP ID	WELL ID	LOCATION FROM TP
20	IL10184880	1/2 - 1 Mile ENE
D21	IL10184284	1/2 - 1 Mile WSW
D22	IL10184268	1/2 - 1 Mile WSW
23	IL10185307	1/2 - 1 Mile NW
E25	IL20003074	1/2 - 1 Mile WSW
26	IL10184249	1/2 - 1 Mile WSW
F27	IL10184901	1/2 - 1 Mile WNW
F28	IL10184900	1/2 - 1 Mile WNW
F29	IL10184902	1/2 - 1 Mile WNW
F30	IL10184872	1/2 - 1 Mile WNW
G31	IL10185221	1/2 - 1 Mile WNW
G32	P18932	1/2 - 1 Mile NW
G33	P18931	1/2 - 1 Mile NW
G34	P18927	1/2 - 1 Mile NW
G35	P18924	1/2 - 1 Mile NW
G36	P18926	1/2 - 1 Mile NW
G37	P18933	1/2 - 1 Mile NW
G38	P18934	1/2 - 1 Mile NW
G39	P18928	1/2 - 1 Mile NW
G40	P18930	1/2 - 1 Mile NW
G41	P18929	1/2 - 1 Mile NW
G42	P18925	1/2 - 1 Mile NW
G43	P18915	1/2 - 1 Mile NW
G44	P18913	1/2 - 1 Mile NW
G45	P18914	1/2 - 1 Mile NW
G46	P18916	1/2 - 1 Mile NW
G47	P18921	1/2 - 1 Mile NW
G48	P18920	1/2 - 1 Mile NW
G49	P18917	1/2 - 1 Mile NW
G50	P18918	1/2 - 1 Mile NW
G51	P18923	1/2 - 1 Mile NW
G52	P18922	1/2 - 1 Mile NW
G53	P18919	1/2 - 1 Mile NW
H54	IL20003075	1/2 - 1 Mile WSW
I55	IL10185646	1/2 - 1 Mile North
I56	IL10185645	1/2 - 1 Mile North
59	IL10185486	1/2 - 1 Mile NW
J60	P18998	1/2 - 1 Mile SW
J61	P18999	1/2 - 1 Mile SW
J62	P19005	1/2 - 1 Mile SW
J63	P19004	1/2 - 1 Mile SW
J64	P19001	1/2 - 1 Mile SW
J65	P19000	1/2 - 1 Mile SW
J66	P19003	1/2 - 1 Mile SW
J67	P19002	1/2 - 1 Mile SW
68	IL10185086	1/2 - 1 Mile WNW
69	IL10184796	1/2 - 1 Mile West
K70	IL10184366	1/2 - 1 Mile WSW
K71	IL10184367	1/2 - 1 Mile WSW
K72	IL10184368	1/2 - 1 Mile WSW
H73	IL10184231	1/2 - 1 Mile WSW
74	IL10185011	1/2 - 1 Mile WNW

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

STATE DATABASE WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
H75	IL10184203	1/2 - 1 Mile WSW
H76	IL10184179	1/2 - 1 Mile WSW
77	IL10185155	1/2 - 1 Mile WNW
78	IL10183931	1/2 - 1 Mile WSW
L79	P19009	1/2 - 1 Mile WSW
L80	P19008	1/2 - 1 Mile WSW
81	IL10185826	1/2 - 1 Mile North
M82	IL10185377	1/2 - 1 Mile NW
N83	P18911	1/2 - 1 Mile NE
N84	P18910	1/2 - 1 Mile NE
O85	P19007	1/2 - 1 Mile WSW
L86	IL10184294	1/2 - 1 Mile WSW
P87	IL10185032	1/2 - 1 Mile WNW
P88	IL10185072	1/2 - 1 Mile WNW
M89	IL10185390	1/2 - 1 Mile NW
P90	IL10185005	1/2 - 1 Mile WNW
P91	IL10185004	1/2 - 1 Mile WNW
P92	IL10185006	1/2 - 1 Mile WNW
P93	IL10185007	1/2 - 1 Mile WNW
94	IL10185338	1/2 - 1 Mile WNW
Q95	IL10184174	1/2 - 1 Mile WSW
Q96	IL10185212	1/2 - 1 Mile WNW
Q97	IL10185213	1/2 - 1 Mile WNW
R98	IL10183929	1/2 - 1 Mile WSW
99	IL10185344	1/2 - 1 Mile WNW
S100	IL10184325	1/2 - 1 Mile West
S101	IL10184365	1/2 - 1 Mile West
102	P19010	1/2 - 1 Mile WSW
S103	IL10184279	1/2 - 1 Mile WSW
R104	IL10183995	1/2 - 1 Mile WSW
S105	P18995	1/2 - 1 Mile WSW
106	IL10184544	1/2 - 1 Mile West
S107	IL10184346	1/2 - 1 Mile West
S108	IL10184347	1/2 - 1 Mile West
109	IL10186100	1/2 - 1 Mile North
T110	P18936	1/2 - 1 Mile WNW
T111	P18937	1/2 - 1 Mile WNW

PHYSICAL SETTING SOURCE MAP - 2537497.32s

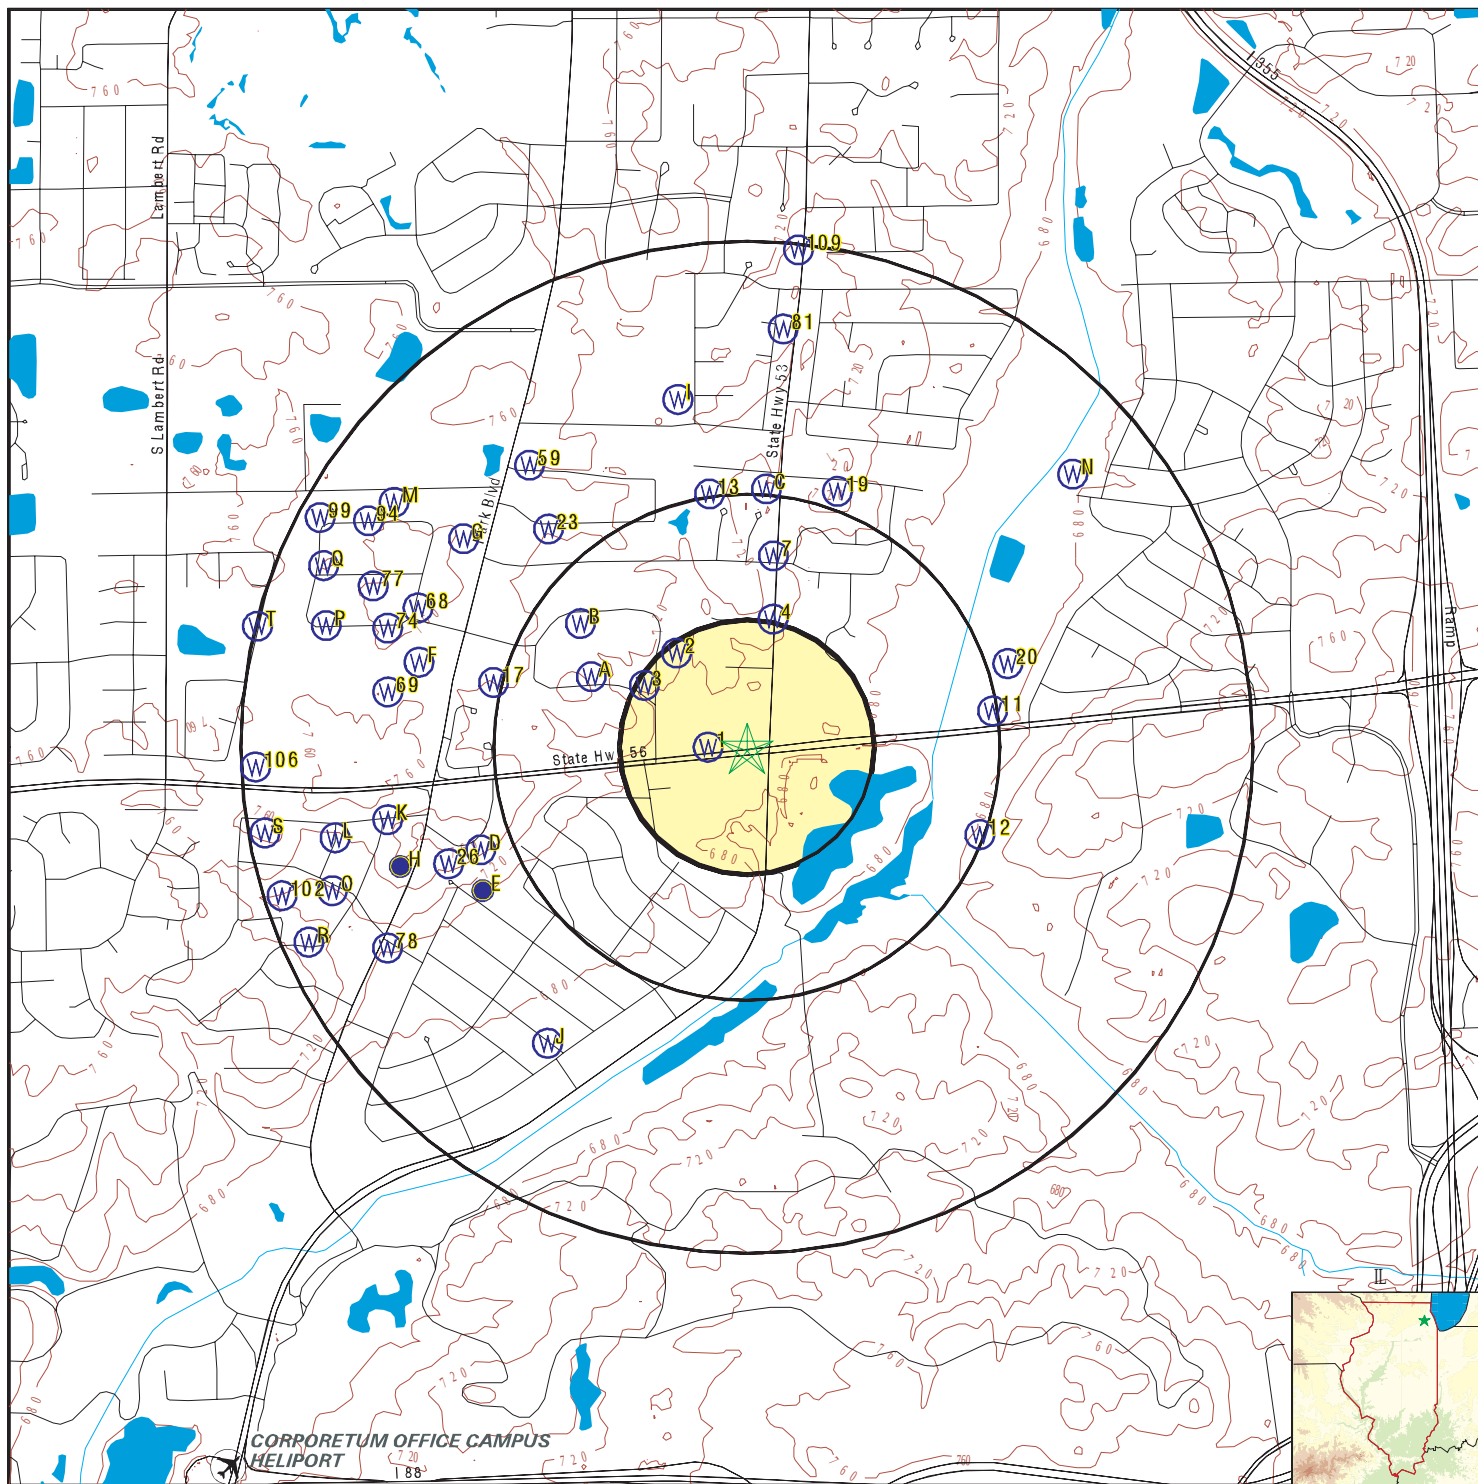

- County Boundary
- Major Roads
- Contour Lines
- Airports
- Earthquake epicenter, Richter 5 or greater
- Water Wells
- Public Water Supply Wells
- Cluster of Multiple Icons

- Groundwater Flow Direction
- Indeterminate Groundwater Flow at Location
- Groundwater Flow Varies at Location
- Closest Hydrogeological Data

SITE NAME: Bank of America
 ADDRESS: 22W151 Butterfield Rd
 Glen Ellyn IL 60137
 LAT/LONG: 41.8312 / 88.0552

CLIENT: LFR Inc
 CONTACT: Morgan Vogt
 INQUIRY #: 2537497.32s
 DATE: July 10, 2009 11:47 am

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database

EDR ID Number

1

West
0 - 1/8 Mile
Higher

IL WELLS

IL10184603

Source:	IL Water Wells Records		
Objectid:	90621	Status:	Water Well
Api:	120432439500		
Longitude:	-88.056572		
Latitude:	41.831157		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Webb Packey
Farm num:	Not Reported	Company na:	Dupage Pump
Elevation:	0		
Elevref:	Not Reported		
Total dept:	150		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.05668263		
Shapey:	41.83120074		
Site id:	IL10184603		

2

NW
1/8 - 1/4 Mile
Higher

IL WELLS

IL10184923

Source:	IL Water Wells Records		
Objectid:	59526	Status:	Water Well
Api:	120432560800		
Longitude:	-88.057779		
Latitude:	41.833856		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Wetzel Bldrs
Farm num:	Not Reported	Company na:	K & K Well Drilling
Elevation:	0		
Elevref:	Not Reported		
Total dept:	140		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.05788975		
Shapey:	41.83389971		
Site id:	IL10184923		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

3

WNW

**1/8 - 1/4 Mile
Higher**

IL WELLS

IL10184819

Source:	IL Water Wells Records		
Objectid:	50895	Status:	Water Well
Api:	120432996000		
Longitude:	-88.059015		
Latitude:	41.832925		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Istanbouli, Linda
Farm num:	Not Reported	Company na:	Kerry, Charles
Elevation:	0		
Elevref:	Not Reported		
Total dept:	180		
Wformation:	rock		
Wfmfrom:	114		
Wfmto:	180		
Pumpgpm:	10		
Shapex:	-88.05912576		
Shapey:	41.83296971		
Site id:	IL10184819		

4

NNE

**1/4 - 1/2 Mile
Higher**

IL WELLS

IL10185045

Source:	IL Water Wells Records		
Objectid:	80609	Status:	Water Well
Api:	120430015600		
Longitude:	-88.054084		
Latitude:	41.834827		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	King Dale
Farm num:	Not Reported	Company na:	Randa Wm J
Elevation:	732		
Elevref:	Ground level		
Total dept:	180		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.05419367		
Shapey:	41.83487073		
Site id:	IL10185045		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

A5
WNW
1/4 - 1/2 Mile
Higher

IL WELLS IL10184877

Source:	IL Water Wells Records		
Objectid:	201791	Status:	Water Well
Api:	120430070200		
Longitude:	-88.06061		
Latitude:	41.833473		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Mills Wesley K
Farm num:	56	Company na:	Randa Wm J
Elevation:	0		
Elevref:	Not Reported		
Total dept:	180		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.06072083		
Shapey:	41.8335177		
Site id:	IL10184877		

A6
WNW
1/4 - 1/2 Mile
Higher

IL WELLS IL10184814

Source:	IL Water Wells Records		
Objectid:	129972	Status:	Water Well
Api:	120432560700		
Longitude:	-88.061471		
Latitude:	41.832880		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Taylor Don
Farm num:	Not Reported	Company na:	Not Reported
Elevation:	0		
Elevref:	Not Reported		
Total dept:	165		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.06158084		
Shapey:	41.8329237		
Site id:	IL10184814		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database

EDR ID Number

7

North
1/4 - 1/2 Mile
Higher

IL WELLS

IL10185246

Source: IL Water Wells Records
Objectid: 169016
Api: 120433101600
Longitude: -88.054067
Latitude: 41.836637
Section : 26
Twp: 39
Tdir: N
Rng: 10
Rdir: E
Farm num: Not Reported
Elevation: 0
Elevref: Not Reported
Total dept: 0
Wformation: Not Reported
Wfmfrom: 0
Wfmto: 0
Pumpgpm: 0
Shapex: -88.05417772
Shapey: 41.83668171
Site id: IL10185246

Status:

Water Well

Farm name:
Company na:

St. Thomas United Methodist Ch
Not Reported

B8

NW
1/4 - 1/2 Mile
Higher

IL WELLS

IL10185029

Source: IL Water Wells Records
Objectid: 268254
Api: 120432560600
Longitude: -88.061462
Latitude: 41.834699
Section : 26
Twp: 39
Tdir: N
Rng: 10
Rdir: E
Farm num: Not Reported
Elevation: 0
Elevref: Not Reported
Total dept: 190
Wformation: Not Reported
Wfmfrom: 0
Wfmto: 0
Pumpgpm: 0
Shapex: -88.06157189
Shapey: 41.83474269
Site id: IL10185029

Status:

Water Well

Farm name:
Company na:

Russell Jim
Knierim James Muelle

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

B9
NW
1/4 - 1/2 Mile
Higher

IL WELLS IL10185027

Source:	IL Water Wells Records		
Objectid:	62285	Status:	Water Well
Api:	120432963000		
Longitude:	-88.061462		
Latitude:	41.834699		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Cesario Homes
Farm num:	Not Reported	Company na:	Fykes, Charles N.
Elevation:	0		
Elevref:	Not Reported		
Total dept:	205		
Wformation:	limestone		
Wfmfrom:	100		
Wfmto:	205		
Pumpgpm:	0		
Shapex:	-88.06157189		
Shapey:	41.83474269		
Site id:	IL10185027		

B10
NW
1/4 - 1/2 Mile
Higher

IL WELLS IL10185028

Source:	IL Water Wells Records		
Objectid:	135159	Status:	Water Well
Api:	120432486800		
Longitude:	-88.061462		
Latitude:	41.834699		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Gall Tim
Farm num:	Not Reported	Company na:	Dupage Pump
Elevation:	0		
Elevref:	Not Reported		
Total dept:	160		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.06157189		
Shapey:	41.83474269		
Site id:	IL10185028		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

11

East
1/4 - 1/2 Mile
Lower

IL WELLS IL10184752

Source:	IL Water Wells Records		
Objectid:	133866		
Api:	120433048000	Status:	Engineering Test
Longitude:	-88.045678		
Latitude:	41.832193		
Section :	25		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Butterfield Rd. over DuPage River
Farm num:	1	Company na:	IL Dept. of Transportation
Elevation:	0		
Elevref:	Ground level		
Total dept:	0		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.04578733		
Shapey:	41.8322378		
Site id:	IL10184752		

12

ESE
1/4 - 1/2 Mile
Lower

IL WELLS IL10184311

Source:	IL Water Wells Records		
Objectid:	263957		
Api:	120430186000	Status:	Water Well
Longitude:	-88.046166		
Latitude:	41.828651		
Section :	36		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Morton Mark
Farm num:	1	Company na:	Geiger, S. B. Co.
Elevation:	790		
Elevref:	Ground level		
Total dept:	912		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.04627623		
Shapey:	41.82869582		
Site id:	IL10184311		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database

EDR ID Number

13

North
1/2 - 1 Mile
Higher

IL WELLS

IL10185411

Source:	IL Water Wells Records		
Objectid:	252425	Status:	Water Well
Api:	120430121800		
Longitude:	-88.056514		
Latitude:	41.838411		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Harding A T
Farm num:	Not Reported	Company na:	Liberg, Patrick A.
Elevation:	0		
Elevref:	Not Reported		
Total dept:	152		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.05662486		
Shapey:	41.83845568		
Site id:	IL10185411		

C14

North
1/2 - 1 Mile
Higher

IL WELLS

IL10185416

Source:	IL Water Wells Records		
Objectid:	80103	Status:	Water Well
Api:	120432394500		
Longitude:	-88.054051		
Latitude:	41.838448		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Intogna Mr
Farm num:	Not Reported	Company na:	Dupage Pump
Elevation:	0		
Elevref:	Not Reported		
Total dept:	160		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.05416178		
Shapey:	41.83849269		
Site id:	IL10185416		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database

EDR ID Number

C15
North
1/2 - 1 Mile
Higher

IL WELLS

IL10185417

Source:	IL Water Wells Records		
Objectid:	181480		
Api:	120430087000	Status:	Water Well
Longitude:	-88.054051		
Latitude:	41.838448		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Gramke Russell
Farm num:	Not Reported	Company na:	Neely, George
Elevation:	0		
Elevref:	Not Reported		
Total dept:	125		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.05416178		
Shapey:	41.83849269		
Site id:	IL10185417		

C16
North
1/2 - 1 Mile
Higher

IL WELLS

IL10185418

Source:	IL Water Wells Records		
Objectid:	268615		
Api:	120430091900	Status:	Water Well
Longitude:	-88.054051		
Latitude:	41.838448		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Able Const
Farm num:	Not Reported	Company na:	Sission, Edward H.
Elevation:	0		
Elevref:	Not Reported		
Total dept:	125		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.05416178		
Shapey:	41.83849269		
Site id:	IL10185418		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

17
WNW
1/2 - 1 Mile
Higher

IL WELLS P18935

Well ID:	263804	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	CESARIO BUILDERS		
Permit:	H940092	Date Drilled:	08/25/1994
Depth (in feet):	205	Aquifer Type:	Bedrock
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	26	Plot Location:	4C
Well Use:	Domestic	Well Type:	Drilled
Record Type:	Construction Report,Geology		
Driller:	LOCKPORT WELL & PUMP		

C18
North
1/2 - 1 Mile
Higher

IL WELLS IL10185461

Source:	IL Water Wells Records		
Objectid:	41784		
Api:	120430085000	Status:	Water Well
Longitude:	-88.055207		
Latitude:	41.838867		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Demarco Eugene
Farm num:	Not Reported	Company na:	Liberg, Patrick A.
Elevation:	0		
Elevref:	Not Reported		
Total dept:	130		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.05531783		
Shapey:	41.83891068		
Site id:	IL10185461		

19
NNE
1/2 - 1 Mile
Higher

IL WELLS IL10185422

Source:	IL Water Wells Records		
Objectid:	63721		
Api:	120432917200	Status:	Water Well
Longitude:	-88.051614		
Latitude:	41.838483		
Section :	25		
Twp:	39		
Tdir:	N		
Rng:	10		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Rdir: E
Farm num: 2
Elevation: 0
Elevref: Not Reported
Total dept: 150
Wformation: limestone
Wfmfrom: 100
Wfmto: 150
Pumpgpm: 10
Shapex: -88.0517247
Shapey: 41.83852671
Site id: IL10185422

Farm name: Blackstone, Ray
Company na: Shaver, James R. Sr.

20 ENE 1/2 - 1 Mile Lower

IL WELLS IL10184880

Source: IL Water Wells Records
Objectid: 75003
Api: 120430076800
Longitude: -88.045096
Latitude: 41.833551
Section : 25
Twp: 39
Tdir: N
Rng: 10
Rdir: E
Farm num: 4
Elevation: 745
Elevref: Ground level
Total dept: 298
Wformation: Not Reported
Wfmfrom: 0
Wfmto: 0
Pumpgpm: 0
Shapex: -88.04520535
Shapey: 41.83359479
Site id: IL10184880

Status: Water Well

Farm name: Citizens Utilities
Company na: Layne Western Co., Inc.

D21 WSW 1/2 - 1 Mile Higher

IL WELLS IL10184284

Source: IL Water Wells Records
Objectid: 50572
Api: 120430002300
Longitude: -88.070124
Latitude: 41.824327
Section : 35
Twp: 39
Tdir: N
Rng: 10

Status: Water Well

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Rdir: E
Farm num: 3
Elevation: 750
Elevref: Ground level
Total dept: 250
Wformation: Not Reported
Wfmfrom: 0
Wfmto: 0
Pumpgpm: 0
Shapex: -88.06525881
Shapey: 41.82841072
Site id: IL10184284

Farm name: Valley View Subdiv
Company na: Layne Western Co., Inc.

D22
WSW
1/2 - 1 Mile
Higher

IL WELLS IL10184268

Source: IL Water Wells Records
Objectid: 11432
Api: 120430238700
Longitude: -88.065409
Latitude: 41.828067
Section : 35
Twp: 39
Tdir: N
Rng: 10
Rdir: E
Farm num: Not Reported
Elevation: 0
Elevref: Not Reported
Total dept: 171
Wformation: Not Reported
Wfmfrom: 0
Wfmto: 0
Pumpgpm: 0
Shapex: -88.06551981
Shapey: 41.82811072
Site id: IL10184268

Status: Water Well

Farm name: Keim Joe Bldrs
Company na: Liberg, Patrick A.

23
NW
1/2 - 1 Mile
Higher

IL WELLS IL10185307

Source: IL Water Wells Records
Objectid: 283836
Api: 120432560900
Longitude: -88.06268
Latitude: 41.837407
Section : 26
Twp: 39
Tdir: N
Rng: 10

Status: Water Well

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Rdir:	E	Farm name:	Woodside Bldrs
Farm num:	Not Reported	Company na:	K & K Well Drilling
Elevation:	0		
Elevref:	Not Reported		
Total dept:	195		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.06279001		
Shapey:	41.83745066		
Site id:	IL10185307		

E24 WSW 1/2 - 1 Mile Higher

FED USGS USGS2383230

Agency cd:	USGS	Site no:	414938088035501
Site name:	39N10E-35.5g1		
Latitude:	414938	Dec lat:	41.82725196
Longitude:	0880355	Coor meth:	M
Dec lon:	-88.06534356	Latlong datum:	NAD27
Coor accr:	F	District:	17
Dec latlong datum:	NAD83	County:	043
State:	17	Land net:	SWNENWS35 T 39N R 10E 3
Country:	US	Map scale:	24000
Location map:	WHEATON		
Altitude:	700		
Altitude method:	Interpolated from topographic map		
Altitude accuracy:	5		
Altitude datum:	National Geodetic Vertical Datum of 1929		
Hydrologic:	Des Plaines. Illinois, Wisconsin. Area = 1440 sq.mi.		
Topographic:	Flat surface		
Site type:	Ground-water other than Spring	Date construction:	195707
Date inventoried:	Not Reported	Mean greenwich time offset:	CST
Local standard time flag:	N		
Type of ground water site:	Single well, other than collector or Ranney type		
Aquifer Type:	Not Reported		
Aquifer:	SILURIAN SYSTEM		
Well depth:	250	Hole depth:	250
Source of depth data:	other government (other than USGS)		
Project number:	441706200		
Real time data flag:	0	Daily flow data begin date:	0000-00-00
Daily flow data end date:	0000-00-00	Daily flow data count:	0
Peak flow data begin date:	0000-00-00	Peak flow data end date:	0000-00-00
Peak flow data count:	0	Water quality data begin date:	1985-07-01
Water quality data end date:	1985-07-01	Water quality data count:	1
Ground water data begin date:	1957-07-17	Ground water data end date:	1982-00-00
Ground water data count:	6		

Ground-water levels, Number of Measurements: 6

Date	Feet below Surface	Feet to Sealevel	Date	Feet below Surface	Feet to Sealevel
1982	40		1976-09	38	
1972-07	38		1971-06	39	
1958-06-12	35		1957-07-17	31	

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

E25
WSW
1/2 - 1 Mile
Higher

IL WELLS IL20003074

Source: IL Water Well Location Information
Syskey: 716437
Facilityid: WL20538
Avail: O
Facstatus: I
Depth draw: 0
Depth toca: 81
Depth comp: 250
Lat dd: 41.826944
Long dd: -88.065278

Watertype: GW
Facname: WELL 3 (20538) ABANDONED

Syskey: 716437
Systemid: IL0437350
Acname: BOYD, SARAH
Addr2: PO BOX 24040
St: IL
Phoneno: 618-239-3245

Sysname: IL AMERICAN-VALLEY VIEW
Addr1: 100 NORTH WATER WORKS DRIVE
City: BELLEVILLE
Zip: 62223-9040

26
WSW
1/2 - 1 Mile
Higher

IL WELLS IL10184249

Source: IL Water Wells Records
Objectid: 76879
Api: 120430002100
Longitude: -88.066509
Latitude: 41.827818
Section : 35
Twp: 39
Tdir: N
Rng: 10
Rdir: E
Farm num: 1
Elevation: 750
Elevref: Ground level
Total dept: 290
Wformation: Not Reported
Wfmfrom: 0
Wfmto: 0
Pumpgpm: 0
Shapex: -88.06661883
Shapey: 41.82786172
Site id: IL10184249

Status: Water Well

Farm name: Valley View Subdiv
Company na: Layne Western Co., Inc.

F27
WNW
1/2 - 1 Mile
Higher

IL WELLS IL10184901

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Source:	IL Water Wells Records		
Objectid:	69990		
Api:	120430319200	Status:	Water Well
Longitude:	-88.067609		
Latitude:	41.833677		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Foley Robt
Farm num:	Not Reported	Company na:	Du Page Pump Inc
Elevation:	0		
Elevref:	Not Reported		
Total dept:	175		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.06772005		
Shapey:	41.83372166		
Site id:	IL10184901		

**F28
WNW
1/2 - 1 Mile
Higher****IL WELLS IL10184900**

Source:	IL Water Wells Records		
Objectid:	43956		
Api:	120430334200	Status:	Water Well
Longitude:	-88.067609		
Latitude:	41.833677		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Ericksen Ray
Farm num:	Not Reported	Company na:	K & K Well Drilling
Elevation:	0		
Elevref:	Not Reported		
Total dept:	200		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.06772005		
Shapey:	41.83372166		
Site id:	IL10184900		

**F29
WNW
1/2 - 1 Mile
Higher****IL WELLS IL10184902**

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Source:	IL Water Wells Records		
Objectid:	92818		
Api:	120432673000	Status:	Water Well
Longitude:	-88.067609		
Latitude:	41.833677		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	MGS Development
Farm num:	Not Reported	Company na:	Knierim, Phil
Elevation:	0		
Elevref:	Not Reported		
Total dept:	140		
Wformation:	rock		
Wfmfrom:	80		
Wfmto:	140		
Pumpgpm:	15		
Shapex:	-88.06772005		
Shapey:	41.83372166		
Site id:	IL10184902		

**F30
WNW
1/2 - 1 Mile
Higher****IL WELLS IL10184872**

Source:	IL Water Wells Records		
Objectid:	44908		
Api:	120430228300	Status:	Water Well
Longitude:	-88.067734		
Latitude:	41.833329		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Glen Ellyn
Farm num:	Not Reported	Company na:	Layne Western Co., Inc.
Elevation:	0		
Elevref:	Not Reported		
Total dept:	419		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.06784504		
Shapey:	41.83337266		
Site id:	IL10184872		

**G31
WNW
1/2 - 1 Mile
Higher****IL WELLS IL10185221**

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Source:	IL Water Wells Records		
Objectid:	185681		
Api:	120430119200	Status:	Water Well
Longitude:	-88.066375		
Latitude:	41.836436		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Ougeck
Farm num:	Not Reported	Company na:	Sission, Edward H.
Elevation:	0		
Elevref:	Not Reported		
Total dept:	124		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.0664861		
Shapey:	41.83647964		
Site id:	IL10185221		

**G32
NW
1/2 - 1 Mile
Higher**

IL WELLS P18932

Well ID:	233329	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	ADLER PLUMBING		
Permit:	Not Reported	Date Drilled:	09/06/1990
Depth (in feet):	135	Aquifer Type:	--
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	26	Plot Location:	Not Reported
Well Use:	Industrial/Commercial	Well Type:	--
Record Type:	Affidavit		
Driller:	MEADOW EQUIPMENT		

**G33
NW
1/2 - 1 Mile
Higher**

IL WELLS P18931

Well ID:	233328	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	ADLER PLUMBING		
Permit:	Not Reported	Date Drilled:	09/06/1990
Depth (in feet):	200	Aquifer Type:	--
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	26	Plot Location:	Not Reported
Well Use:	Industrial/Commercial	Well Type:	--
Record Type:	Affidavit		
Driller:	MEADOW EQUIPMENT		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

G34
NW
1/2 - 1 Mile
Higher

IL WELLS P18927

Well ID:	233323	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	JOHN CAMPANELLA LOT 102		
Permit:	Not Reported	Date Drilled:	//
Depth (in feet):	165	Aquifer Type:	Bedrock
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	26	Plot Location:	Not Reported
Well Use:	Domestic	Well Type:	--
Record Type:	Construction Report,Geology		
Driller:	GORLO		

G35
NW
1/2 - 1 Mile
Higher

IL WELLS P18924

Well ID:	233320	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	COLLEGE OF DUPAGE		
Permit:	Not Reported	Date Drilled:	09/06/1990
Depth (in feet):	135	Aquifer Type:	--
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	26	Plot Location:	Not Reported
Well Use:	School	Well Type:	--
Record Type:	Affidavit		
Driller:	MEADOW EQUIPMENT		

G36
NW
1/2 - 1 Mile
Higher

IL WELLS P18926

Well ID:	233322	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	RUSSELL GRAMKE		
Permit:	3110	Date Drilled:	00/00/1967
Depth (in feet):	125	Aquifer Type:	Bedrock
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	26	Plot Location:	Not Reported
Well Use:	Domestic	Well Type:	--
Record Type:	Construction Report,Geology		
Driller:	NEELY		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

G37
NW
1/2 - 1 Mile
Higher

IL WELLS P18933

Well ID:	233330	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	ADLER PLUMBING		
Permit:	Not Reported	Date Drilled:	09/06/1990
Depth (in feet):	180	Aquifer Type:	--
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	26	Plot Location:	Not Reported
Well Use:	Industrial/Commercial	Well Type:	--
Record Type:	Affidavit		
Driller:	MEADOW EQUIPMENT		

G38
NW
1/2 - 1 Mile
Higher

IL WELLS P18934

Well ID:	233331	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	ALDER PLUMBING		
Permit:	Not Reported	Date Drilled:	09/06/1990
Depth (in feet):	200	Aquifer Type:	--
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	26	Plot Location:	Not Reported
Well Use:	Industrial/Commercial	Well Type:	--
Record Type:	Affidavit		
Driller:	MEADOW EQUIPMENT		

G39
NW
1/2 - 1 Mile
Higher

IL WELLS P18928

Well ID:	233324	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	THOMPSON		
Permit:	03573	Date Drilled:	00/00/1959
Depth (in feet):	165	Aquifer Type:	Bedrock
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	26	Plot Location:	Not Reported
Well Use:	Domestic	Well Type:	--
Record Type:	Construction Report,Geology		
Driller:	A-1 DRILLING CO.		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

G40
NW
1/2 - 1 Mile
Higher

IL WELLS P18930

Well ID:	233327	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	WESLEY K.MILLS LOT 42		
Permit:	AW-472	Date Drilled:	00/00/1959
Depth (in feet):	180	Aquifer Type:	Bedrock
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	26	Plot Location:	Not Reported
Well Use:	Domestic	Well Type:	--
Record Type:	Construction Report,Geology		
Driller:	ARNT & SON		

G41
NW
1/2 - 1 Mile
Higher

IL WELLS P18929

Well ID:	233325	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	DALE KING		
Permit:	Not Reported	Date Drilled:	00/00/1958
Depth (in feet):	180	Aquifer Type:	Bedrock
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	26	Plot Location:	Not Reported
Well Use:	Domestic	Well Type:	--
Record Type:	Construction Report,Geology		
Driller:	ARNT & SON		

G42
NW
1/2 - 1 Mile
Higher

IL WELLS P18925

Well ID:	233321	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	COLLEGE OF DUPAGE		
Permit:	Not Reported	Date Drilled:	09/06/1990
Depth (in feet):	180	Aquifer Type:	--
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	26	Plot Location:	Not Reported
Well Use:	School	Well Type:	--
Record Type:	Affidavit		
Driller:	MEADOW EQUIPMENT		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

G43
NW
1/2 - 1 Mile
Higher

IL WELLS P18915

Well ID:	176020	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	ADLER PLUMBING		
Permit:	Not Reported	Date Drilled:	09/06/1990
Depth (in feet):	180	Aquifer Type:	--
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	26	Plot Location:	Not Reported
Well Use:	Commercial	Well Type:	--
Record Type:	Affidavit		
Driller:	MEADOW EQUIPMENT		

G44
NW
1/2 - 1 Mile
Higher

IL WELLS P18913

Well ID:	176018	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	ADLER PLUMBING		
Permit:	Not Reported	Date Drilled:	09/06/1990
Depth (in feet):	200	Aquifer Type:	--
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	26	Plot Location:	Not Reported
Well Use:	Commercial	Well Type:	--
Record Type:	Affidavit		
Driller:	MEADOW EQUIPMENT		

G45
NW
1/2 - 1 Mile
Higher

IL WELLS P18914

Well ID:	176019	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	ADLER PLUMBING		
Permit:	Not Reported	Date Drilled:	09/06/1990
Depth (in feet):	135	Aquifer Type:	--
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	26	Plot Location:	Not Reported
Well Use:	Commercial	Well Type:	--
Record Type:	Affidavit		
Driller:	MEADOW EQUIPMENT		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

G46
NW
1/2 - 1 Mile
Higher

IL WELLS P18916

Well ID:	176021	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	ADLER PLUMBING		
Permit:	Not Reported	Date Drilled:	09/06/1990
Depth (in feet):	200	Aquifer Type:	--
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	26	Plot Location:	Not Reported
Well Use:	Commercial	Well Type:	--
Record Type:	Affidavit		
Driller:	MEADOW EQUIPMENT		

G47
NW
1/2 - 1 Mile
Higher

IL WELLS P18921

Well ID:	176242	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	THOMPSON		
Permit:	003573	Date Drilled:	00/00/1959
Depth (in feet):	165	Aquifer Type:	Bedrock
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	26	Plot Location:	Not Reported
Well Use:	Domestic	Well Type:	--
Record Type:	Construction Report,Geology		
Driller:	A-1 WELL DRILLING CO		

G48
NW
1/2 - 1 Mile
Higher

IL WELLS P18920

Well ID:	176241	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	JOHN L CAMPANELLA LOT 102		
Permit:	Not Reported	Date Drilled:	00/00/0000
Depth (in feet):	165	Aquifer Type:	Bedrock
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	26	Plot Location:	Not Reported
Well Use:	Domestic	Well Type:	--
Record Type:	Construction Report,Geology,Indicates comment in owner's field something unusual		
Driller:	GORLO		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

G49
NW
1/2 - 1 Mile
Higher

IL WELLS P18917

Well ID:	176030	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	COLLEGE OF DUPAGE		
Permit:	Not Reported	Date Drilled:	09/06/1990
Depth (in feet):	135	Aquifer Type:	--
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	26	Plot Location:	Not Reported
Well Use:	School	Well Type:	--
Record Type:	Affidavit		
Driller:	MEADOW EQUIPMENT		

G50
NW
1/2 - 1 Mile
Higher

IL WELLS P18918

Well ID:	176031	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	COLLEGE OF DUPAGE		
Permit:	Not Reported	Date Drilled:	09/06/1990
Depth (in feet):	180	Aquifer Type:	--
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	26	Plot Location:	Not Reported
Well Use:	School	Well Type:	--
Record Type:	Affidavit		
Driller:	MEADOW EQUIPMENT		

G51
NW
1/2 - 1 Mile
Higher

IL WELLS P18923

Well ID:	176245	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	WESLEY K MILLS LOT 42		
Permit:	AW472	Date Drilled:	00/00/1959
Depth (in feet):	180	Aquifer Type:	Bedrock
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	26	Plot Location:	Not Reported
Well Use:	Domestic	Well Type:	--
Record Type:	Construction Report,Geology,Indicates comment in owner's field something unusual		
Driller:	ARNT & SON		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

G52
NW
1/2 - 1 Mile
Higher

IL WELLS P18922

Well ID:	176243	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	MR DALE KING		
Permit:	Not Reported	Date Drilled:	00/00/1958
Depth (in feet):	180	Aquifer Type:	Bedrock
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	26	Plot Location:	Not Reported
Well Use:	Domestic	Well Type:	--
Record Type:	Construction Report,Geology		
Driller:	N ARNT & SON		

G53
NW
1/2 - 1 Mile
Higher

IL WELLS P18919

Well ID:	176240	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	RUSSELL GRAMKE		
Permit:	003110	Date Drilled:	09/20/1967
Depth (in feet):	125	Aquifer Type:	Bedrock
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	26	Plot Location:	Not Reported
Well Use:	Domestic	Well Type:	--
Record Type:	Construction Report,Geology		
Driller:	NEELY		

H54
WSW
1/2 - 1 Mile
Higher

IL WELLS IL20003075

Source:	IL Water Well Location Information		
Syskey:	716437		
Facilityid:	WL20537	Watertype:	GW
Avail:	E	Facname:	WELL 1 (20537) EMERGENCY
Facstatus:	A		
Depth draw:	0		
Depth toca:	117		
Depth comp:	290		
Lat dd:	41.828056		
Long dd:	-88.068056		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Syskey:	716437	Sysname:	IL AMERICAN-VALLEY VIEW
Systemid:	IL0437350	Addr1:	100 NORTH WATER WORKS DRIVE
Acname:	BOYD, SARAH	City:	BELLEVILLE
Addr2:	PO BOX 24040	Zip:	62223-9040
St:	IL		
Phoneno:	618-239-3245		

I55
North
1/2 - 1 Mile
Higher

IL WELLS **IL10185646**

Source:	IL Water Wells Records		
Objectid:	76560		
Api:	120430315800	Status:	Water Well
Longitude:	-88.057728		
Latitude:	41.841113		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Neal James
Farm num:	Not Reported	Company na:	K & K Well Drilling
Elevation:	0		
Elevref:	Not Reported		
Total dept:	140		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.05783898		
Shapey:	41.84115765		
Site id:	IL10185646		

I56
North
1/2 - 1 Mile
Higher

IL WELLS **IL10185645**

Source:	IL Water Wells Records		
Objectid:	4423		
Api:	120430325400	Status:	Water Well
Longitude:	-88.057728		
Latitude:	41.841113		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Gail Constr
Farm num:	Not Reported	Company na:	Dupage Pump
Elevation:	0		
Elevref:	Not Reported		
Total dept:	175		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Shapex: -88.05783898
 Shapey: 41.84115765
 Site id: IL10185645

H57
WSW
1/2 - 1 Mile
Higher

FED USGS USGS2383231

Agency cd:	USGS	Site no:	414941088040501
Site name:	39N10E-35.6g1		
Latitude:	414941		
Longitude:	0880405	Dec lat:	41.82808527
Dec lon:	-88.06812145	Coor meth:	M
Coor accr:	U	Latlong datum:	NAD27
Dec latlong datum:	NAD83	District:	17
State:	17	County:	043
Country:	US	Land net:	Not Reported
Location map:	Not Reported	Map scale:	Not Reported
Altitude:	745		
Altitude method:	Unknown		
Altitude accuracy:	Not Reported		
Altitude datum:	National Geodetic Vertical Datum of 1929		
Hydrologic:	Upper Fox. Illinois, Wisconsin. Area = 1570 sq.mi.		
Topographic:	Not Reported		
Site type:	Ground-water other than Spring	Date construction:	Not Reported
Date inventoried:	Not Reported	Mean greenwich time offset:	CST
Local standard time flag:	N		
Type of ground water site:	Single well, other than collector or Ranney type		
Aquifer Type:	Not Reported		
Aquifer:	Not Reported		
Well depth:	290	Hole depth:	Not Reported
Source of depth data:	other government (other than USGS)		
Project number:	Not Reported		
Real time data flag:	0	Daily flow data begin date:	0000-00-00
Daily flow data end date:	0000-00-00	Daily flow data count:	0
Peak flow data begin date:	0000-00-00	Peak flow data end date:	0000-00-00
Peak flow data count:	0	Water quality data begin date:	1988-01-27
Water quality data end date:	1988-01-27	Water quality data count:	1
Ground water data begin date:	0000-00-00	Ground water data end date:	0000-00-00
Ground water data count:	0		

Ground-water levels, Number of Measurements: 0

H58
WSW
1/2 - 1 Mile
Higher

FRDS PWS IL0437350

Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	15376		
Facility name:	TP 02-WELL 3 (ABANDONED)		
Facility type:	Treatment_plant	Treatment process:	fluoridation
Treatment objective:	other		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Contact name:	DUNDORE, ESTHER	Contact address1:	300 N. WATER WORKS DR.
Original name:	DUNDORE, ESTHER	Contact city:	BELLEVILLE
Contact phone:	618-239-3249		
Contact address2:	PO BOX 24040		
Contact zip:	62223-9040		
Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	15377		
Facility name:	TP 03-WELL 4 (ABANDONED)	Treatment process:	fluoridation
Facility type:	Treatment_plant		
Treatment objective:	other		
Contact name:	DUNDORE, ESTHER	Contact address1:	300 N. WATER WORKS DR.
Original name:	DUNDORE, ESTHER	Contact city:	BELLEVILLE
Contact phone:	618-239-3249		
Contact address2:	PO BOX 24040		
Contact zip:	62223-9040		
Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	20245		
Facility name:	WELL 1 (20537) EMERGENCY	Treatment process:	fluoridation
Facility type:	Well		
Treatment objective:	other		
Contact name:	DUNDORE, ESTHER	Contact address1:	300 N. WATER WORKS DR.
Original name:	DUNDORE, ESTHER	Contact city:	BELLEVILLE
Contact phone:	618-239-3249		
Contact address2:	PO BOX 24040		
Contact zip:	62223-9040		
Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	20246		
Facility name:	WELL 3 (20538) ABANDONED	Treatment process:	fluoridation
Facility type:	Well		
Treatment objective:	other		
Contact name:	DUNDORE, ESTHER	Contact address1:	300 N. WATER WORKS DR.
Original name:	DUNDORE, ESTHER	Contact city:	BELLEVILLE
Contact phone:	618-239-3249		
Contact address2:	PO BOX 24040		
Contact zip:	62223-9040		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Pwsid: State: Pws name: Population Served: PWS Source: Pws type: Status: Facility id: Facility name: Facility type: Treatment objective: Contact name: Original name: Contact phone: Contact address2: Contact zip:	IL0437350 IL IL AMERICAN-VALLEY VIEW 8869 Purch_surface_water CWS Active 20247 WELL 4 (20539) ABANDONED Well other DUNDORE, ESTHER DUNDORE, ESTHER 618-239-3249 PO BOX 24040 62223-9040	Epa region: County: Pwssvconn: Owner type: Treatment process: Contact address1: Contact city:	05 DuPage 2534 Private fluoridation 300 N. WATER WORKS DR. BELLEVILLE
Pwsid: State: Pws name: Population Served: PWS Source: Pws type: Status: Facility id: Facility name: Facility type: Treatment objective: Contact name: Original name: Contact phone: Contact address2: Contact zip:	IL0437350 IL IL AMERICAN-VALLEY VIEW 8869 Purch_surface_water CWS Active 20248 WELL 5 (20540) EMERGENCY Well other DUNDORE, ESTHER DUNDORE, ESTHER 618-239-3249 PO BOX 24040 62223-9040	Epa region: County: Pwssvconn: Owner type: Treatment process: Contact address1: Contact city:	05 DuPage 2534 Private fluoridation 300 N. WATER WORKS DR. BELLEVILLE
Pwsid: State: Pws name: Population Served: PWS Source: Pws type: Status: Facility id: Facility name: Facility type: Treatment objective: Contact name: Original name: Contact phone: Contact address2: Contact zip:	IL0437350 IL IL AMERICAN-VALLEY VIEW 8869 Purch_surface_water CWS Active 20249 WELL 6 (20541) ABANDONED Well other DUNDORE, ESTHER DUNDORE, ESTHER 618-239-3249 PO BOX 24040 62223-9040	Epa region: County: Pwssvconn: Owner type: Treatment process: Contact address1: Contact city:	05 DuPage 2534 Private fluoridation 300 N. WATER WORKS DR. BELLEVILLE
Pwsid: State: Pws name: Population Served: PWS Source: Pws type: Status: Facility id: Facility name: Facility type: Treatment objective:	IL0437350 IL IL AMERICAN-VALLEY VIEW 8869 Purch_surface_water CWS Active 22829 PF 06-BOOSTER STA 1 (ABANDONED) Pump_facility other	Epa region: County: Pwssvconn: Owner type: Treatment process:	05 DuPage 2534 Private fluoridation

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Contact name:	DUNDORE, ESTHER	Contact address1:	300 N. WATER WORKS DR.
Original name:	DUNDORE, ESTHER	Contact city:	BELLEVILLE
Contact phone:	618-239-3249		
Contact address2:	PO BOX 24040		
Contact zip:	62223-9040		
Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	22830		
Facility name:	PF 07-BOOSTER STA 2 (ABANDONED)		
Facility type:	Pump_facility	Treatment process:	fluoridation
Treatment objective:	other		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER		
Contact phone:	618-239-3249	Contact address1:	300 N. WATER WORKS DR.
Contact address2:	PO BOX 24040	Contact city:	BELLEVILLE
Contact zip:	62223-9040		
Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	23647		
Facility name:	CTZNS VALLEY VIEW DVN		
Facility type:	Distribution_system_zone	Treatment process:	fluoridation
Treatment objective:	other		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER		
Contact phone:	618-239-3249	Contact address1:	300 N. WATER WORKS DR.
Contact address2:	PO BOX 24040	Contact city:	BELLEVILLE
Contact zip:	62223-9040		
Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	26104		
Facility name:	CC 08-DISCH TO DIST FROM 4 HSPS		
Facility type:	Consecutive_connection	Treatment process:	fluoridation
Treatment objective:	other		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER		
Contact phone:	618-239-3249	Contact address1:	300 N. WATER WORKS DR.
Contact address2:	PO BOX 24040	Contact city:	BELLEVILLE
Contact zip:	62223-9040		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	27306		
Facility name:	GENERIC FINISHED SAMPLING STATION		
Facility type:	Sampling_station	Treatment process:	fluoridation
Treatment objective:	other		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER		
Contact phone:	618-239-3249	Contact address1:	300 N. WATER WORKS DR.
Contact address2:	PO BOX 24040	Contact city:	BELLEVILLE
Contact zip:	62223-9040		

Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	29728		
Facility name:	GENERIC RAW SAMPLING STATION		
Facility type:	Sampling_station	Treatment process:	fluoridation
Treatment objective:	other		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER		
Contact phone:	618-239-3249	Contact address1:	300 N. WATER WORKS DR.
Contact address2:	PO BOX 24040	Contact city:	BELLEVILLE
Contact zip:	62223-9040		

Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	11116		
Facility name:	DISTRIBUTION ELEVATED STORAGE		
Facility type:	Storage	Treatment process:	gaseous chlorination, pre
Treatment objective:	disinfection		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER		
Contact phone:	618-239-3249	Contact address1:	300 N. WATER WORKS DR.
Contact address2:	PO BOX 24040	Contact city:	BELLEVILLE
Contact zip:	62223-9040		

Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	12752		
Facility name:	TAP 08 GROUND STORAGE		
Facility type:	Storage	Treatment process:	gaseous chlorination, pre
Treatment objective:	disinfection		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Contact name:	DUNDORE, ESTHER	Contact address1:	300 N. WATER WORKS DR.
Original name:	DUNDORE, ESTHER	Contact city:	BELLEVILLE
Contact phone:	618-239-3249		
Contact address2:	PO BOX 24040		
Contact zip:	62223-9040		
Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	13322		
Facility name:	DISTRIBUTION PRESSURE STORAGE		
Facility type:	Storage	Treatment process:	gaseous chlorination, pre
Treatment objective:	disinfection		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER		
Contact phone:	618-239-3249	Contact address1:	300 N. WATER WORKS DR.
Contact address2:	PO BOX 24040	Contact city:	BELLEVILLE
Contact zip:	62223-9040		
Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	14000		
Facility name:	TAP 05 PRESSURE STORAGE		
Facility type:	Storage	Treatment process:	gaseous chlorination, pre
Treatment objective:	disinfection		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER		
Contact phone:	618-239-3249	Contact address1:	300 N. WATER WORKS DR.
Contact address2:	PO BOX 24040	Contact city:	BELLEVILLE
Contact zip:	62223-9040		
Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	14352		
Facility name:	DISTRIBUTION STANDPIPE STORAGE		
Facility type:	Storage	Treatment process:	gaseous chlorination, pre
Treatment objective:	disinfection		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER		
Contact phone:	618-239-3249	Contact address1:	300 N. WATER WORKS DR.
Contact address2:	PO BOX 24040	Contact city:	BELLEVILLE
Contact zip:	62223-9040		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	15375		
Facility name:	TP 01-WELL 1 (EMERGENCY)		
Facility type:	Treatment_plant	Treatment process:	gaseous chlorination, pre
Treatment objective:	disinfection		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER		
Contact phone:	618-239-3249	Contact address1:	300 N. WATER WORKS DR.
Contact address2:	PO BOX 24040	Contact city:	BELLEVILLE
Contact zip:	62223-9040		
Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	15376		
Facility name:	TP 02-WELL 3 (ABANDONED)		
Facility type:	Treatment_plant	Treatment process:	gaseous chlorination, pre
Treatment objective:	disinfection		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER		
Contact phone:	618-239-3249	Contact address1:	300 N. WATER WORKS DR.
Contact address2:	PO BOX 24040	Contact city:	BELLEVILLE
Contact zip:	62223-9040		
Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	15377		
Facility name:	TP 03-WELL 4 (ABANDONED)		
Facility type:	Treatment_plant	Treatment process:	gaseous chlorination, pre
Treatment objective:	disinfection		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER		
Contact phone:	618-239-3249	Contact address1:	300 N. WATER WORKS DR.
Contact address2:	PO BOX 24040	Contact city:	BELLEVILLE
Contact zip:	62223-9040		
Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	20245		
Facility name:	WELL 1 (20537) EMERGENCY		
Facility type:	Well	Treatment process:	gaseous chlorination, pre
Treatment objective:	disinfection		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Contact name:	DUNDORE, ESTHER	Contact address1:	300 N. WATER WORKS DR.
Original name:	DUNDORE, ESTHER	Contact city:	BELLEVILLE
Contact phone:	618-239-3249		
Contact address2:	PO BOX 24040		
Contact zip:	62223-9040		
Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	20246		
Facility name:	WELL 3 (20538) ABANDONED	Treatment process:	gaseous chlorination, pre
Facility type:	Well		
Treatment objective:	disinfection		
Contact name:	DUNDORE, ESTHER	Contact address1:	300 N. WATER WORKS DR.
Original name:	DUNDORE, ESTHER	Contact city:	BELLEVILLE
Contact phone:	618-239-3249		
Contact address2:	PO BOX 24040		
Contact zip:	62223-9040		
Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	20247		
Facility name:	WELL 4 (20539) ABANDONED	Treatment process:	gaseous chlorination, pre
Facility type:	Well		
Treatment objective:	disinfection		
Contact name:	DUNDORE, ESTHER	Contact address1:	300 N. WATER WORKS DR.
Original name:	DUNDORE, ESTHER	Contact city:	BELLEVILLE
Contact phone:	618-239-3249		
Contact address2:	PO BOX 24040		
Contact zip:	62223-9040		
Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	20248		
Facility name:	WELL 5 (20540) EMERGENCY	Treatment process:	gaseous chlorination, pre
Facility type:	Well		
Treatment objective:	disinfection		
Contact name:	DUNDORE, ESTHER	Contact address1:	300 N. WATER WORKS DR.
Original name:	DUNDORE, ESTHER	Contact city:	BELLEVILLE
Contact phone:	618-239-3249		
Contact address2:	PO BOX 24040		
Contact zip:	62223-9040		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	20249		
Facility name:	WELL 6 (20541) ABANDONED		
Facility type:	Well	Treatment process:	gaseous chlorination, pre
Treatment objective:	disinfection		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER		
Contact phone:	618-239-3249	Contact address1:	300 N. WATER WORKS DR.
Contact address2:	PO BOX 24040	Contact city:	BELLEVILLE
Contact zip:	62223-9040		
Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	22829		
Facility name:	PF 06-BOOSTER STA 1 (ABANDONED)		
Facility type:	Pump_facility	Treatment process:	gaseous chlorination, pre
Treatment objective:	disinfection		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER		
Contact phone:	618-239-3249	Contact address1:	300 N. WATER WORKS DR.
Contact address2:	PO BOX 24040	Contact city:	BELLEVILLE
Contact zip:	62223-9040		
Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	22830		
Facility name:	PF 07-BOOSTER STA 2 (ABANDONED)		
Facility type:	Pump_facility	Treatment process:	gaseous chlorination, pre
Treatment objective:	disinfection		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER		
Contact phone:	618-239-3249	Contact address1:	300 N. WATER WORKS DR.
Contact address2:	PO BOX 24040	Contact city:	BELLEVILLE
Contact zip:	62223-9040		
Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	23647		
Facility name:	CTZNS VALLEY VIEW DVN		
Facility type:	Distribution_system_zone	Treatment process:	gaseous chlorination, pre
Treatment objective:	disinfection		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Contact name:	DUNDORE, ESTHER	Contact address1:	300 N. WATER WORKS DR.
Original name:	DUNDORE, ESTHER	Contact city:	BELLEVILLE
Contact phone:	618-239-3249		
Contact address2:	PO BOX 24040		
Contact zip:	62223-9040		
Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	26104		
Facility name:	CC 08-DISCH TO DIST FROM 4 HSPS		
Facility type:	Consecutive_connection	Treatment process:	gaseous chlorination, pre
Treatment objective:	disinfection		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER		
Contact phone:	618-239-3249	Contact address1:	300 N. WATER WORKS DR.
Contact address2:	PO BOX 24040	Contact city:	BELLEVILLE
Contact zip:	62223-9040		
Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	27306		
Facility name:	GENERIC FINISHED SAMPLING STATION		
Facility type:	Sampling_station	Treatment process:	gaseous chlorination, pre
Treatment objective:	disinfection		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER		
Contact phone:	618-239-3249	Contact address1:	300 N. WATER WORKS DR.
Contact address2:	PO BOX 24040	Contact city:	BELLEVILLE
Contact zip:	62223-9040		
Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	29728		
Facility name:	GENERIC RAW SAMPLING STATION		
Facility type:	Sampling_station	Treatment process:	gaseous chlorination, pre
Treatment objective:	disinfection		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER		
Contact phone:	618-239-3249	Contact address1:	300 N. WATER WORKS DR.
Contact address2:	PO BOX 24040	Contact city:	BELLEVILLE
Contact zip:	62223-9040		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	11116		
Facility name:	DISTRIBUTION ELEVATED STORAGE		
Facility type:	Storage	Treatment process:	fluoridation
Treatment objective:	disinfection		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER		
Contact phone:	618-239-3249	Contact address1:	300 N. WATER WORKS DR.
Contact address2:	PO BOX 24040	Contact city:	BELLEVILLE
Contact zip:	62223-9040		

Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	12752		
Facility name:	TAP 08 GROUND STORAGE		
Facility type:	Storage	Treatment process:	fluoridation
Treatment objective:	disinfection		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER		
Contact phone:	618-239-3249	Contact address1:	300 N. WATER WORKS DR.
Contact address2:	PO BOX 24040	Contact city:	BELLEVILLE
Contact zip:	62223-9040		

Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	13322		
Facility name:	DISTRIBUTION PRESSURE STORAGE		
Facility type:	Storage	Treatment process:	fluoridation
Treatment objective:	disinfection		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER		
Contact phone:	618-239-3249	Contact address1:	300 N. WATER WORKS DR.
Contact address2:	PO BOX 24040	Contact city:	BELLEVILLE
Contact zip:	62223-9040		

Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	14000		
Facility name:	TAP 05 PRESSURE STORAGE		
Facility type:	Storage	Treatment process:	fluoridation
Treatment objective:	disinfection		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Contact name:	DUNDORE, ESTHER	Contact address1:	300 N. WATER WORKS DR.
Original name:	DUNDORE, ESTHER	Contact city:	BELLEVILLE
Contact phone:	618-239-3249		
Contact address2:	PO BOX 24040		
Contact zip:	62223-9040		
Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	14352		
Facility name:	DISTRIBUTION STANDPIPE STORAGE		
Facility type:	Storage	Treatment process:	fluoridation
Treatment objective:	disinfection		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER	Contact address1:	300 N. WATER WORKS DR.
Contact phone:	618-239-3249	Contact city:	BELLEVILLE
Contact address2:	PO BOX 24040		
Contact zip:	62223-9040		
Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	15375		
Facility name:	TP 01-WELL 1 (EMERGENCY)		
Facility type:	Treatment_plant	Treatment process:	fluoridation
Treatment objective:	disinfection		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER	Contact address1:	300 N. WATER WORKS DR.
Contact phone:	618-239-3249	Contact city:	BELLEVILLE
Contact address2:	PO BOX 24040		
Contact zip:	62223-9040		
Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	15376		
Facility name:	TP 02-WELL 3 (ABANDONED)		
Facility type:	Treatment_plant	Treatment process:	fluoridation
Treatment objective:	disinfection		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER	Contact address1:	300 N. WATER WORKS DR.
Contact phone:	618-239-3249	Contact city:	BELLEVILLE
Contact address2:	PO BOX 24040		
Contact zip:	62223-9040		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	15377		
Facility name:	TP 03-WELL 4 (ABANDONED)		
Facility type:	Treatment_plant	Treatment process:	fluoridation
Treatment objective:	disinfection		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER		
Contact phone:	618-239-3249	Contact address1:	300 N. WATER WORKS DR.
Contact address2:	PO BOX 24040	Contact city:	BELLEVILLE
Contact zip:	62223-9040		
Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	20245		
Facility name:	WELL 1 (20537) EMERGENCY		
Facility type:	Well	Treatment process:	fluoridation
Treatment objective:	disinfection		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER		
Contact phone:	618-239-3249	Contact address1:	300 N. WATER WORKS DR.
Contact address2:	PO BOX 24040	Contact city:	BELLEVILLE
Contact zip:	62223-9040		
Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	20246		
Facility name:	WELL 3 (20538) ABANDONED		
Facility type:	Well	Treatment process:	fluoridation
Treatment objective:	disinfection		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER		
Contact phone:	618-239-3249	Contact address1:	300 N. WATER WORKS DR.
Contact address2:	PO BOX 24040	Contact city:	BELLEVILLE
Contact zip:	62223-9040		
Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	20247		
Facility name:	WELL 4 (20539) ABANDONED		
Facility type:	Well	Treatment process:	fluoridation
Treatment objective:	disinfection		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Contact name:	DUNDORE, ESTHER	Contact address1:	300 N. WATER WORKS DR.
Original name:	DUNDORE, ESTHER	Contact city:	BELLEVILLE
Contact phone:	618-239-3249		
Contact address2:	PO BOX 24040		
Contact zip:	62223-9040		
Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	20248		
Facility name:	WELL 5 (20540) EMERGENCY	Treatment process:	fluoridation
Facility type:	Well		
Treatment objective:	disinfection		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER	Contact address1:	300 N. WATER WORKS DR.
Contact phone:	618-239-3249	Contact city:	BELLEVILLE
Contact address2:	PO BOX 24040		
Contact zip:	62223-9040		
Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	20249		
Facility name:	WELL 6 (20541) ABANDONED	Treatment process:	fluoridation
Facility type:	Well		
Treatment objective:	disinfection		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER	Contact address1:	300 N. WATER WORKS DR.
Contact phone:	618-239-3249	Contact city:	BELLEVILLE
Contact address2:	PO BOX 24040		
Contact zip:	62223-9040		
Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	22829		
Facility name:	PF 06-BOOSTER STA 1 (ABANDONED)	Treatment process:	fluoridation
Facility type:	Pump_facility		
Treatment objective:	disinfection		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER	Contact address1:	300 N. WATER WORKS DR.
Contact phone:	618-239-3249	Contact city:	BELLEVILLE
Contact address2:	PO BOX 24040		
Contact zip:	62223-9040		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	22830		
Facility name:	PF 07-BOOSTER STA 2 (ABANDONED)		
Facility type:	Pump_facility	Treatment process:	fluoridation
Treatment objective:	disinfection		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER		
Contact phone:	618-239-3249	Contact address1:	300 N. WATER WORKS DR.
Contact address2:	PO BOX 24040	Contact city:	BELLEVILLE
Contact zip:	62223-9040		

Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	23647		
Facility name:	CTZNS VALLEY VIEW DVN		
Facility type:	Distribution_system_zone	Treatment process:	fluoridation
Treatment objective:	disinfection		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER		
Contact phone:	618-239-3249	Contact address1:	300 N. WATER WORKS DR.
Contact address2:	PO BOX 24040	Contact city:	BELLEVILLE
Contact zip:	62223-9040		

Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	26104		
Facility name:	CC 08-DISCH TO DIST FROM 4 HSPS		
Facility type:	Consecutive_connection	Treatment process:	fluoridation
Treatment objective:	disinfection		
Contact name:	DUNDORE, ESTHER		
Original name:	DUNDORE, ESTHER		
Contact phone:	618-239-3249	Contact address1:	300 N. WATER WORKS DR.
Contact address2:	PO BOX 24040	Contact city:	BELLEVILLE
Contact zip:	62223-9040		

Pwsid:	IL0437350	Epa region:	05
State:	IL	County:	DuPage
Pws name:	IL AMERICAN-VALLEY VIEW		
Population Served:	8869	Pwssvconn:	2534
PWS Source:	Purch_surface_water		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	27306		
Facility name:	GENERIC FINISHED SAMPLING STATION		
Facility type:	Sampling_station	Treatment process:	fluoridation
Treatment objective:	disinfection		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Contact name: DUNDORE, ESTHER
Original name: DUNDORE, ESTHER
Contact phone: 618-239-3249
Contact address2: PO BOX 24040
Contact zip: 62223-9040
Contact address1: 300 N. WATER WORKS DR.
Contact city: BELLEVILLE

PWS ID: IL0437350
Date Initiated: Not Reported
PWS Name: CTZNS VALLEY VIEW DVN
MILTON TWP, IL 60137
Date Deactivated: Not Reported

Addressee / Facility: Not Reported

Facility Latitude: 41 49 49.0000
Facility Latitude: 41 50 40.0000
Facility Latitude: 41 49 41.0000
City Served: MILTON TWP
Treatment Class: Treated
Facility Longitude: 88 4 50.0000
Facility Longitude: 88 2 40.0000
Facility Longitude: 88 4 5.0000
Population: 8091

Violations information not reported.

ENFORCEMENT INFORMATION:

System Name:	CTZNS VALLEY VIEW DVN		
Violation Type:	MCL, Monthly (TCR)		
Contaminant:	COLIFORM (TCR)		
Compliance Period:	1995-06-01 - 1995-06-30		
Violation ID:	9529770		
Enforcement Date:	1995-08-26	Enf. Action:	State Violation/Reminder Notice
System Name:	CTZNS VALLEY VIEW DVN		
Violation Type:	MCL, Monthly (TCR)		
Contaminant:	COLIFORM (TCR)		
Compliance Period:	1995-06-01 - 1995-06-30		
Violation ID:	9529770		
Enforcement Date:	1995-08-26	Enf. Action:	State Public Notif Requested
System Name:	CTZNS VALLEY VIEW DVN		
Violation Type:	Monitoring, Routine Minor (TCR)		
Contaminant:	COLIFORM (TCR)		
Compliance Period:	1999-06-01 - 1999-06-30		
Violation ID:	9945529		
Enforcement Date:	1999-08-15	Enf. Action:	State Violation/Reminder Notice
System Name:	CTZNS VALLEY VIEW DVN		
Violation Type:	Monitoring, Routine Minor (TCR)		
Contaminant:	COLIFORM (TCR)		
Compliance Period:	1999-06-01 - 1999-06-30		
Violation ID:	9945529		
Enforcement Date:	1999-08-15	Enf. Action:	State Public Notif Requested

59
NW
1/2 - 1 Mile
Higher

IL WELLS IL10185486

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Source:	IL Water Wells Records		
Objectid:	141579		
Api:	120430108700	Status:	Water Well
Longitude:	-88.063408		
Latitude:	41.839232		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Boardman Chas
Farm num:	Not Reported	Company na:	Liberg, Patrick A.
Elevation:	0		
Elevref:	Not Reported		
Total dept:	155		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.06351909		
Shapey:	41.83927563		
Site id:	IL10185486		

**J60
SW
1/2 - 1 Mile
Lower**

IL WELLS P18998

Well ID:	169969	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	SWANDER & CO LOT 21		
Permit:	AW61	Date Drilled:	00/00/1959
Depth (in feet):	118	Aquifer Type:	Bedrock
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	35	Plot Location:	Not Reported
Well Use:	Domestic	Well Type:	--
Record Type:	Construction Report,Geology,Indicates comment in owner's field something unusual		
Driller:	ARNT & SON		

**J61
SW
1/2 - 1 Mile
Lower**

IL WELLS P18999

Well ID:	169970	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	DONALD SALMON LOT 6		
Permit:	AU575	Date Drilled:	00/00/1959
Depth (in feet):	150	Aquifer Type:	Bedrock
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	35	Plot Location:	Not Reported
Well Use:	Domestic	Well Type:	--
Record Type:	Construction Report,Geology,Indicates comment in owner's field something unusual		
Driller:	ARNT & SON		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

J62
SW
1/2 - 1 Mile
Lower

IL WELLS P19005

Well ID:	233363	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	JAMES UTHOFF LOT 20		
Permit:	Not Reported	Date Drilled:	00/00/1959
Depth (in feet):	112	Aquifer Type:	Bedrock
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	35	Plot Location:	Not Reported
Well Use:	Domestic	Well Type:	--
Record Type:	Construction Report,Geology		
Driller:	ARNT & SON		

J63
SW
1/2 - 1 Mile
Lower

IL WELLS P19004

Well ID:	233362	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	DONALD SALMON LOT 6		
Permit:	AU-575	Date Drilled:	00/00/1959
Depth (in feet):	150	Aquifer Type:	Bedrock
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	35	Plot Location:	Not Reported
Well Use:	Domestic	Well Type:	--
Record Type:	Construction Report,Geology		
Driller:	ARNT & SON		

J64
SW
1/2 - 1 Mile
Lower

IL WELLS P19001

Well ID:	233359	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	MR.THOMPSON		
Permit:	Not Reported	Date Drilled:	00/00/1957
Depth (in feet):	121	Aquifer Type:	Bedrock
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	35	Plot Location:	Not Reported
Well Use:	Domestic	Well Type:	--
Record Type:	Construction Report,Geology		
Driller:	ARNT & SON		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

J65
SW
1/2 - 1 Mile
Lower

IL WELLS P19000

Well ID:	169971	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	MR JAMES UTHOFF LOT 20		
Permit:	AU892	Date Drilled:	00/00/1959
Depth (in feet):	112	Aquifer Type:	Bedrock
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	35	Plot Location:	Not Reported
Well Use:	Domestic	Well Type:	--
Record Type:	Construction Report,Geology,Indicates comment in owner's field something unusual		
Driller:	N ARNT & SON		

J66
SW
1/2 - 1 Mile
Lower

IL WELLS P19003

Well ID:	233361	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	SWANDER & CO. LOT 21		
Permit:	AW-61	Date Drilled:	00/00/1959
Depth (in feet):	118	Aquifer Type:	Bedrock
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	35	Plot Location:	Not Reported
Well Use:	Domestic	Well Type:	--
Record Type:	Construction Report,Geology		
Driller:	ARNT & SON		

J67
SW
1/2 - 1 Mile
Lower

IL WELLS P19002

Well ID:	233360	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	JOHN E.HUGHES		
Permit:	Not Reported	Date Drilled:	//
Depth (in feet):	134	Aquifer Type:	Bedrock
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	35	Plot Location:	Not Reported
Well Use:	Domestic	Well Type:	--
Record Type:	Construction Report,Geology		
Driller:	ARNT & SON		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

68
WNW
1/2 - 1 Mile
Higher

IL WELLS IL10185086

Source:	IL Water Wells Records		
Objectid:	38975	Status:	Water Well
Api:	120430085100		
Longitude:	-88.067681		
Latitude:	41.835145		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Meye Robert
Farm num:	Not Reported	Company na:	Liberg, Patrick A.
Elevation:	0		
Elevref:	Not Reported		
Total dept:	180		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.0677921		
Shapey:	41.83518865		
Site id:	IL10185086		

69
West
1/2 - 1 Mile
Higher

IL WELLS IL10184796

Source:	IL Water Wells Records		
Objectid:	270021	Status:	Water Well
Api:	120433073200		
Longitude:	-88.068837		
Latitude:	41.832741		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Van Horne, Bill
Farm num:	Not Reported	Company na:	Kerry, Charles M.
Elevation:	0		
Elevref:	Not Reported		
Total dept:	200		
Wformation:	limestone		
Wfmfrom:	105		
Wfmto:	200		
Pumpgpm:	35		
Shapex:	-88.06894806		
Shapey:	41.83278466		
Site id:	IL10184796		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

K70
WSW
1/2 - 1 Mile
Higher

IL WELLS IL10184366

Source:	IL Water Wells Records		
Objectid:	113656	Status:	Water Well
Api:	120432827200		
Longitude:	-88.068841		
Latitude:	41.829080		
Section :	35		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Spinney, Jack
Farm num:	2	Company na:	Fykes, Charles N.
Elevation:	0		
Elevref:	Not Reported		
Total dept:	165		
Wformation:	limestone		
Wfmfrom:	130		
Wfmto:	165		
Pumpgpm:	12		
Shapex:	-88.06895094		
Shapey:	41.82912469		
Site id:	IL10184366		

K71
WSW
1/2 - 1 Mile
Higher

IL WELLS IL10184367

Source:	IL Water Wells Records		
Objectid:	141902	Status:	Water Well
Api:	120430016100		
Longitude:	-88.068841		
Latitude:	41.829080		
Section :	35		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Hughes John H
Farm num:	Not Reported	Company na:	Randa Wm J
Elevation:	750		
Elevref:	Ground level		
Total dept:	134		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.06895094		
Shapey:	41.82912469		
Site id:	IL10184367		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

K72
WSW
1/2 - 1 Mile
Higher

IL WELLS IL10184368

Source:	IL Water Wells Records		
Objectid:	254563		
Api:	120432915100	Status:	Water Well
Longitude:	-88.068841		
Latitude:	41.829080		
Section :	35		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Mele, Michael
Farm num:	Not Reported	Company na:	Liberg, Thomas P.
Elevation:	0		
Elevref:	Not Reported		
Total dept:	280		
Wformation:	limestone		
Wfmfrom:	131		
Wfmto:	280		
Pumpgpm:	0		
Shapex:	-88.06895094		
Shapey:	41.82912469		
Site id:	IL10184368		

H73
WSW
1/2 - 1 Mile
Higher

IL WELLS IL10184231

Source:	IL Water Wells Records		
Objectid:	280449		
Api:	120430070500	Status:	Water Well
Longitude:	-88.068461		
Latitude:	41.827667		
Section :	35		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Salmon Donald
Farm num:	72	Company na:	Randa Wm J
Elevation:	0		
Elevref:	Not Reported		
Total dept:	150		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.06857189		
Shapey:	41.82771171		
Site id:	IL10184231		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

74
WNW
1/2 - 1 Mile
Higher

IL WELLS IL10185011

Source:	IL Water Wells Records		
Objectid:	107198	Status:	Water Well
Api:	120432439300		
Longitude:	-88.068839		
Latitude:	41.834569		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Handcrafted Homes
Farm num:	Not Reported	Company na:	Dupage Pump
Elevation:	0		
Elevref:	Not Reported		
Total dept:	160		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.06895011		
Shapey:	41.83461265		
Site id:	IL10185011		

H75
WSW
1/2 - 1 Mile
Higher

IL WELLS IL10184203

Source:	IL Water Wells Records		
Objectid:	284426	Status:	Water Well
Api:	120430309100		
Longitude:	-88.06889		
Latitude:	41.827444		
Section :	35		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Kettel Constr
Farm num:	Not Reported	Company na:	Sission, Edward H.
Elevation:	0		
Elevref:	Not Reported		
Total dept:	133		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.06900089		
Shapey:	41.82748771		
Site id:	IL10184203		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database

EDR ID Number

H76
WSW
1/2 - 1 Mile
Higher

IL WELLS

IL10184179

Source:	IL Water Wells Records		
Objectid:	161476		
Api:	120430016000	Status:	Water Well
Longitude:	-88.068846		
Latitude:	41.827242		
Section :	35		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Thompson
Farm num:	Not Reported	Company na:	Randa Wm J
Elevation:	740		
Elevref:	Ground level		
Total dept:	121		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.06895689		
Shapey:	41.82728571		
Site id:	IL10184179		

77
WNW
1/2 - 1 Mile
Higher

IL WELLS

IL10185155

Source:	IL Water Wells Records		
Objectid:	206908		
Api:	120430070100	Status:	Water Well
Longitude:	-88.069396		
Latitude:	41.835774		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Cardinal Bldrs
Farm num:	5	Company na:	Neely & Son
Elevation:	0		
Elevref:	Not Reported		
Total dept:	160		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.06950717		
Shapey:	41.83581763		
Site id:	IL10185155		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

78
WSW
1/2 - 1 Mile
Higher

IL WELLS IL10183931

Source:	IL Water Wells Records		
Objectid:	67655		
Api:	120432885500	Status:	Water Well
Longitude:	-88.068848		
Latitude:	41.825403		
Section :	35		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Lofgren, Richard
Farm num:	Not Reported	Company na:	Knierim, Phil
Elevation:	0		
Elevref:	Not Reported		
Total dept:	160		
Wformation:	rock		
Wfmfrom:	60		
Wfmto:	160		
Pumpgpm:	0		
Shapex:	-88.06895883		
Shapey:	41.82544772		
Site id:	IL10183931		

L79
WSW
1/2 - 1 Mile
Higher

IL WELLS P19009

Well ID:	251199	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	MIKE MELE 91-072		
Permit:	91-0074	Date Drilled:	09/17/1991
Depth (in feet):	280	Aquifer Type:	Bedrock
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	35	Plot Location:	7H
Well Use:	Domestic	Well Type:	--
Record Type:	Construction Report,Geology		
Driller:	MEADOW EQUIP S & S		

L80
WSW
1/2 - 1 Mile
Higher

IL WELLS P19008

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Well ID:	169968	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	JOHN E HUGHES		
Permit:	Not Reported	Date Drilled:	00/00/1962
Depth (in feet):	134	Aquifer Type:	Bedrock
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	35	Plot Location:	7H
Well Use:	Domestic	Well Type:	--
Record Type:	Construction Report,Geology		
Driller:	N ARNT & SON		

81 North 1/2 - 1 Mile Higher

IL WELLS IL10185826

Source:	IL Water Wells Records		
Objectid:	216060		
Api:	120430043900	Status:	Water Well
Longitude:	-88.053693		
Latitude:	41.843135		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Thompson
Farm num:	5	Company na:	AI-Well Drilling
Elevation:	748		
Elevref:	Ground level		
Total dept:	165		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.05380391		
Shapey:	41.84317966		
Site id:	IL10185826		

M82 NW 1/2 - 1 Mile Higher

IL WELLS IL10185377

Source:	IL Water Wells Records		
Objectid:	22388		
Api:	120430098500	Status:	Water Well
Longitude:	-88.068359		
Latitude:	41.838116		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Rdir:	E	Farm name:	Triland Homes
Farm num:	Not Reported	Company na:	Sission, Edward H.
Elevation:	0		
Elevref:	Not Reported		
Total dept:	178		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.06847021		
Shapey:	41.83815962		
Site id:	IL10185377		

N83
NE
1/2 - 1 Mile
Lower

IL WELLS P18911

Well ID:	260648	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	RAY BLACKSTONE #2		
Permit:	H910259	Date Drilled:	02/04/1992
Depth (in feet):	150	Aquifer Type:	Bedrock
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	25	Plot Location:	Not Reported
Well Use:	Domestic	Well Type:	Drilled
Record Type:	Construction Report,Geology		
Driller:	SHAVER		

N84
NE
1/2 - 1 Mile
Lower

IL WELLS P18910

Well ID:	176239	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	F & S CONST CO LOT 3		
Permit:	AY138	Date Drilled:	00/00/1960
Depth (in feet):	150	Aquifer Type:	Bedrock
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	25	Plot Location:	Not Reported
Well Use:	Domestic	Well Type:	--
Record Type:	Construction Report,Geology,Indicates comment in owner's field something unusual		
Driller:	GEO NEELY & SON		

O85
WSW
1/2 - 1 Mile
Higher

IL WELLS P19007

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Well ID:	169967	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	MR THOMPSON		
Permit:	Not Reported	Date Drilled:	00/00/1957
Depth (in feet):	121	Aquifer Type:	Bedrock
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	35	Plot Location:	7G
Well Use:	Domestic	Well Type:	--
Record Type:	Construction Report,Geology		
Driller:	N ARNT & SON		

L86
WSW
1/2 - 1 Mile
Higher

IL WELLS IL10184294

Source:	IL Water Wells Records		
Objectid:	99204		
Api:	120430057800	Status:	Water Well
Longitude:	-88.054337		
Latitude:	41.817058		
Section :	35		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Uthoff James
Farm num:	80	Company na:	Randa Wm J
Elevation:	0		
Elevref:	Not Reported		
Total dept:	112		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.071411		
Shapey:	41.82853368		
Site id:	IL10184294		

P87
WNW
1/2 - 1 Mile
Higher

IL WELLS IL10185032

Source:	IL Water Wells Records		
Objectid:	112705		
Api:	120432439400	Status:	Water Well
Longitude:	-88.071025		
Latitude:	41.834729		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Rdir:	E	Farm name:	Joe Keim Bldrs
Farm num:	Not Reported	Company na:	Sission, Edward H.
Elevation:	0		
Elevref:	Not Reported		
Total dept:	145		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.07113619		
Shapey:	41.83477363		
Site id:	IL10185032		

P88
WNW
1/2 - 1 Mile
Higher

IL WELLS **IL10185072**

Source:	IL Water Wells Records		
Objectid:	252120		
Api:	120430135500	Status:	Water Well
Longitude:	-88.070953		
Latitude:	41.835007		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Meister-Neiberg
Farm num:	Not Reported	Company na:	Liberg, Patrick A.
Elevation:	0		
Elevref:	Not Reported		
Total dept:	143		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.07106419		
Shapey:	41.83505063		
Site id:	IL10185072		

M89
NW
1/2 - 1 Mile
Higher

IL WELLS **IL10185390**

Source:	IL Water Wells Records		
Objectid:	265993		
Api:	120430119300	Status:	Water Well
Longitude:	-88.068836		
Latitude:	41.838224		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Rdir:	E	Farm name:	Bullis Emory
Farm num:	Not Reported	Company na:	Sission, Edward H.
Elevation:	0		
Elevref:	Not Reported		
Total dept:	180		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.06894723		
Shapey:	41.83826761		
Site id:	IL10185390		

P90
WNW
1/2 - 1 Mile
Higher

IL WELLS **IL10185005**

Source:	IL Water Wells Records		
Objectid:	71564		
Api:	120432470000	Status:	Water Well
Longitude:	-88.071295		
Latitude:	41.834526		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Zanoni Fabian
Farm num:	Not Reported	Company na:	Dupage Pump
Elevation:	0		
Elevref:	Not Reported		
Total dept:	160		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.07140619		
Shapey:	41.83456963		
Site id:	IL10185005		

P91
WNW
1/2 - 1 Mile
Higher

IL WELLS **IL10185004**

Source:	IL Water Wells Records		
Objectid:	37345		
Api:	120433066500	Status:	Water Well
Longitude:	-88.071295		
Latitude:	41.834526		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Rdir:	E	Farm name:	Sokolis, Mark
Farm num:	Not Reported	Company na:	Wellendorf, Rodney
Elevation:	0		
Elevref:	Not Reported		
Total dept:	180		
Wformation:	limestone		
Wfmfrom:	110		
Wfmto:	0		
Pumpgpm:	30		
Shapex:	-88.07140619		
Shapey:	41.83456963		
Site id:	IL10185004		

P92
WNW
1/2 - 1 Mile
Higher

IL WELLS **IL10185006**

Source:	IL Water Wells Records		
Objectid:	88592		
Api:	120433145900	Status:	Water Well
Longitude:	-88.071295		
Latitude:	41.834526		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Donnelly, Patrick & Kate
Farm num:	Not Reported	Company na:	Liberg, Steven Scott
Elevation:	0		
Elevref:	Not Reported		
Total dept:	225		
Wformation:	limestone		
Wfmfrom:	115		
Wfmto:	225		
Pumpgpm:	12		
Shapex:	-88.07140619		
Shapey:	41.83456963		
Site id:	IL10185006		

P93
WNW
1/2 - 1 Mile
Higher

IL WELLS **IL10185007**

Source:	IL Water Wells Records		
Objectid:	206102		
Api:	120432460900	Status:	Water Well
Longitude:	-88.071295		
Latitude:	41.834526		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Rdir:	E	Farm name:	Springwood Bldrs
Farm num:	Not Reported	Company na:	Dupage Pump
Elevation:	0		
Elevref:	Not Reported		
Total dept:	160		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.07140619		
Shapey:	41.83456963		
Site id:	IL10185007		

94
WNW
1/2 - 1 Mile
Higher

IL WELLS IL10185338

Source:	IL Water Wells Records		
Objectid:	50932		
Api:	120430084900	Status:	Water Well
Longitude:	-88.069578		
Latitude:	41.837642		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Armani
Farm num:	Not Reported	Company na:	Liberg, Patrick A.
Elevation:	0		
Elevref:	Not Reported		
Total dept:	180		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.06968923		
Shapey:	41.83768661		
Site id:	IL10185338		

O95
WSW
1/2 - 1 Mile
Higher

IL WELLS IL10184174

Source:	IL Water Wells Records		
Objectid:	72104		
Api:	120432952300	Status:	Water Well
Longitude:	-88.071291		
Latitude:	41.827191		
Section :	35		
Twp:	39		
Tdir:	N		
Rng:	10		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Rdir:	E	Farm name:	Junius, Larry
Farm num:	Not Reported	Company na:	Senffner, Alan James
Elevation:	0		
Elevref:	Not Reported		
Total dept:	160		
Wformation:	limestone		
Wfmfrom:	85		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.07140096		
Shapey:	41.8272347		
Site id:	IL10184174		

Q96 WNW 1/2 - 1 Mile Higher

IL WELLS IL10185212

Source:	IL Water Wells Records		
Objectid:	54040		
Api:	120432560500	Status:	Water Well
Longitude:	-88.071297		
Latitude:	41.836356		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Maple Invest
Farm num:	Not Reported	Company na:	Liberg, John E.
Elevation:	0		
Elevref:	Not Reported		
Total dept:	160		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.07140825		
Shapey:	41.83639962		
Site id:	IL10185212		

Q97 WNW 1/2 - 1 Mile Higher

IL WELLS IL10185213

Source:	IL Water Wells Records		
Objectid:	60612		
Api:	120432460800	Status:	Water Well
Longitude:	-88.071297		
Latitude:	41.836356		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Rdir:	E	Farm name:	Batistich Nick
Farm num:	Not Reported	Company na:	Dupage Pump
Elevation:	0		
Elevref:	Not Reported		
Total dept:	220		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.07140825		
Shapey:	41.83639962		
Site id:	IL10185213		

R98
WSW
1/2 - 1 Mile
Higher

IL WELLS IL10183929

Source:	IL Water Wells Records		
Objectid:	68351		
Api:	120432961200	Status:	Water Well
Longitude:	-88.071289		
Latitude:	41.825352		
Section :	35		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Jones, Donald & Joan
Farm num:	Not Reported	Company na:	Senffner, Alan James
Elevation:	0		
Elevref:	Not Reported		
Total dept:	160		
Wformation:	limestone		
Wfmfrom:	95		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.0713989		
Shapey:	41.82539671		
Site id:	IL10183929		

99
WNW
1/2 - 1 Mile
Higher

IL WELLS IL10185344

Source:	IL Water Wells Records		
Objectid:	245389		
Api:	120430185300	Status:	Water Well
Longitude:	-88.063756		
Latitude:	41.844209		
Section :	26		
Twp:	39		
Tdir:	N		
Rng:	10		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Rdir:	E	Farm name:	Siegert Paul
Farm num:	Not Reported	Company na:	Zanker, Joseph I.
Elevation:	0		
Elevref:	Not Reported		
Total dept:	205		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.07153829		
Shapey:	41.8377796		
Site id:	IL10185344		

S100
West
1/2 - 1 Mile
Higher**IL WELLS IL10184325**

Source:	IL Water Wells Records		
Objectid:	188291		
Api:	120430345700	Status:	Water Well
Longitude:	-88.073438		
Latitude:	41.828806		
Section :	34		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Holliday H
Farm num:	1	Company na:	Fischer James
Elevation:	0		
Elevref:	Not Reported		
Total dept:	210		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.07354908		
Shapey:	41.82885067		
Site id:	IL10184325		

S101
West
1/2 - 1 Mile
Higher**IL WELLS IL10184365**

Source:	IL Water Wells Records		
Objectid:	36044		
Api:	120430020900	Status:	Water Well
Longitude:	-88.07351		
Latitude:	41.829080		
Section :	34		
Twp:	39		
Tdir:	N		
Rng:	10		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Rdir:	E	Farm name:	Bettes Field Const
Farm num:	Not Reported	Company na:	Randa Wm J
Elevation:	762		
Elevref:	Ground level		
Total dept:	157		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.07362109		
Shapey:	41.82912467		
Site id:	IL10184365		

102 WSW 1/2 - 1 Mile Higher

IL WELLS P19010

Well ID:	260912	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	LARRY JUNIUS		
Permit:	93-2219	Date Drilled:	03/02/1994
Depth (in feet):	160	Aquifer Type:	Bedrock
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	35	Plot Location:	8G
Well Use:	Domestic	Well Type:	Drilled
Record Type:	Construction Report,Geology		
Driller:	DUPAGE PUMP INC.		

S103 WSW 1/2 - 1 Mile Higher

IL WELLS IL10184279

Source:	IL Water Wells Records		
Objectid:	155496		
Api:	120430044000	Status:	Water Well
Longitude:	-88.073437		
Latitude:	41.828324		
Section :	34		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Blackstone Bldrs
Farm num:	Not Reported	Company na:	Bilsky, J. W.
Elevation:	760		
Elevref:	Ground level		
Total dept:	153		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Shapex: -88.07354806
Shapey: 41.82836767
Site id: IL10184279

R104
WSW
1/2 - 1 Mile
Higher

IL WELLS IL10183995

Source:	IL Water Wells Records		
Objectid:	120348		
Api:	120430070600	Status:	Water Well
Longitude:	-88.072437		
Latitude:	41.825793		
Section :	35		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Swander And Co
Farm num:	60	Company na:	Randa Wm J
Elevation:	0		
Elevref:	Not Reported		
Total dept:	118		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.07254695		
Shapey:	41.8258367		
Site id:	IL10183995		

S105
WSW
1/2 - 1 Mile
Higher

IL WELLS P18995

Well ID:	217394	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	CHARLES FYKES		
Permit:	132682	Date Drilled:	07/03/1987
Depth (in feet):	185	Aquifer Type:	Bedrock
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	34	Plot Location:	1H
Well Use:	Domestic	Well Type:	--
Record Type:	Construction Report,Geology		
Driller:	ROBERT GREEN		

106
West
1/2 - 1 Mile
Higher

IL WELLS IL10184544

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Source:	IL Water Wells Records		
Objectid:	188796		
Api:	120430070300	Status:	Water Well
Longitude:	-88.073902		
Latitude:	41.830590		
Section :	27		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	St Luke Luth Ch
Farm num:	Not Reported	Company na:	Perrine William
Elevation:	0		
Elevref:	Not Reported		
Total dept:	160		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.07401315		
Shapey:	41.83063365		
Site id:	IL10184544		

**S107
West
1/2 - 1 Mile
Higher****IL WELLS IL10184346**

Source:	IL Water Wells Records		
Objectid:	11036		
Api:	120432782400	Status:	Water Well
Longitude:	-88.073726		
Latitude:	41.828983		
Section :	34		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Green, Robert
Farm num:	1	Company na:	Fykes, Charles N.
Elevation:	0		
Elevref:	Not Reported		
Total dept:	185		
Wformation:	limestone		
Wfmfrom:	85		
Wfmto:	185		
Pumpgpm:	10		
Shapex:	-88.07383709		
Shapey:	41.82902767		
Site id:	IL10184346		

**S108
West
1/2 - 1 Mile
Higher****IL WELLS IL10184347**

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Source:	IL Water Wells Records		
Objectid:	77512		
Api:	120430015900	Status:	Water Well
Longitude:	-88.073726		
Latitude:	41.828983		
Section :	34		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Luchmoel
Farm num:	Not Reported	Company na:	Randa Wm J
Elevation:	750		
Elevref:	Ground level		
Total dept:	139		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.07383709		
Shapey:	41.82902767		
Site id:	IL10184347		

109 North 1/2 - 1 Mile Higher

IL WELLS IL10186100

Source:	IL Water Wells Records		
Objectid:	148178		
Api:	120432453400	Status:	Water Well
Longitude:	-88.053111		
Latitude:	41.845400		
Section :	23		
Twp:	39		
Tdir:	N		
Rng:	10		
Rdir:	E	Farm name:	Bester Chas
Farm num:	Not Reported	Company na:	Liberg, John E.
Elevation:	0		
Elevref:	Not Reported		
Total dept:	160		
Wformation:	Not Reported		
Wfmfrom:	0		
Wfmto:	0		
Pumpgpm:	0		
Shapex:	-88.05322097		
Shapey:	41.84544364		
Site id:	IL10186100		

T110 WNW 1/2 - 1 Mile Higher

IL WELLS P18936

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Well ID:	176244	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	CARDINAL BLDRS FRED MONS #103		
Permit:	AX763	Date Drilled:	00/00/1960
Depth (in feet):	160	Aquifer Type:	Bedrock
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	26	Plot Location:	7D
Well Use:	Domestic	Well Type:	--
Record Type:	Construction Report,Geology,Indicates comment in owner's field something unusual		
Driller:	GEO NEELY & SON		

T111
WNW
1/2 - 1 Mile
Higher

IL WELLS P18937

Well ID:	233326	Second ID:	Not Reported
Info Source:	IL Private Water Wells Survey		
Owner:	CARDINAL BUILDERS LOT 103		
Permit:	AX-763	Date Drilled:	00/00/1960
Depth (in feet):	160	Aquifer Type:	Bedrock
County Code:	043	County:	DUPAGE
Township:	39N	Range:	10E
Section:	26	Plot Location:	7D
Well Use:	Domestic	Well Type:	--
Record Type:	Construction Report,Geology		
Driller:	NEELY & SON		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

RADON

AREA RADON INFORMATION

State Database: IL Radon

Radon Test Results

Floor	# Sites	Min pCi/L	Avg pCi/L	Max pCi/L	# Sites>4pCi/L	# Sites>20	County
Basement	135	0.5	4.8	64.5	47	3	DUPAGE
1st Floor living area	13	0.8	2.4	6.4	1	0	DUPAGE
1st Floor bedroom	19	1.1	3.1	5.4	3	0	DUPAGE
Total	167	0.5	4.4	64.5	51	3	DUPAGE

Federal EPA Radon Zone for DUPAGE County: 2

Note: Zone 1 indoor average level > 4 pCi/L.

: Zone 2 indoor average level >= 2 pCi/L and <= 4 pCi/L.

: Zone 3 indoor average level < 2 pCi/L.

Federal Area Radon Information for Zip Code: 60137

Number of sites tested: 4

Area	Average Activity	% <4 pCi/L	% 4-20 pCi/L	% >20 pCi/L
Living Area - 1st Floor	Not Reported	Not Reported	Not Reported	Not Reported
Living Area - 2nd Floor	Not Reported	Not Reported	Not Reported	Not Reported
Basement	10.825 pCi/L	25%	50%	25%

PHYSICAL SETTING SOURCE RECORDS SEARCHED

TOPOGRAPHIC INFORMATION

USGS 7.5' Digital Elevation Model (DEM)

Source: United States Geologic Survey

EDR acquired the USGS 7.5' Digital Elevation Model in 2002 and updated it in 2006. The 7.5 minute DEM corresponds to the USGS 1:24,000- and 1:25,000-scale topographic quadrangle maps. The DEM provides elevation data with consistent elevation units and projection.

Scanned Digital USGS 7.5' Topographic Map (DRG)

Source: United States Geologic Survey

A digital raster graphic (DRG) is a scanned image of a U.S. Geological Survey topographic map. The map images are made by scanning published paper maps on high-resolution scanners. The raster image is georeferenced and fit to the Universal Transverse Mercator (UTM) projection.

HYDROLOGIC INFORMATION

Flood Zone Data: This data, available in select counties across the country, was obtained by EDR in 1999 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002 and 2005 from the U.S. Fish and Wildlife Service.

HYDROGEOLOGIC INFORMATION

AQUIFLOW^R Information System

Source: EDR proprietary database of groundwater flow information

EDR has developed the AQUIFLOW Information System (AIS) to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted to regulatory authorities at select sites and has extracted the date of the report, hydrogeologically determined groundwater flow direction and depth to water table information.

GEOLOGIC INFORMATION

Geologic Age and Rock Stratigraphic Unit

Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - A digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

STATSGO: State Soil Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Services

The U.S. Department of Agriculture's (USDA) Natural Resources Conservation Service (NRCS) leads the national Conservation Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps.

SSURGO: Soil Survey Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Services (NRCS)

Telephone: 800-672-5559

SSURGO is the most detailed level of mapping done by the Natural Resources Conservation Services, mapping scales generally range from 1:12,000 to 1:63,360. Field mapping methods using national standards are used to construct the soil maps in the Soil Survey Geographic (SSURGO) database. SSURGO digitizing duplicates the original soil survey maps. This level of mapping is designed for use by landowners, townships and county natural resource planning and management.

PHYSICAL SETTING SOURCE RECORDS SEARCHED

LOCAL / REGIONAL WATER AGENCY RECORDS

FEDERAL WATER WELLS

PWS: Public Water Systems

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Public Water System data from the Federal Reporting Data System. A PWS is any water system which provides water to at least 25 people for at least 60 days annually. PWSs provide water from wells, rivers and other sources.

PWS ENF: Public Water Systems Violation and Enforcement Data

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Violation and Enforcement data for Public Water Systems from the Safe Drinking Water Information System (SDWIS) after August 1995. Prior to August 1995, the data came from the Federal Reporting Data System (FRDS).

USGS Water Wells: USGS National Water Inventory System (NWIS)

This database contains descriptive information on sites where the USGS collects or has collected data on surface water and/or groundwater. The groundwater data includes information on wells, springs, and other sources of groundwater.

STATE RECORDS

Water Well Records

Source: Illinois Geological Survey

Telephone: 217-333-4747

Illinois Private Well Database and PICS (Public, Industrial, Commercial Survey)

Source: Illinois State Water Survey

Telephone: 217-333-9043

Water Well Location Information

Source: Illinois Environmental Protection Agency

Telephone: 217-782-0810

OTHER STATE DATABASE INFORMATION

RADON

State Database: IL Radon

Source: Department of Nuclear Safety

Telephone: 217-785-9958

County Radon Results

Area Radon Information

Source: USGS

Telephone: 703-356-4020

The National Radon Database has been developed by the U.S. Environmental Protection Agency (USEPA) and is a compilation of the EPA/State Residential Radon Survey and the National Residential Radon Survey. The study covers the years 1986 - 1992. Where necessary data has been supplemented by information collected at private sources such as universities and research institutions.

EPA Radon Zones

Source: EPA

Telephone: 703-356-4020

Sections 307 & 309 of IRAA directed EPA to list and identify areas of U.S. with the potential for elevated indoor radon levels.

OTHER

Airport Landing Facilities: Private and public use landing facilities

Source: Federal Aviation Administration, 800-457-6656

Epicenters: World earthquake epicenters, Richter 5 or greater

Source: Department of Commerce, National Oceanic and Atmospheric Administration

PHYSICAL SETTING SOURCE RECORDS SEARCHED

STREET AND ADDRESS INFORMATION

© 2009 Tele Atlas North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

APPENDIX C

Historical Resources

Aerial Photographs

Bank of America

22W151 Butterfield Rd
Glen Ellyn, IL 60137

Inquiry Number: 2537497.35
July 10, 2009

The EDR Aerial Photo Decade Package



440 Wheelers Farms Road
Milford, CT 06461
800.352.0050
www.edrnet.com

EDR Aerial Photo Decade Package

Environmental Data Resources, Inc. (EDR) Aerial Photo Decade Package is a screening tool designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDRs professional researchers provide digitally reproduced historical aerial photographs, and when available, provide one photo per decade.

When delivered electronically by EDR, the aerial photo images included with this report are for ONE TIME USE ONLY. Further reproduction of these aerial photo images is prohibited without permission from EDR. For more information contact your EDR Account Executive.

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report AS IS. Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2009 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Date EDR Searched Historical Sources:

Aerial Photography July 10, 2009

Target Property:

22W151 Butterfield Rd

Glen Ellyn, IL 60137

<u>Year</u>	<u>Scale</u>	<u>Details</u>	<u>Source</u>
1952	Aerial Photograph. Scale: 1"=750'	Panel #: 2441088-G1/Flight Date: April 19, 1952	EDR
1971	Aerial Photograph. Scale: 1"=833'	Panel #: 2441088-G1/Flight Date: May 14, 1971	EDR
1983	Aerial Photograph. Scale: 1"=1000'	Panel #: 2441088-G1/Flight Date: April 20, 1983	EDR
1988	Aerial Photograph. Scale: 1"=750'	Panel #: 2441088-G1/Flight Date: April 17, 1988	EDR
1993	Aerial Photograph. Scale: 1"=750'	Panel #: 2441088-G1/Flight Date: April 17, 1993	EDR
1994	Aerial Photograph. Scale: 1"=750'	Panel #: 2441088-G1/Flight Date: March 31, 1994	EDR
2005	Aerial Photograph. 1" = 604'	Flight Year: 2005	EDR
2006	Aerial Photograph. 1" = 604'	Flight Year: 2006	EDR



INQUIRY #: 2537497.35

YEAR: 1952

| = 750'





INQUIRY #: 2537497.35

YEAR: 1971

| = 833'





INQUIRY #: 2537497.35

YEAR: 1983

| = 1000'





INQUIRY #: 2537497.35

YEAR: 1988

| = 750'





INQUIRY #: 2537497.35

YEAR: 1993

| = 750'





INQUIRY #: 2537497.35

YEAR: 1994

| = 750'






INQUIRY #: 2537497.35

YEAR: 2005

| = 604'



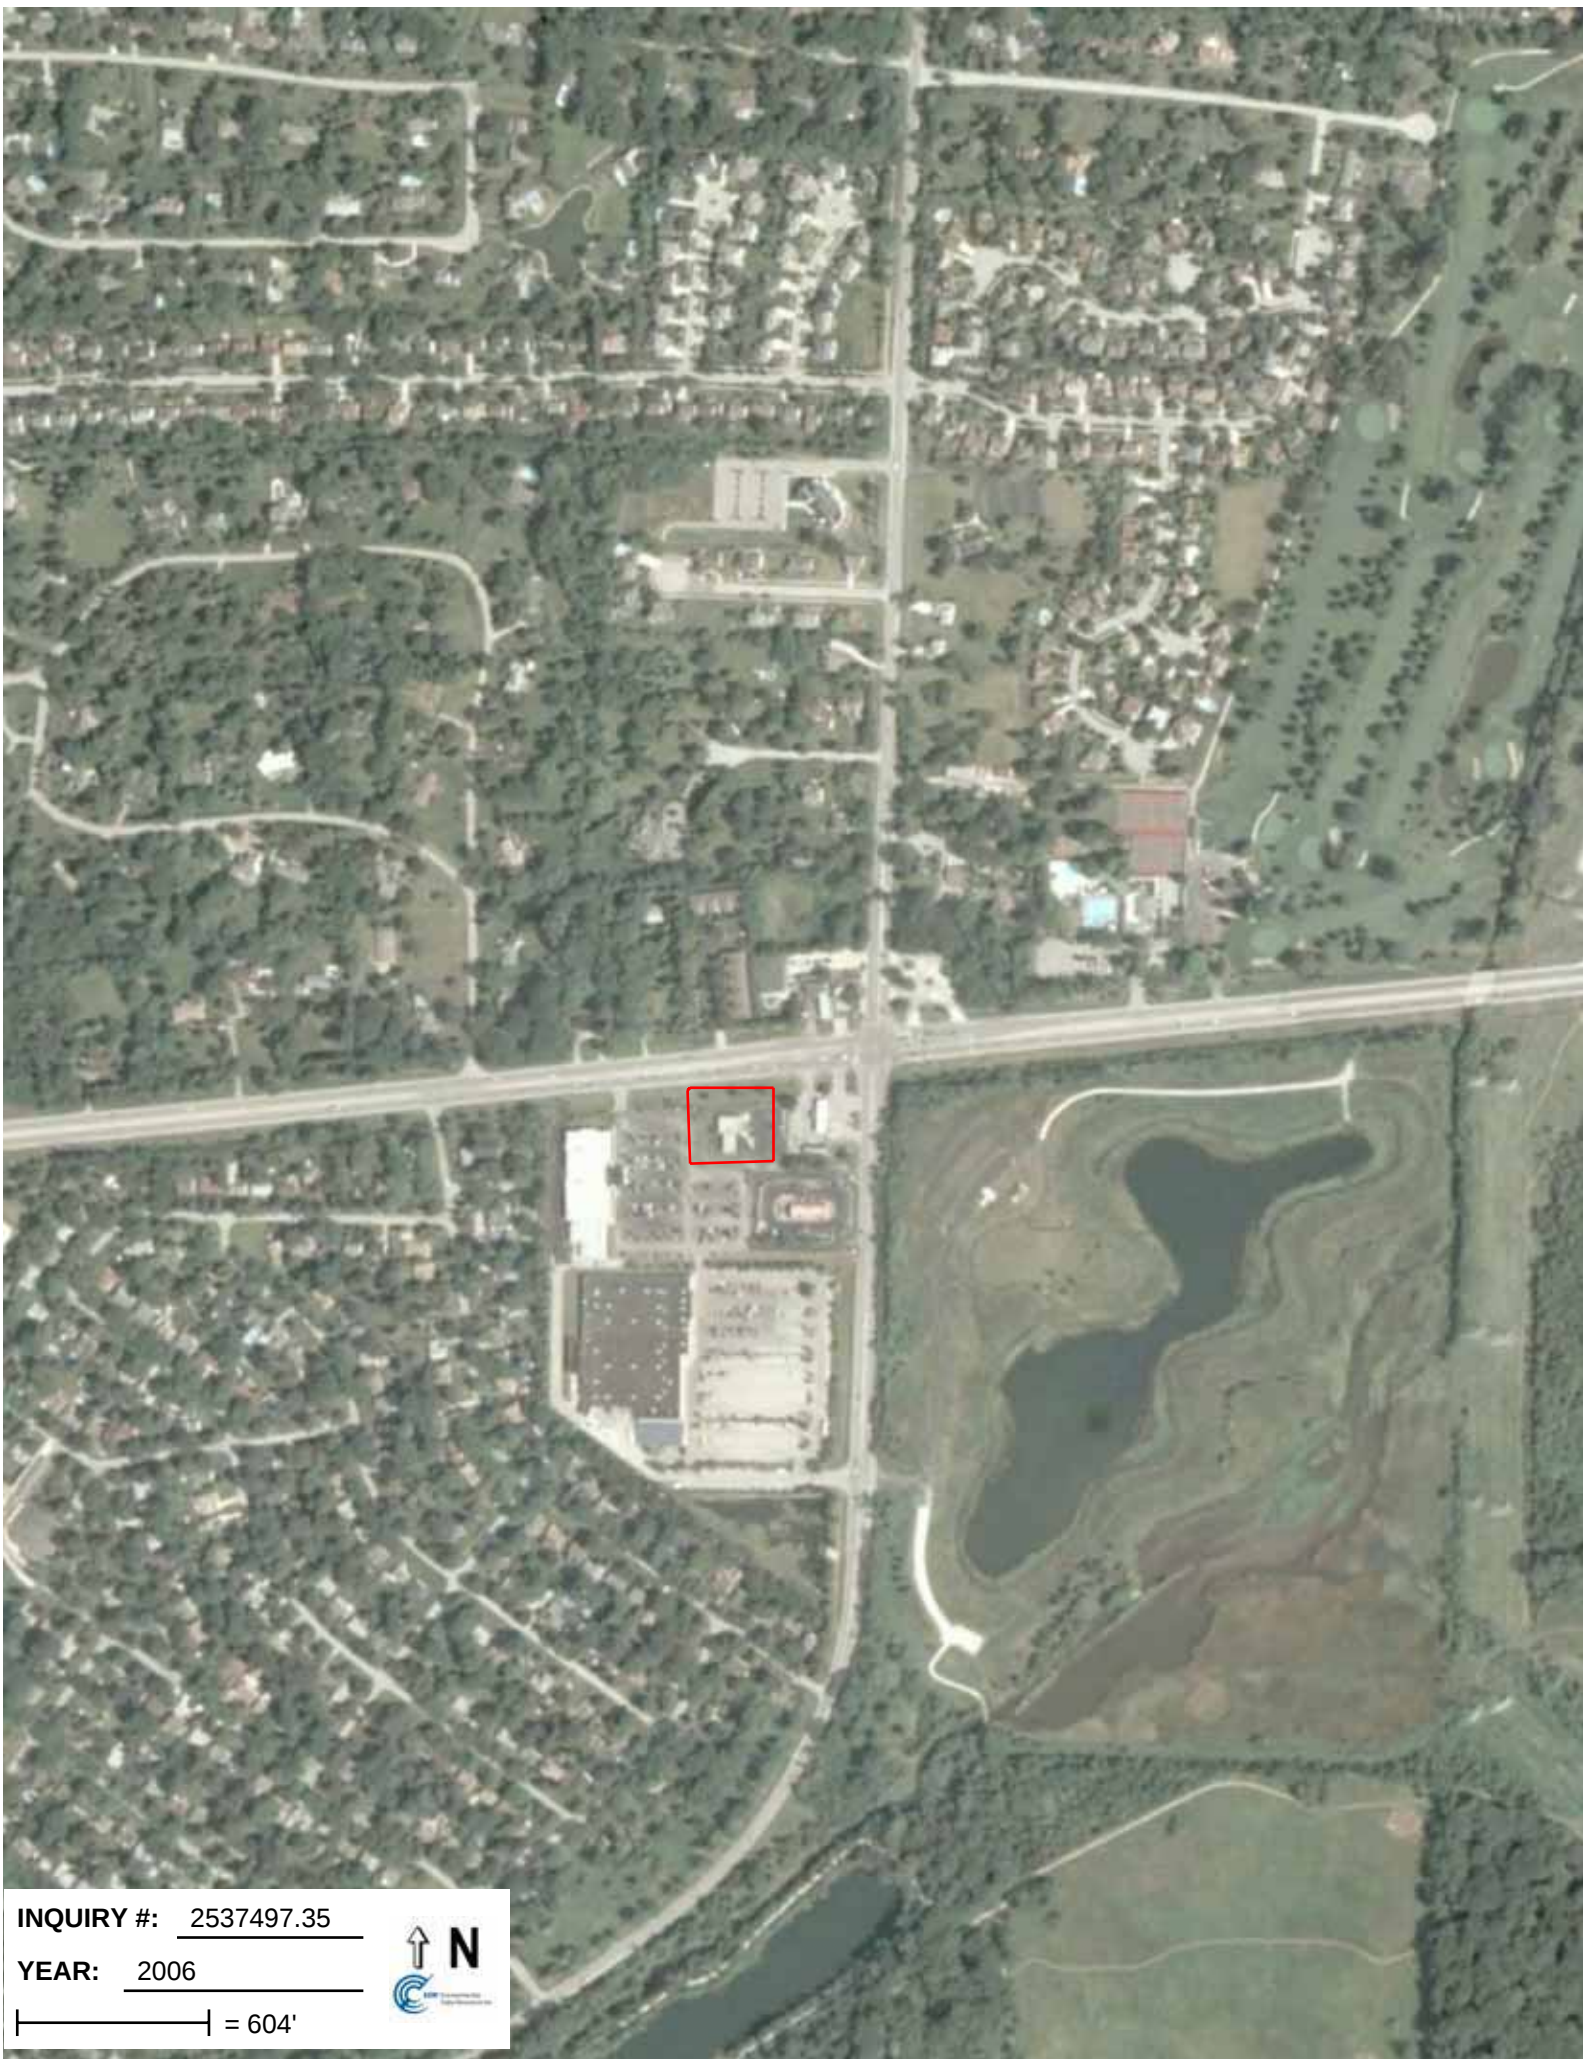

INQUIRY #: 2537497.35

YEAR: 2006

| = 604'



Sanborn Maps

Bank of America

22W151 Butterfield Rd
Glen Ellyn, IL 60137

Inquiry Number: 2537497.33
July 10, 2009

Certified Sanborn® Map Report



440 Wheelers Farms Road
Milford, CT 06461
800.352.0050
www.edrnet.com

Certified Sanborn® Map Report

7/10/09

Site Name:

Bank of America
22W151 Butterfield Rd
Glen Ellyn, IL 60137

Client Name:

LFR Inc
630 Tollgate Road
Elgin, IL 60123

EDR Inquiry # 2537497.33

Contact: Morgan Vogt



The complete Sanborn Library collection has been searched by EDR, and fire insurance maps covering the target property location provided by LFR Inc were identified for the years listed below. The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by Sanborn Library LLC, the copyright holder for the collection.

Certified Sanborn Results:

Site Name: Bank of America
Address: 22W151 Butterfield Rd
City, State, Zip: Glen Ellyn, IL 60137
Cross Street:
P.O. # NA
Project: Bank of America
Certification # B425-489C-ACB7



Sanborn® Library search results
Certification # B425-489C-ACB7

UNMAPPED PROPERTY

This report certifies that the complete holdings of the Sanborn Library, LLC collection have been searched based on client supplied target property information, and fire insurance maps covering the target property were not found.

The Sanborn Library includes more than 1.2 million Sanborn fire insurance maps, which track historical property usage in approximately 12,000 American cities and towns. Collections searched:

- ☒ Library of Congress
- ☒ University Publications of America
- ☒ EDR Private Collection

Limited Permission To Make Copies

LFR Inc (the client) is permitted to make up to THREE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

Disclaimer - Copyright and Trademark notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2009 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

City Directory Abstract

Bank of America

22W151 Butterfield Rd
Glen Ellyn, IL 60137

Inquiry Number: 2537497.36
July 14, 2009

The EDR-City Directory Abstract



Environmental Data Resources Inc

440 Wheelers Farms Road
Milford, CT 06461
800.352.0050
www.edrnet.com

TABLE OF CONTENTS

SECTION

Executive Summary

Findings

Thank you for your business.

Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OR DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2008 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc. or its affiliates is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

2009 Enhancements to EDR City Directory Abstract

New for 2009, the EDR City Directory Abstract has been enhanced with additional information and features. These enhancements will make your city directory research process more efficient, flexible, and insightful than ever before. The enhancements will improve the options for selecting adjoining properties, and will speed up your review of the report.

City Directory Report. Three important enhancements have been made to the EDR City Directory Abstract:

1. *Executive Summary.* The report begins with an Executive Summary that lists the sources consulted in the preparation of the report. Where available, a parcel map is also provided within the report, showing the locations of properties researched.
2. *Page Images.* Where available, the actual page source images will be included in the Appendix, so that you can review them for information that may provide additional insight. EDR has copyright permission to include these images.
3. *Findings Listed by Location.* Another useful enhancement is that findings are now grouped by address. This will significantly reduce the time you need to review your abstracts. Findings are provided under each property address, listed in reverse chronological order and referencing the source for each entry.

Options for Selecting Adjoining Properties. Ensuring that the right adjoining property addresses are searched is one of the biggest challenges that environmental professionals face when conducting city directory historical research. EDR's new enhancements make it easier for you to meet this challenge. Now, when you place an order for the EDR City Directory Abstract, you have the following choices for determining which addresses should be researched.

1. *You Select Addresses and EDR Selects Addresses.* Use the "Add Another Address" feature to specify the addresses you want researched. Your selections will be supplemented by addresses selected by EDR researchers using our established research methods. Where available, a digital map will be shown, indicating property lines overlaid on a color aerial photo and their corresponding addresses. Simply use the address list below the map to check off which properties shown on the map you want to include. You may also select other addresses using the "Add Another Address" feature at the bottom of the list.
2. *EDR Selects Addresses.* Choose this method if you want EDR's researchers to select the addresses to be researched for you, using our established research methods.
3. *You Select Addresses.* Use this method for research based solely on the addresses you select or enter into the system.
4. *Hold City Directory Research Option.* If you choose to select your own adjoining addresses, you may pause production of your EDR City Directory Abstract report until you have had a chance to look at your other EDR reports and sources. Sources for property addresses include: your Certified Sanborn Map Report may show you the location of property addresses; the new EDR Property Tax Map Report may show the location of property addresses; and your field research can supplement these sources with additional address information. To use this capability, simply click "Hold City Directory research" box under "Other Options" at the bottom of the page. Once you have determined what addresses you want researched, go to your EDR Order Status page, select the EDR City Directory Abstract, and enter the addresses and submit for production.

Questions? Contact your EDR representative at 800-352-0050. For more information about all of EDR's 2009 report and service enhancements, visit www.edrnet.com/2009enhancements

EXECUTIVE SUMMARY

DESCRIPTION

Environmental Data Resources, Inc.'s (EDR) City Directory Abstract is a screening tool designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDR's City Directory Abstract includes a search and abstract of available city directory data. For each address, the directory lists the name of the corresponding occupant at five year intervals.

RESEARCH SUMMARY

The following research sources were consulted in the preparation of this report. An "X" indicates where information was identified in the source and provided in this report.

<u>Year</u>	<u>Source</u>	<u>TP</u>	<u>Adjoining</u>	<u>Text Abstract</u>	<u>Source Image</u>
2007	Haines Criss-Cross Directory	X	X	X	-
2000	Haines Criss-Cross Directory	X	X	X	-
1995	Haines Criss-Cross Directory	X	X	X	-
1990	Haines Criss-Cross Directory	-	X	X	-
1986	Haines Criss-Cross Directory	-	X	X	-
1976	Haines Criss-Cross Directory	X	X	X	-

FINDINGS

TARGET PROPERTY INFORMATION

ADDRESS

22W151 Butterfield Rd
Glen Ellyn, IL 60137

FINDINGS DETAIL

Target Property research detail.

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2007	LaSalle Bank	Haines Criss-Cross Directory
2000	LaSalle Bank	Haines Criss-Cross Directory
1995	LaSalle Talman Bank	Haines Criss-Cross Directory
1976	Talman Fed Svgs & Loan	Haines Criss-Cross Directory

FINDINGS

ADJOINING PROPERTY DETAIL

The following Adjoining Property addresses were researched for this report. Detailed findings are provided for each address.

Arboretum Rd

2S727 Arboretum Rd

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2007	Residential	Haines Criss-Cross Directory
2000	Residential	Haines Criss-Cross Directory
1995	Residential	Haines Criss-Cross Directory
1990	Residential	Haines Criss-Cross Directory
1986	Residential	Haines Criss-Cross Directory
1976	Residential	Haines Criss-Cross Directory

2S775 Arboretum Rd

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2007	Residential	Haines Criss-Cross Directory
2000	Residential	Haines Criss-Cross Directory
1995	Residential	Haines Criss-Cross Directory
1990	Residential	Haines Criss-Cross Directory
1986	Residential	Haines Criss-Cross Directory
1976	Residential	Haines Criss-Cross Directory

Butterfield Rd

Butterfield Rd

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2007	No other addresses (22W000-22W299) block Butterfield Rd	Haines Criss-Cross Directory
2000	No other addresses (22W000-22W299) block Butterfield Rd	Haines Criss-Cross Directory
1995	No other addresses (22W000-22W299) block Butterfield Rd	Haines Criss-Cross Directory
1990	No other addresses (22W000-22W299) block Butterfield Rd	Haines Criss-Cross Directory
1986	No other addresses (22W000-22W299) block Butterfield Rd	Haines Criss-Cross Directory
1976	No other addresses (22W000-22W299) block Butterfield Rd	Haines Criss-Cross Directory

FINDINGS

22W132 Butterfield Rd

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2007	Financl Transition	Haines Criss-Cross Directory
2000	Financl Transition	Haines Criss-Cross Directory
1995	Financl Transition	Haines Criss-Cross Directory

22W134 Butterfield Rd

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2007	Residential	Haines Criss-Cross Directory
2000	Insight Technology Inc	Haines Criss-Cross Directory
1990	Butterfld Club The	Haines Criss-Cross Directory

22W136 Butterfield Rd

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2007	Residential	Haines Criss-Cross Directory
2000	Residential	Haines Criss-Cross Directory
1995	Residential	Haines Criss-Cross Directory

22W140 Butterfield Rd

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1976	No Return	Haines Criss-Cross Directory

22W164 Butterfield Rd

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1986	Residential	Haines Criss-Cross Directory

22W280 Butterfield Rd

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2007	Residential	Haines Criss-Cross Directory
2000	Residential	Haines Criss-Cross Directory
1995	Residential	Haines Criss-Cross Directory
1990	Residential	Haines Criss-Cross Directory
1986	Residential	Haines Criss-Cross Directory
1976	Residential	Haines Criss-Cross Directory

FINDINGS

TARGET PROPERTY: ADDRESS NOT LISTED IN RESEARCH SOURCE

The following Target Property addresses were researched for this report, and the addresses were not listed in the research source.

Address Researched

22W151 Butterfield Rd

Address Not Listed in Research Source

1990, 1986

ADJOINING PROPERTY: ADDRESSES NOT LISTED IN RESEARCH SOURCE

The following Adjoining Property addresses were researched for this report, and the addresses were not listed in research source.

Address Researched

22W132 Butterfield Rd

22W134 Butterfield Rd

22W136 Butterfield Rd

22W164 Butterfield Rd

Address Not Listed in Research Source

1990, 1986, 1976

1995, 1986, 1976

1990, 1986, 1976

1976

Historical Topographic Maps

Bank of America

22W151 Butterfield Rd
Glen Ellyn, IL 60137

Inquiry Number: 2537497.34
July 10, 2009

The EDR Historical Topographic Map Report

EDR Historical Topographic Map Report

Environmental Data Resources, Inc.s (EDR) Historical Topographic Map Report is designed to assist professionals in evaluating potential liability on a target property resulting from past activities. EDRs Historical Topographic Map Report includes a search of a collection of public and private color historical topographic maps, dating back to the early 1900s.

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.


Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report AS IS. Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2009 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.


EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Historical Topographic Map

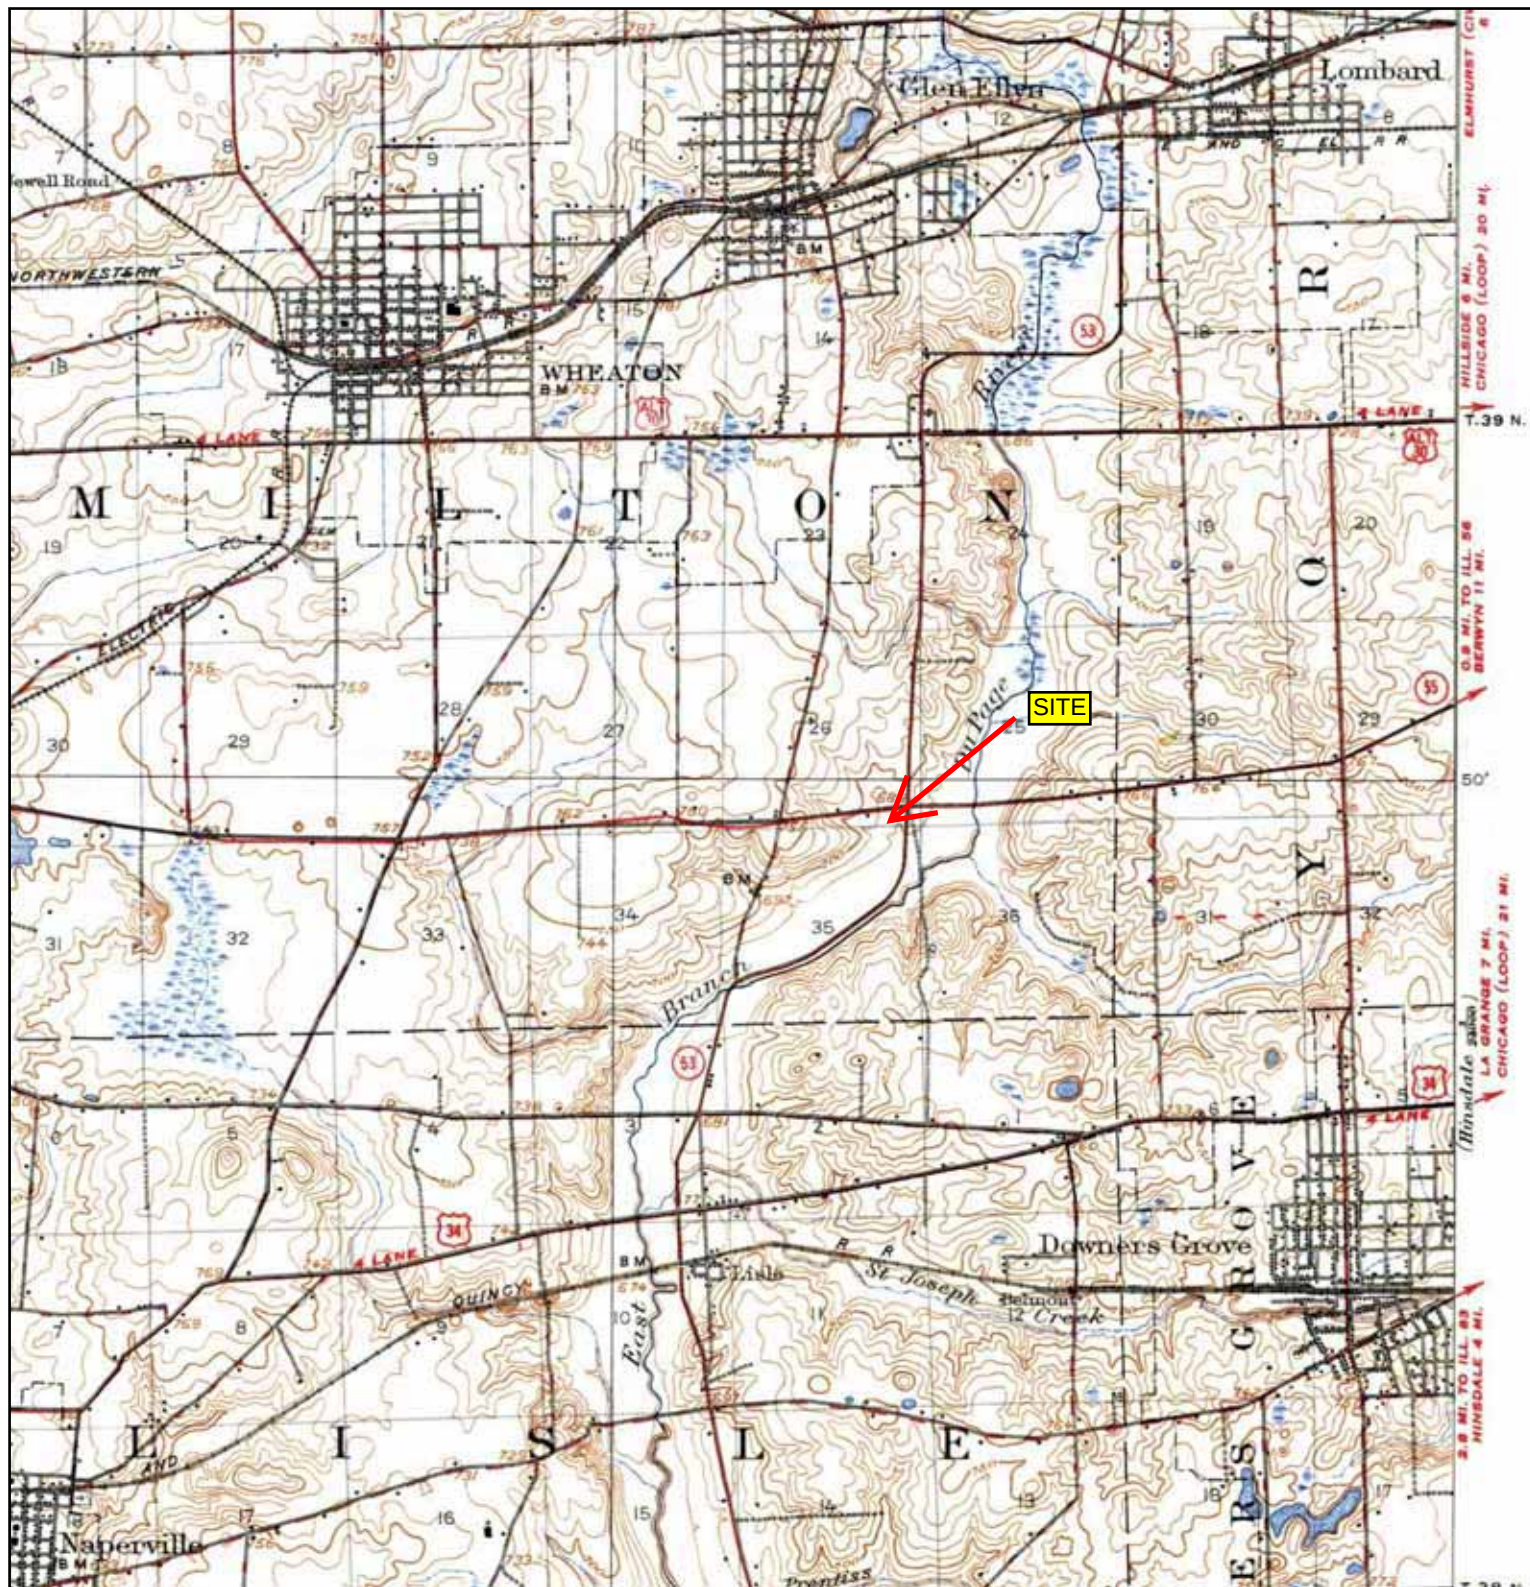


N ↑	TARGET QUAD NAME: WHEATON MAP YEAR: 1949 REVISED FROM: 1908 SERIES: 15 SCALE: 1:62500	SITE NAME: Bank of America ADDRESS: 22W151 Butterfield Rd Glen Ellyn, IL 60137 LAT/LONG: 41.8312 / 88.0552	CLIENT: LFR Inc CONTACT: Morgan Vogt INQUIRY#: 2537497.34 RESEARCH DATE: 07/10/2009
----------------	--	---	--

Historical Topographic Map

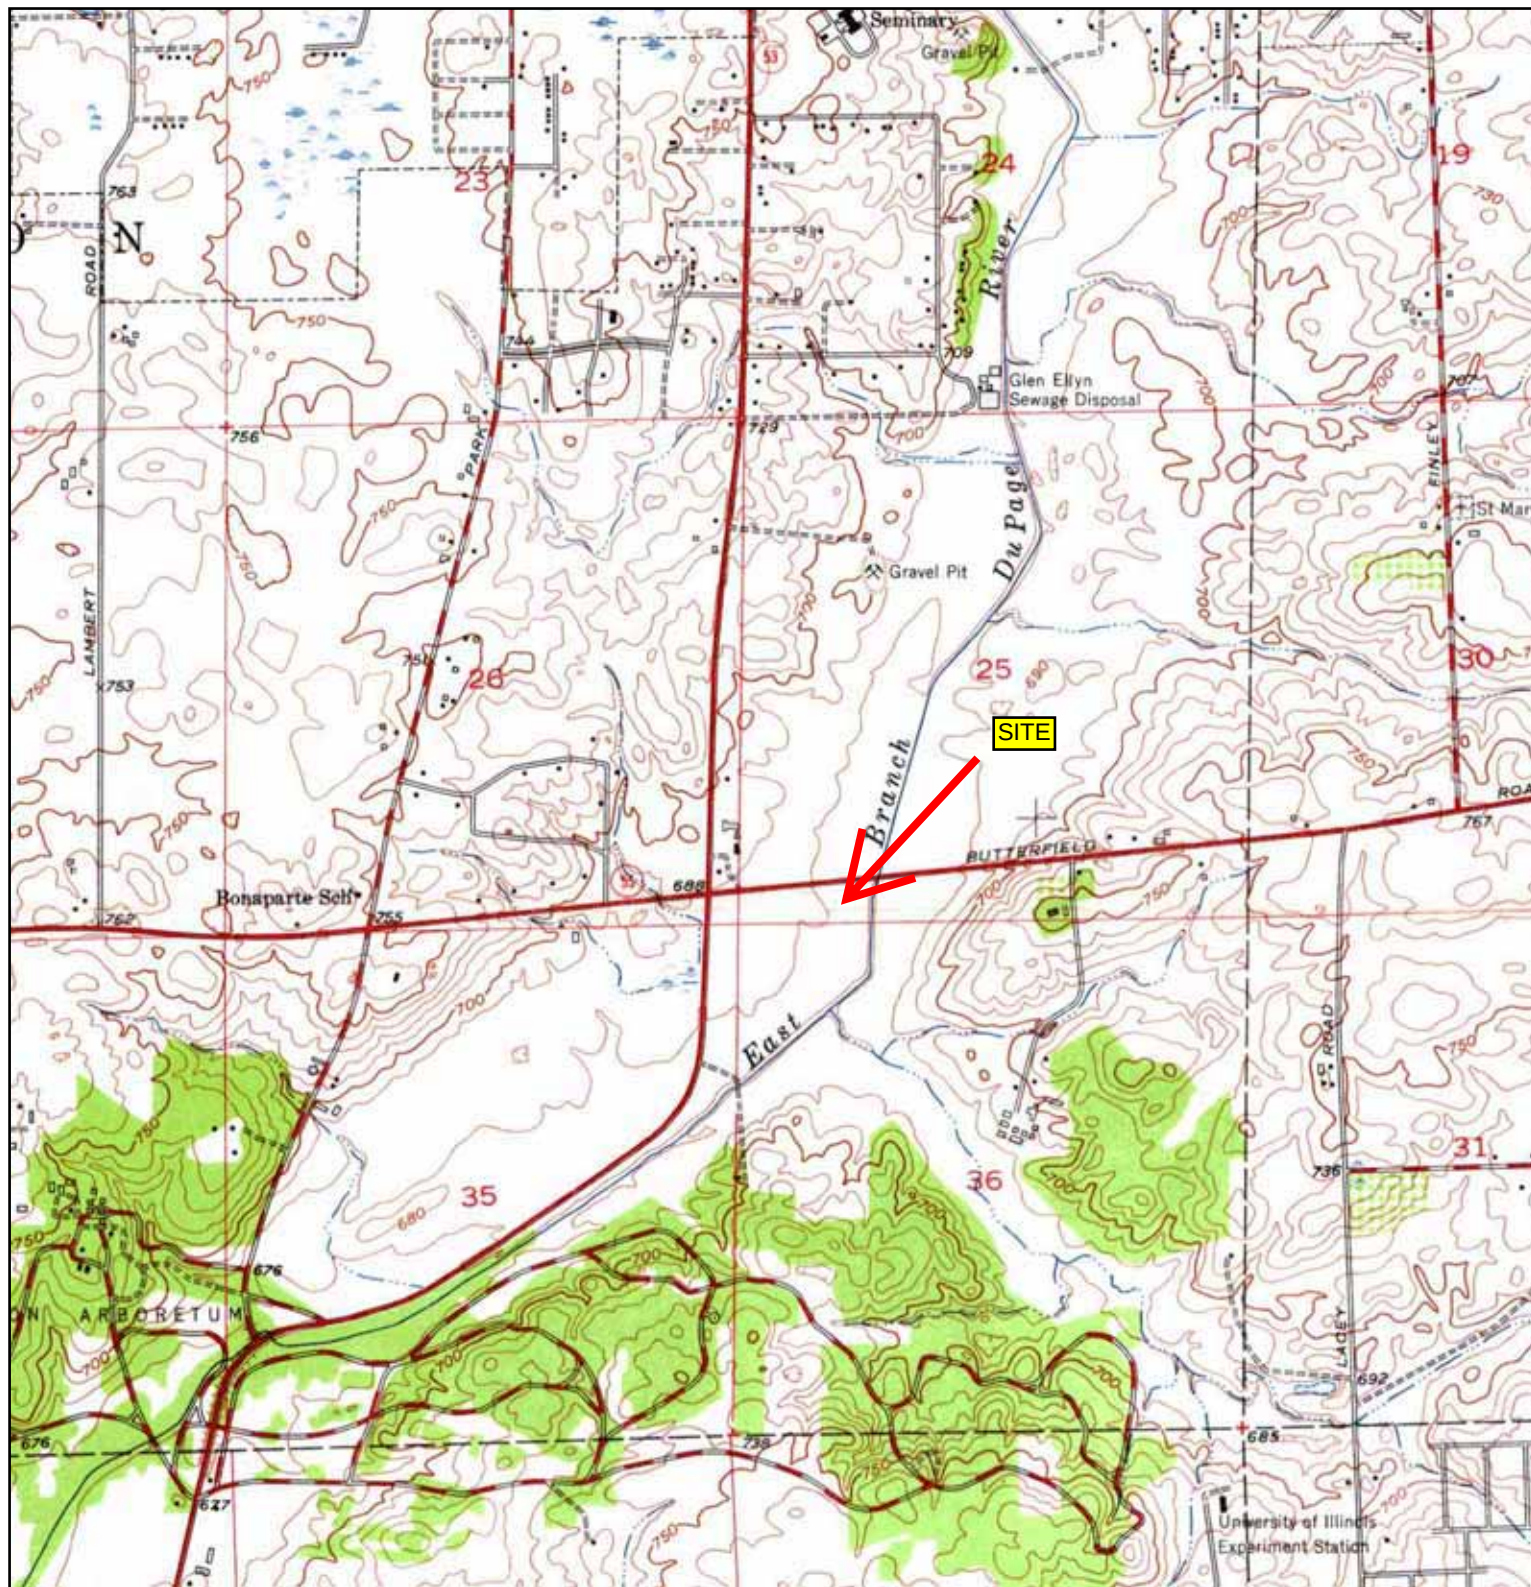

N ↑	TARGET QUAD NAME: WHEATON MAP YEAR: 1954 SERIES: 7.5 SCALE: 1:24000	SITE NAME: Bank of America ADDRESS: 22W151 Butterfield Rd Glen Ellyn, IL 60137 LAT/LONG: 41.8312 / 88.0552	CLIENT: LFR Inc CONTACT: Morgan Vogt INQUIRY#: 2537497.34 RESEARCH DATE: 07/10/2009
----------------	---	---	--

Historical Topographic Map

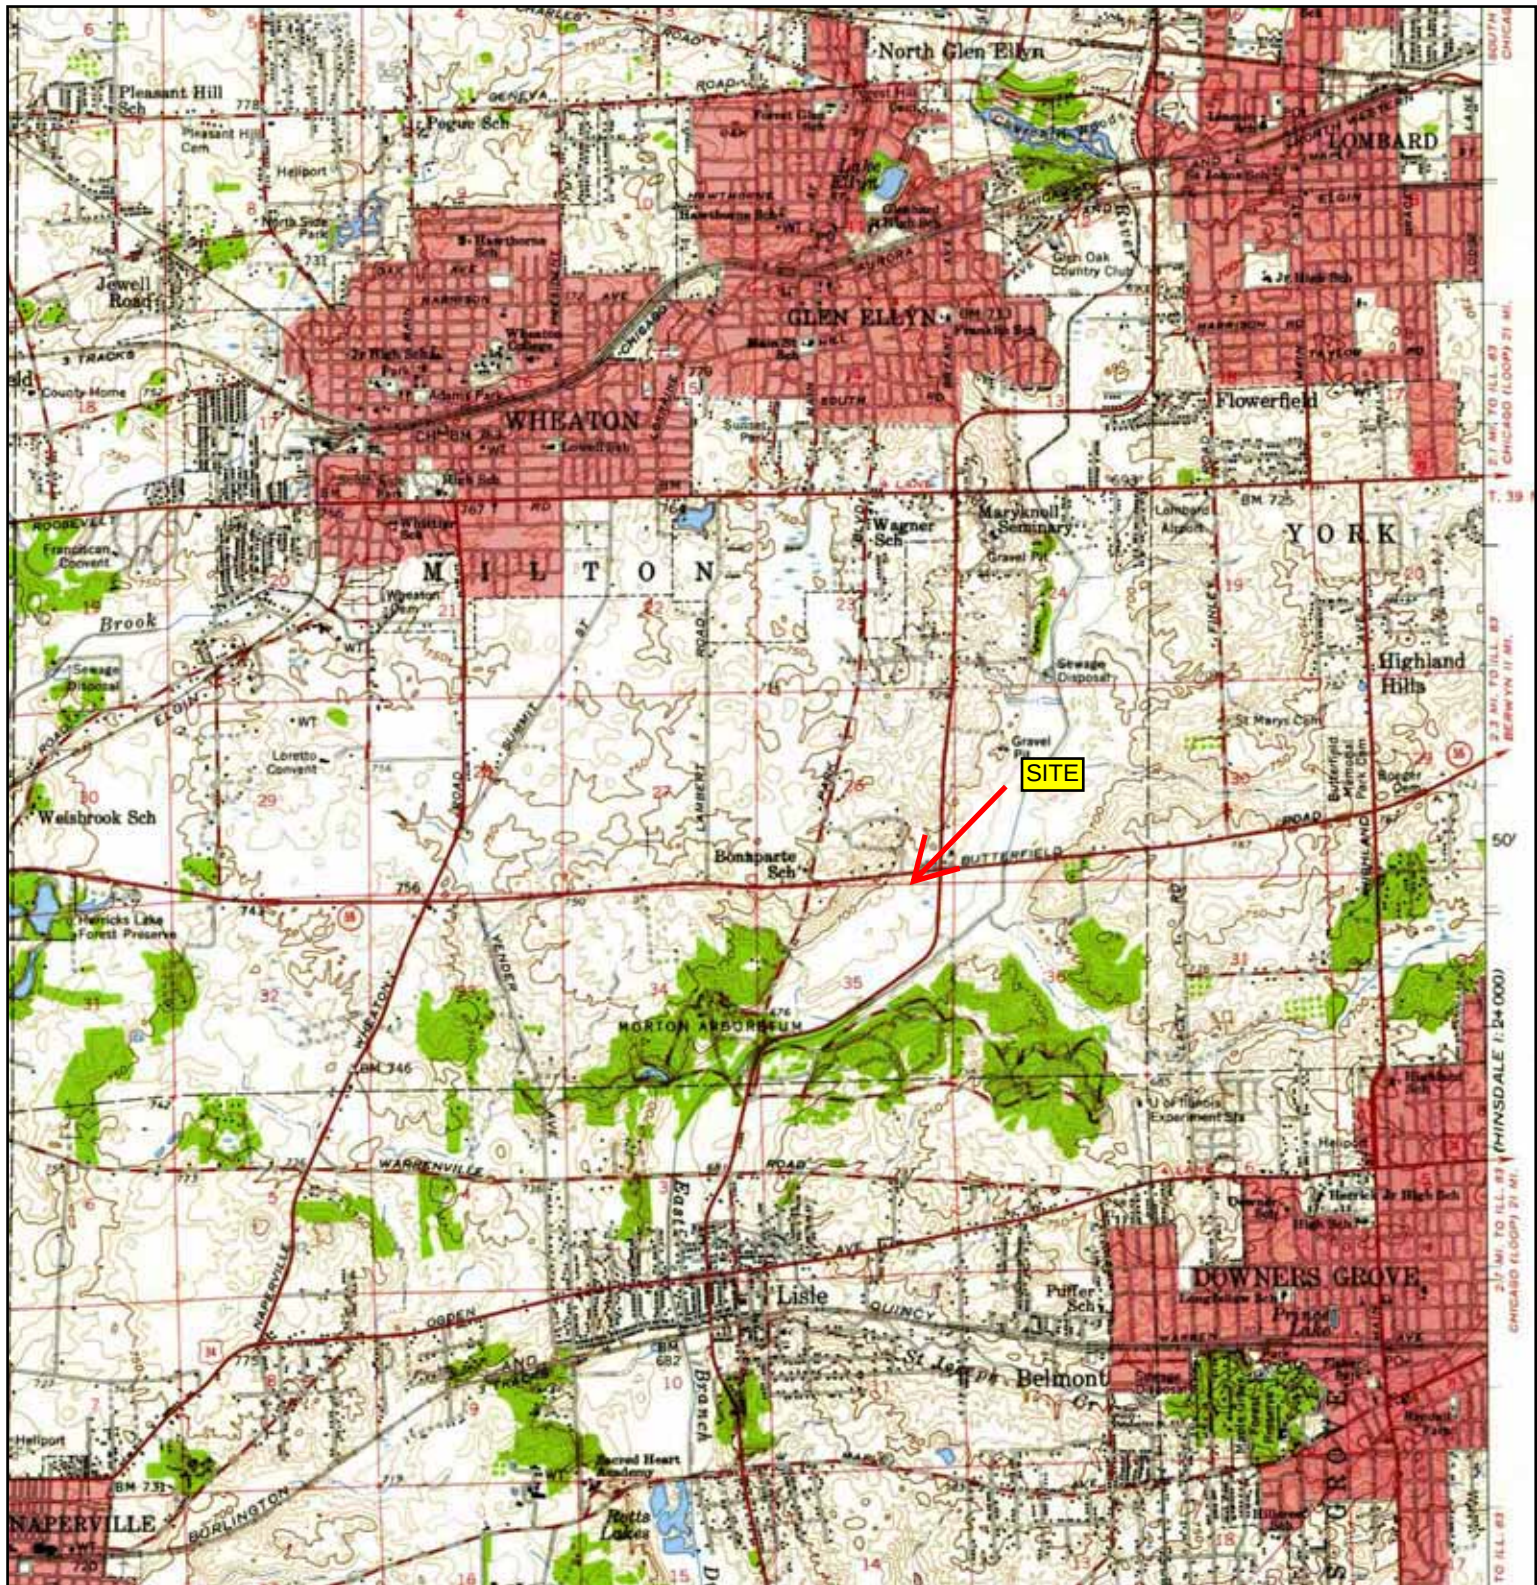


TARGET QUAD
NAME: WHEATON
MAP YEAR: 1954

SERIES: 15
SCALE: 1:62500

SITE NAME: Bank of America
ADDRESS: 22W151 Butterfield Rd
Glen Ellyn, IL 60137
LAT/LONG: 41.8312 / 88.0552


CLIENT: LFR Inc
CONTACT: Morgan Vogt
INQUIRY#: 2537497.34
RESEARCH DATE: 07/10/2009

Historical Topographic Map

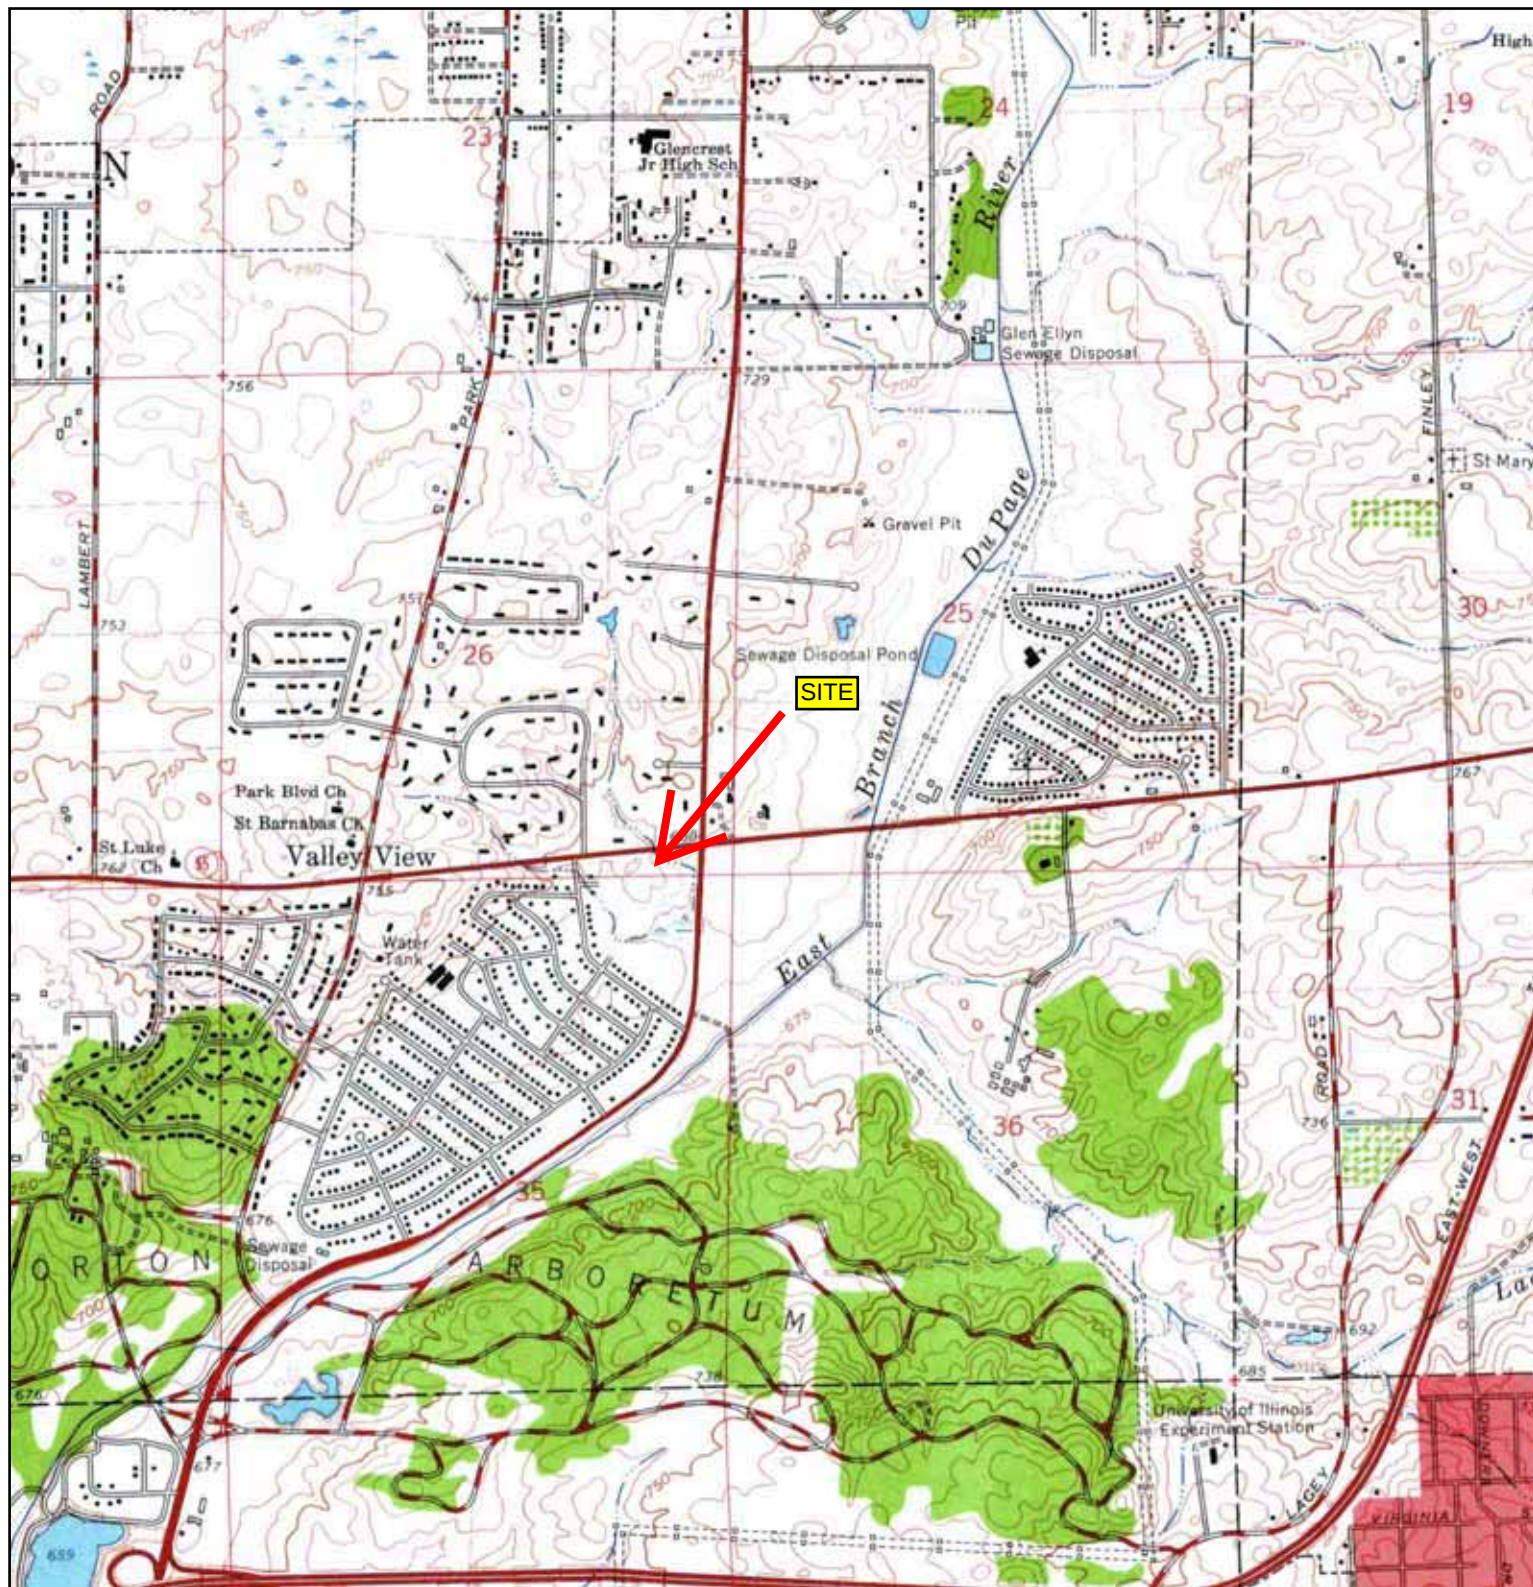


	TARGET QUAD NAME: WHEATON MAP YEAR: 1962	SITE NAME: Bank of America ADDRESS: 22W151 Butterfield Rd Glen Ellyn, IL 60137 LAT/LONG: 41.8312 / 88.0552	CLIENT: LFR Inc CONTACT: Morgan Vogt INQUIRY#: 2537497.34 RESEARCH DATE: 07/10/2009
	SERIES: 7.5 SCALE: 1:24000		

Historical Topographic Map

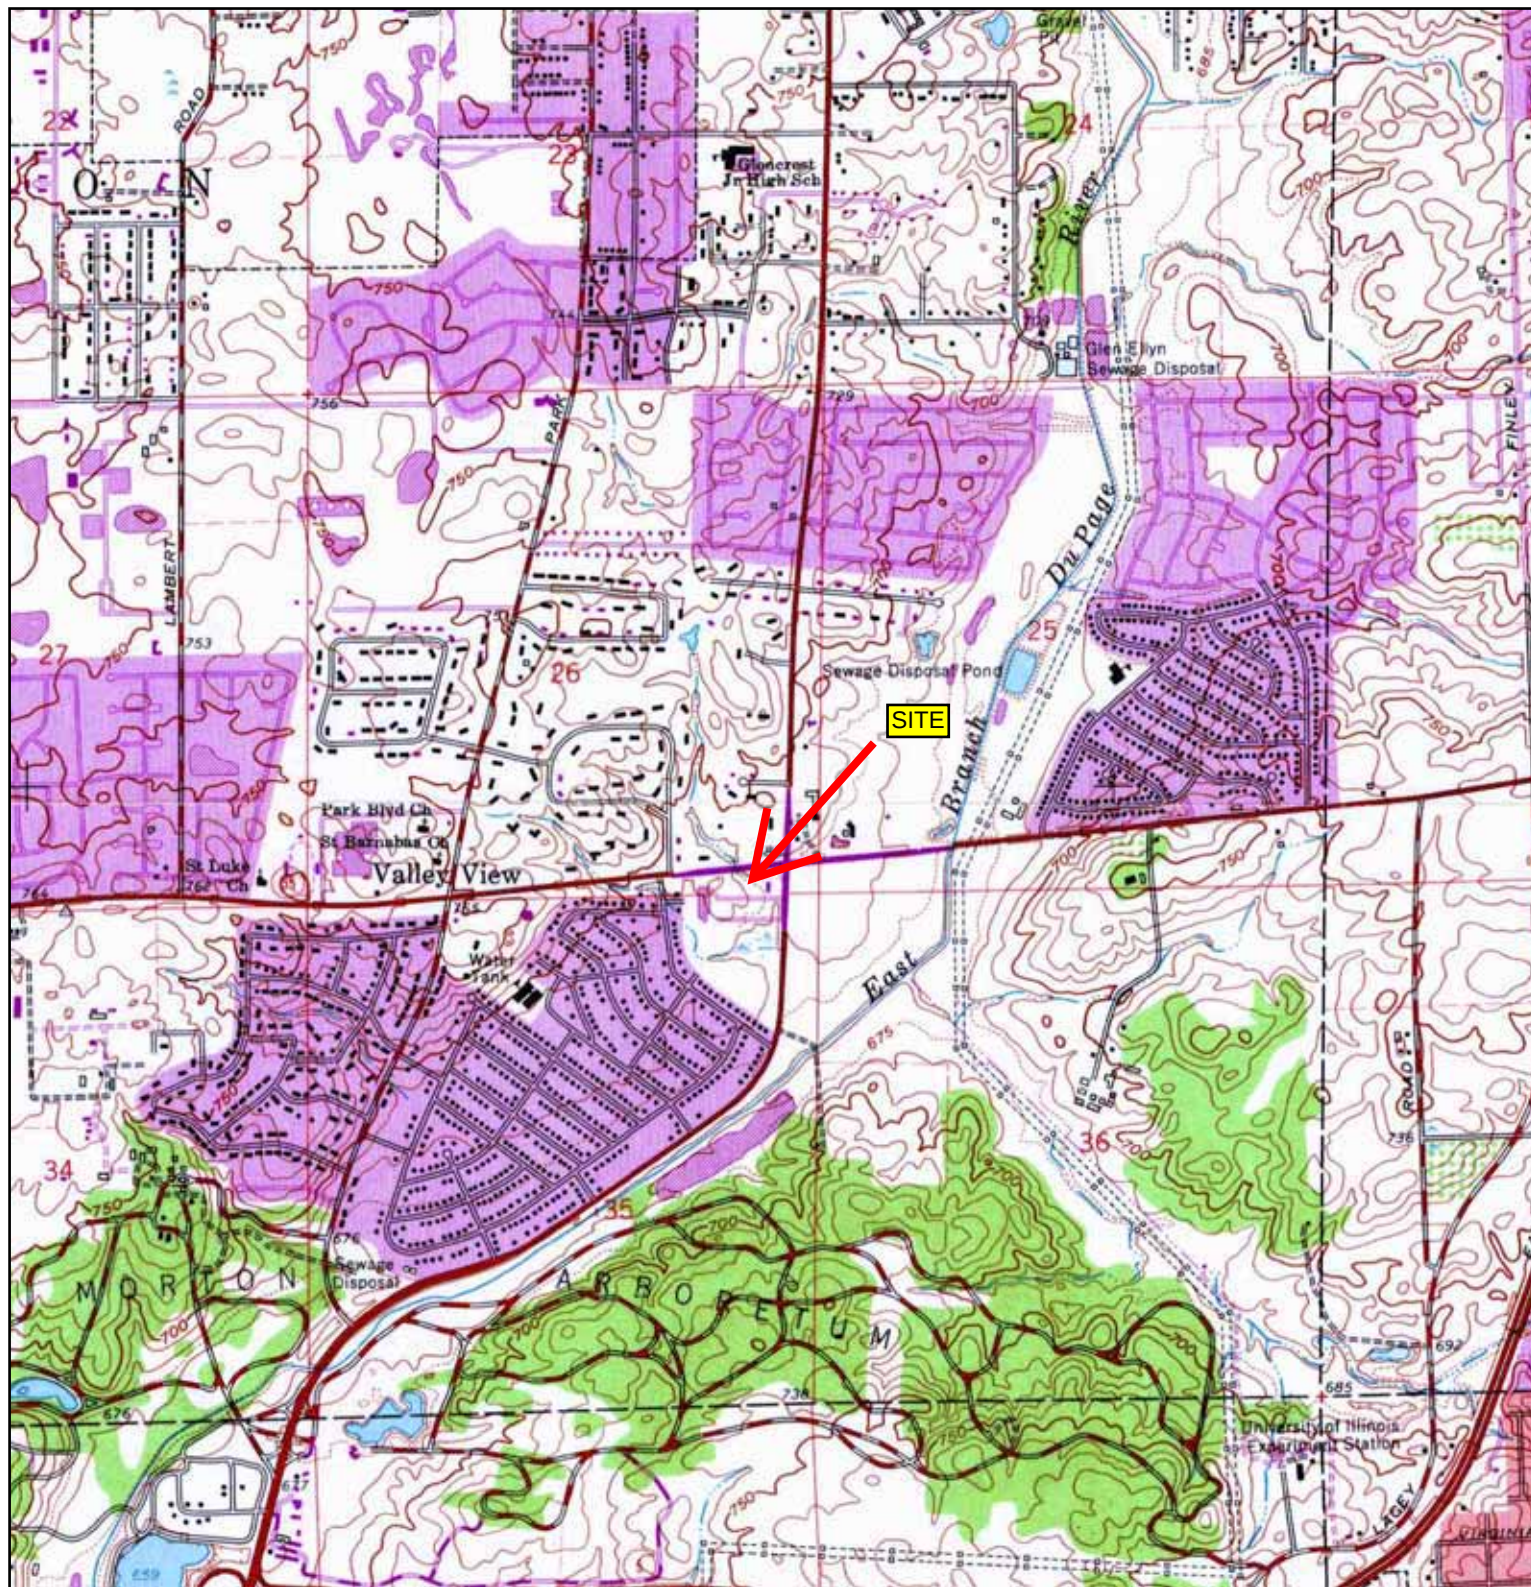


N ↑	TARGET QUAD NAME: WHEATON MAP YEAR: 1972 PHOTOREVISED FROM: 1962 SERIES: 7.5 SCALE: 1:24000	SITE NAME: Bank of America ADDRESS: 22W151 Butterfield Rd Glen Ellyn, IL 60137 LAT/LONG: 41.8312 / 88.0552	CLIENT: LFR Inc CONTACT: Morgan Vogt INQUIRY#: 2537497.34 RESEARCH DATE: 07/10/2009
----------------	--	---	--

Historical Topographic Map

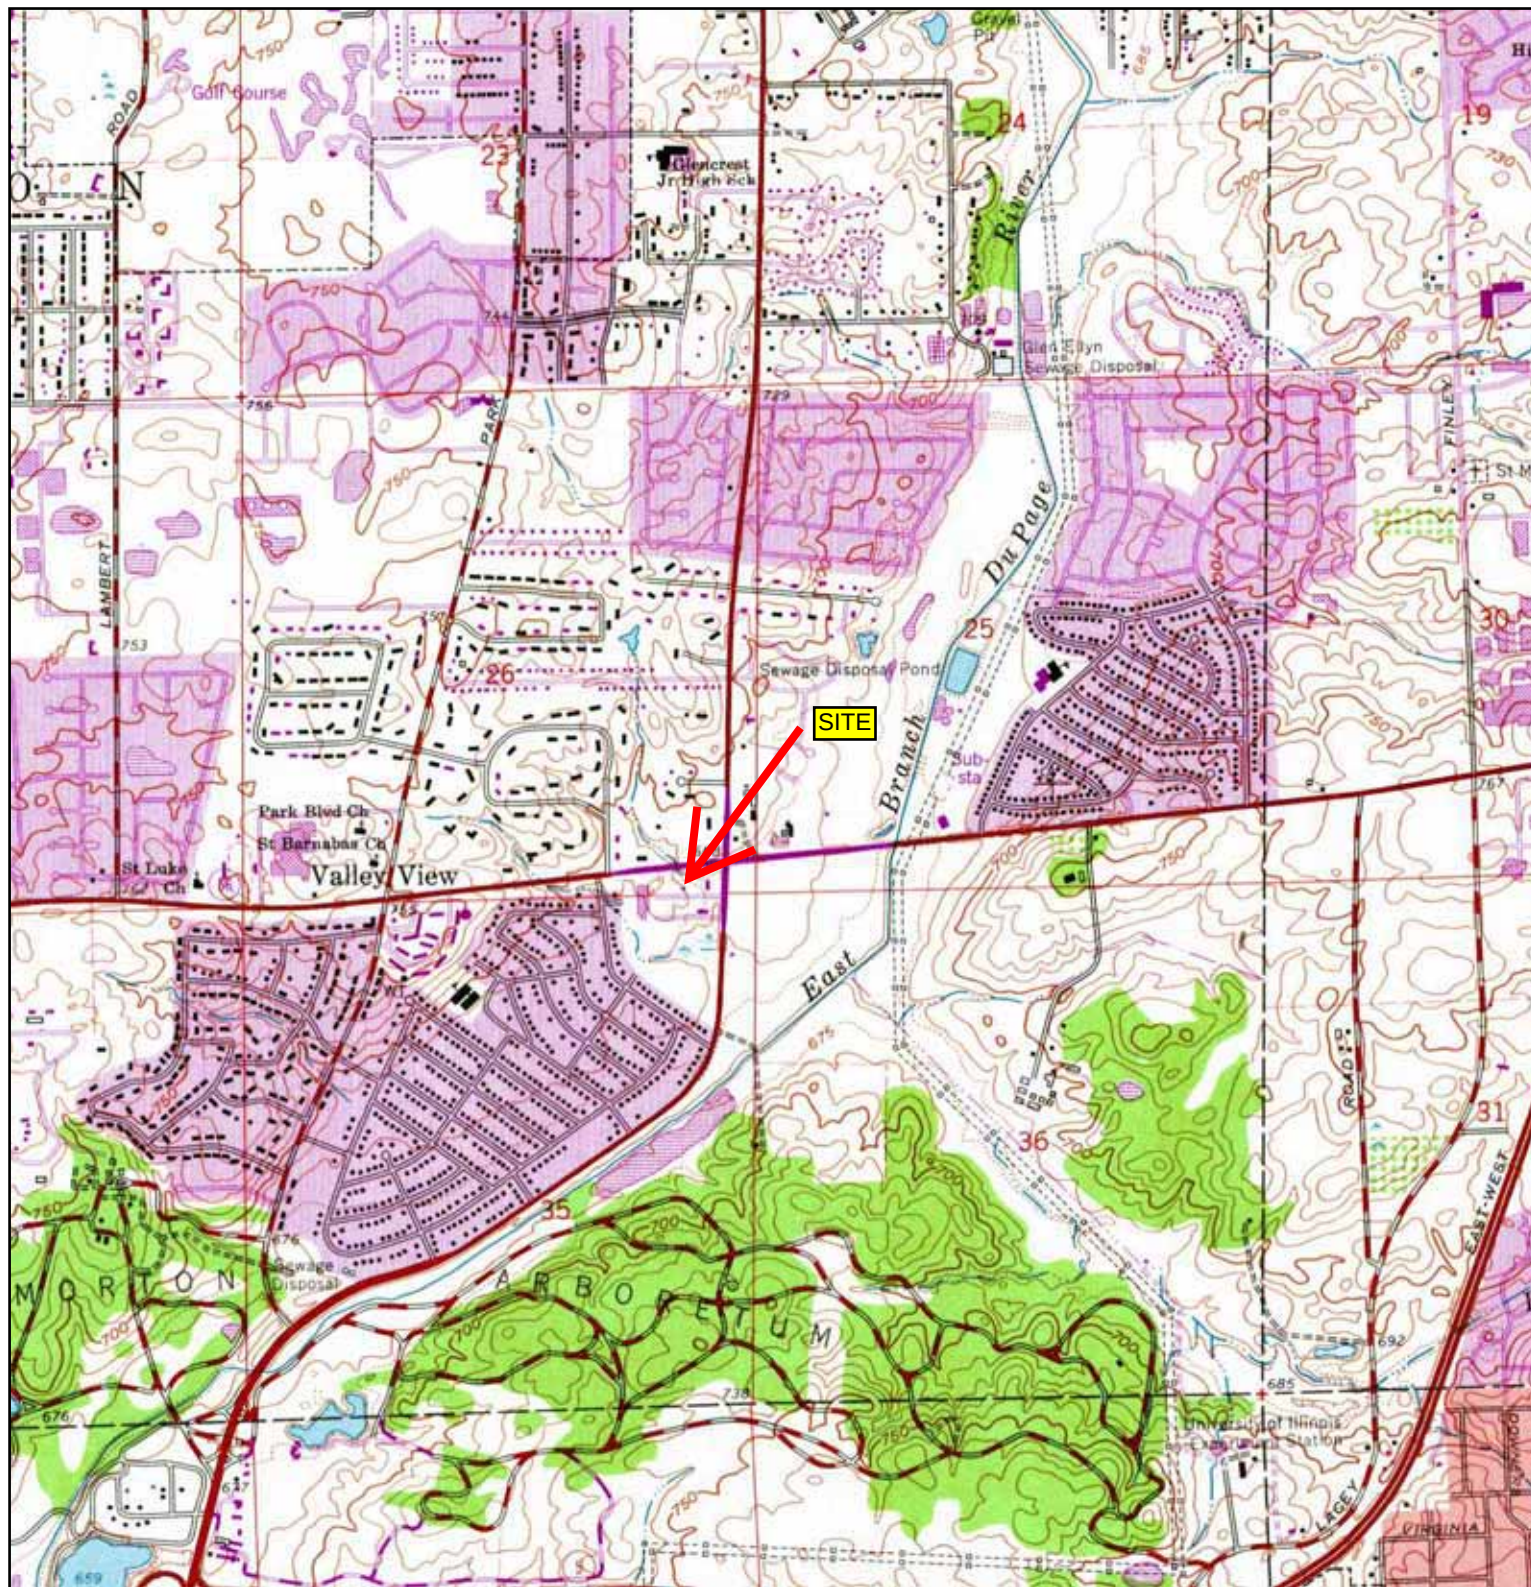


N ↑	TARGET QUAD NAME: WHEATON MAP YEAR: 1980 PHOTOREVISED FROM: 1962 SERIES: 7.5 SCALE: 1:24000	SITE NAME: Bank of America ADDRESS: 22W151 Butterfield Rd Glen Ellyn, IL 60137 LAT/LONG: 41.8312 / 88.0552	CLIENT: LFR Inc CONTACT: Morgan Vogt INQUIRY#: 2537497.34 RESEARCH DATE: 07/10/2009
----------------	--	---	--

Historical Topographic Map

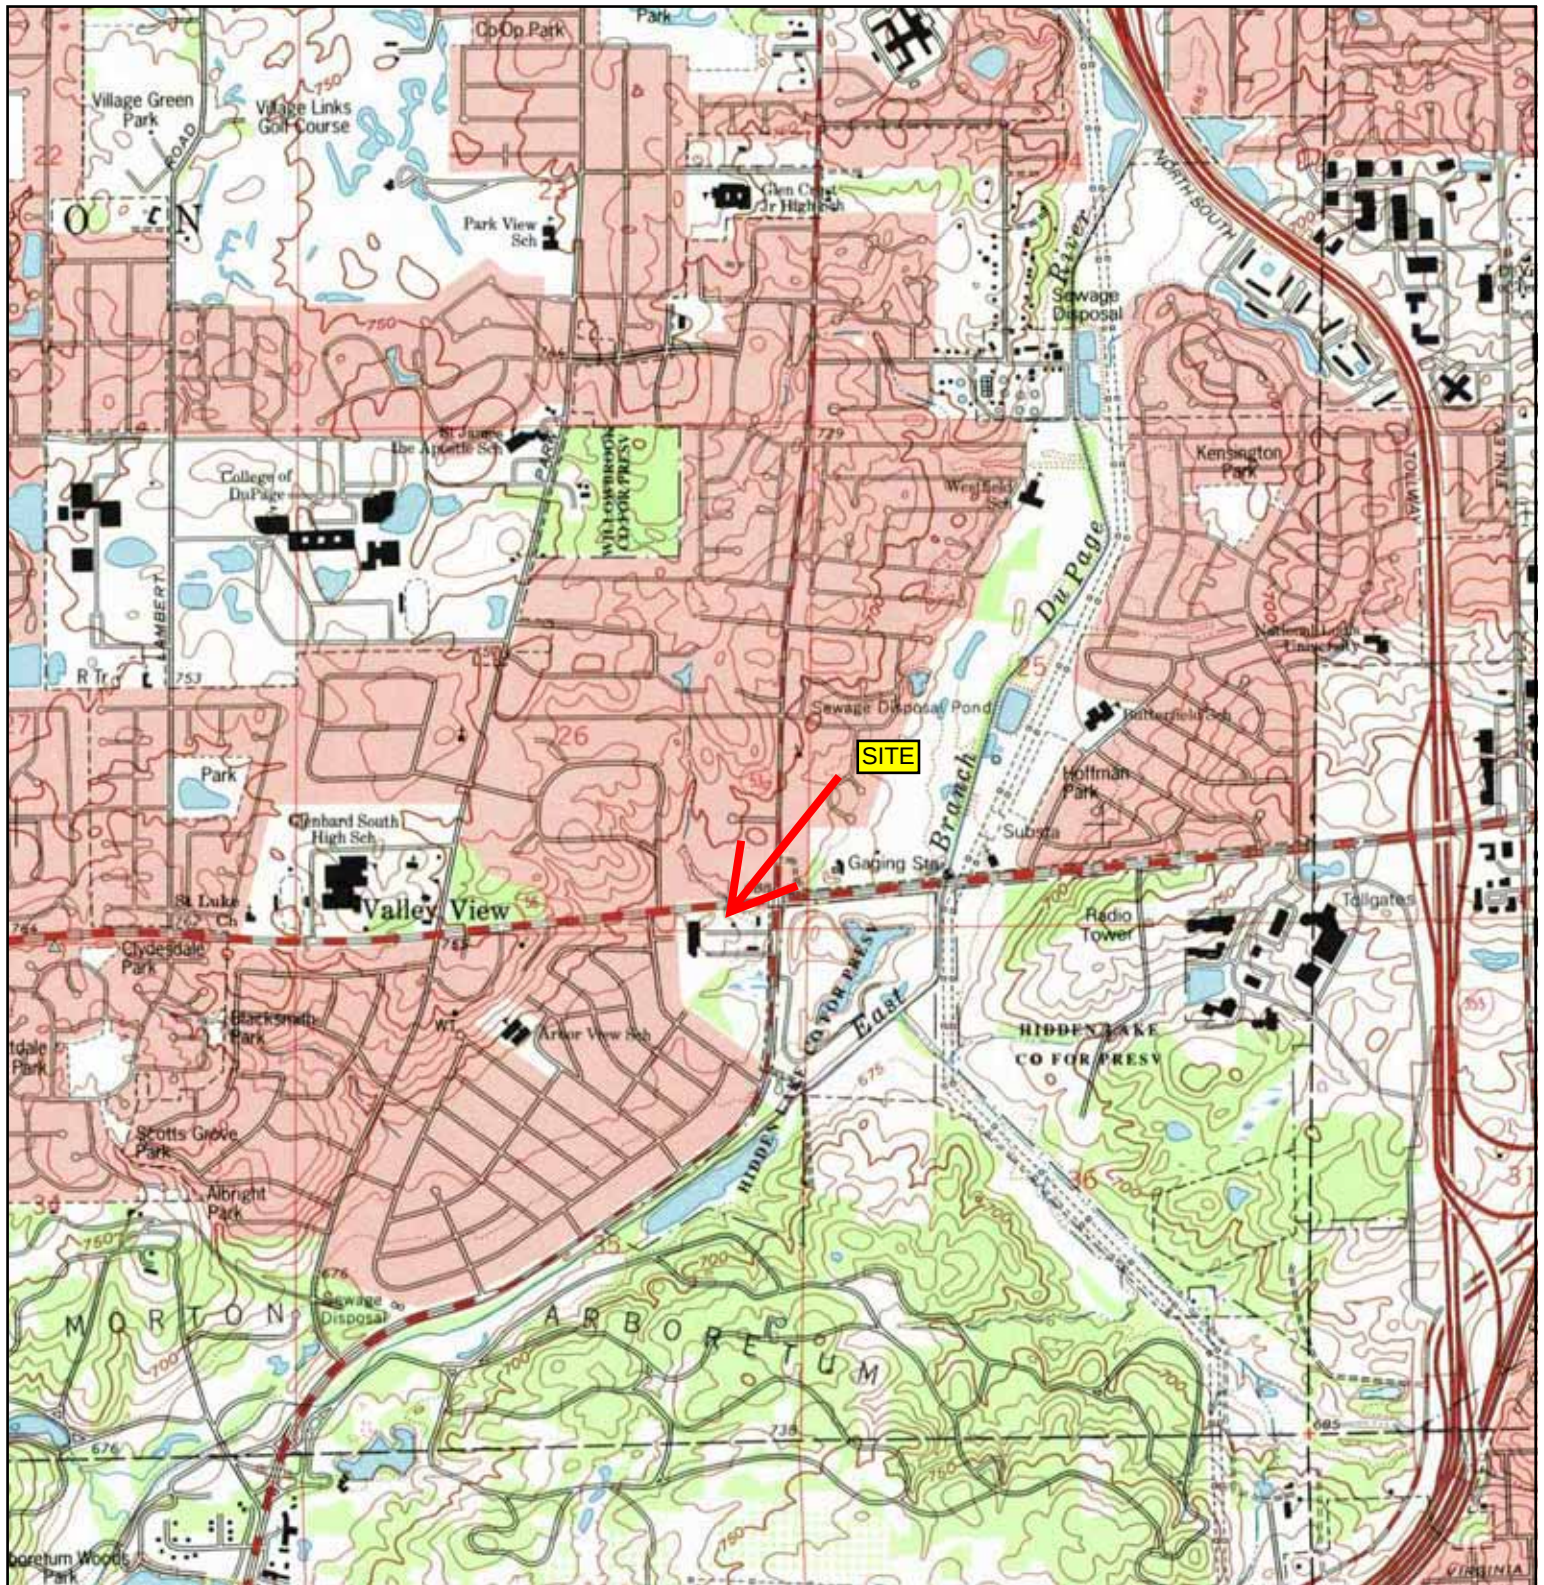

N ↑	TARGET QUAD NAME: WHEATON MAP YEAR: 1993 SERIES: 7.5 SCALE: 1:24000	SITE NAME: Bank of America ADDRESS: 22W151 Butterfield Rd Glen Ellyn, IL 60137 LAT/LONG: 41.8312 / 88.0552	CLIENT: LFR Inc CONTACT: Morgan Vogt INQUIRY#: 2537497.34 RESEARCH DATE: 07/10/2009
----------------	---	---	--

Historical Topographic Map

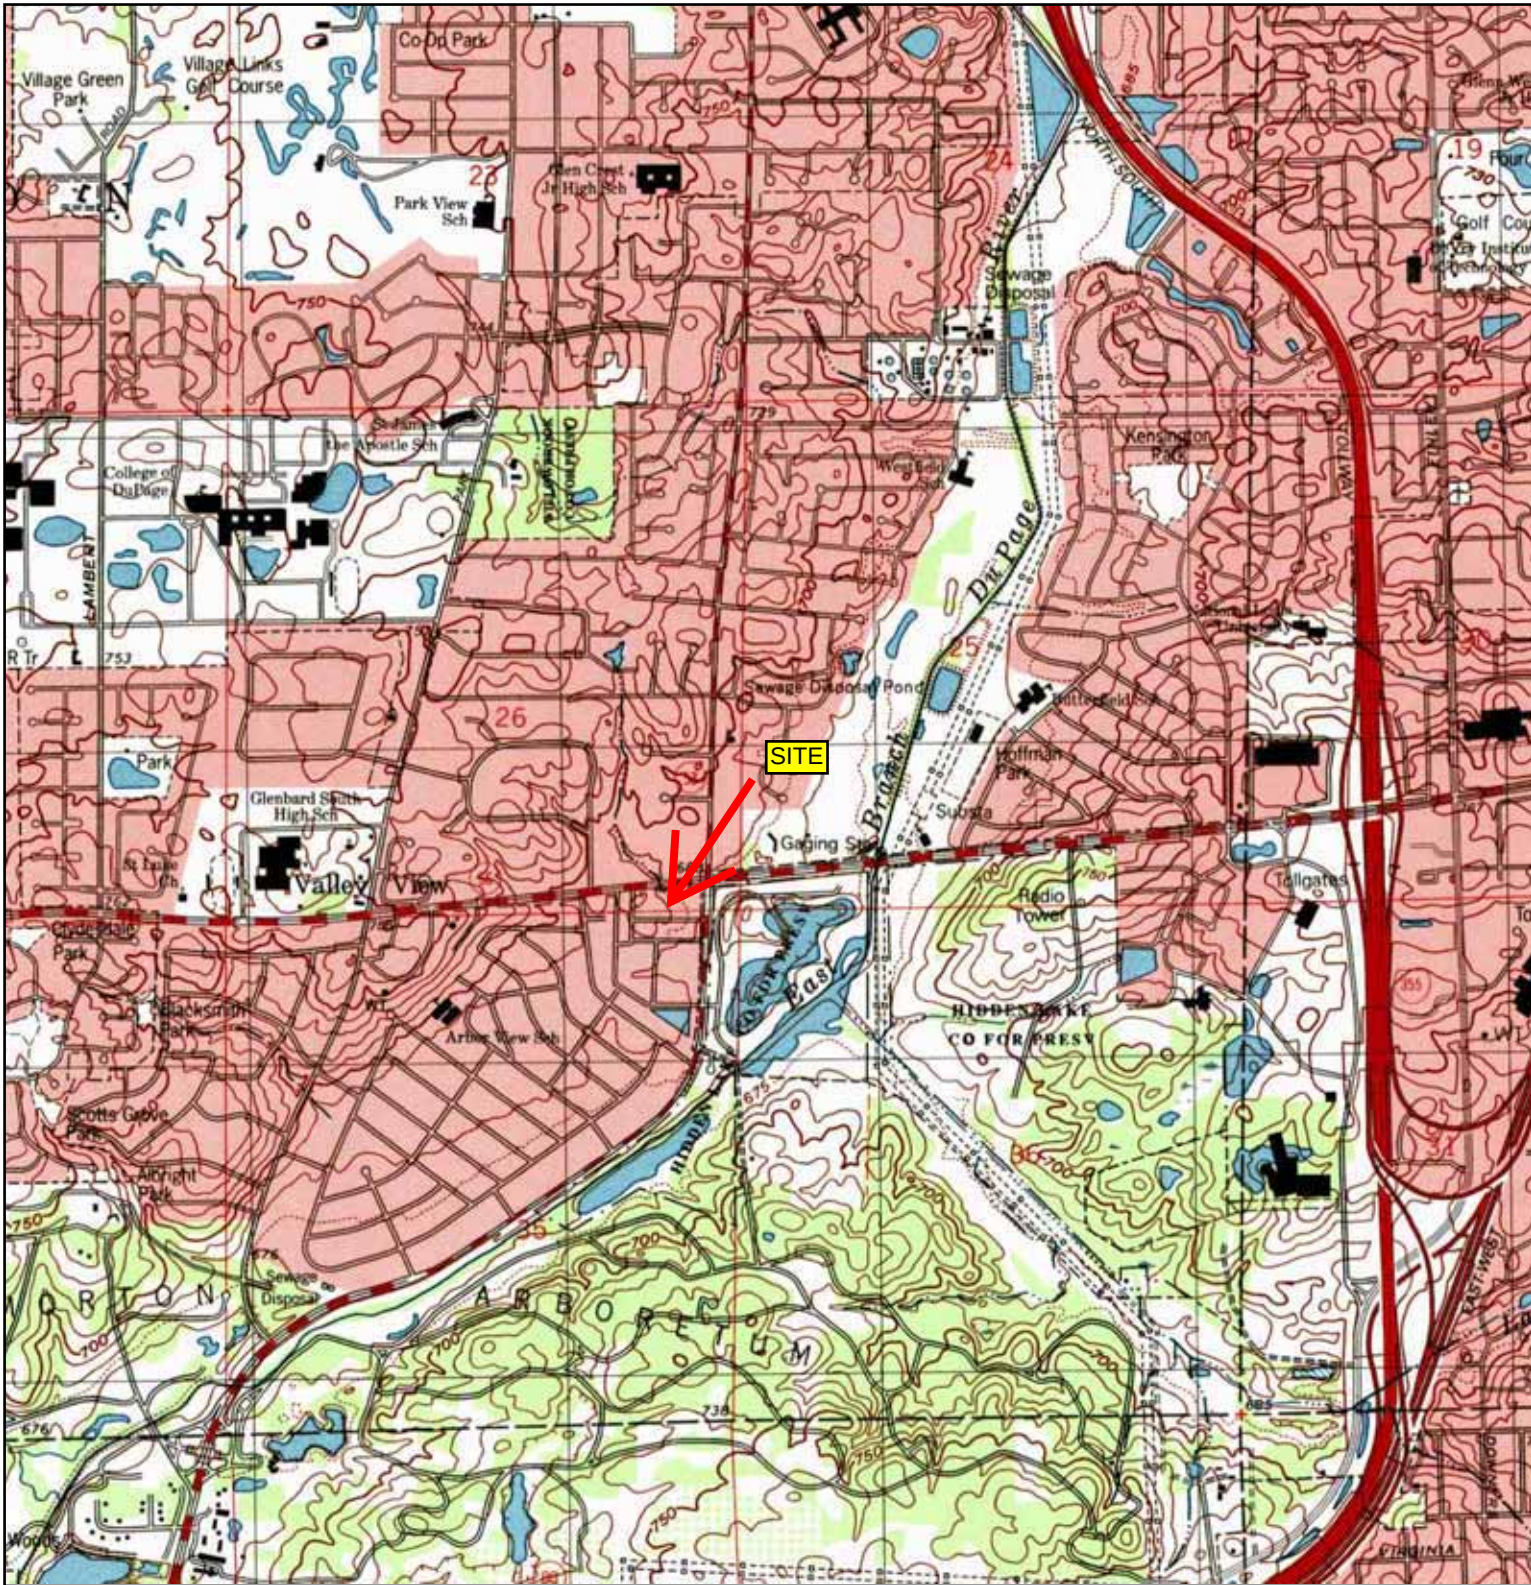

	TARGET QUAD NAME: WHEATON MAP YEAR: 1998	SITE NAME: Bank of America ADDRESS: 22W151 Butterfield Rd Glen Ellyn, IL 60137 LAT/LONG: 41.8312 / 88.0552	CLIENT: LFR Inc CONTACT: Morgan Vogt INQUIRY#: 2537497.34 RESEARCH DATE: 07/10/2009
	SERIES: 7.5 SCALE: 1:24000		

APPENDIX D

User Provided Information



Phase I Environmental Site Assessment Questionnaire

(User Provided Information Questionnaire)

Date: 8/3/09
Site Name: GLEN ELLYN SOUTH Your Name: ERIN BERGIN
Site Location: 22 W 51 BUTTERFIELD Your Title: PROPERTY MANAGER
Relationship to Site: ☒ Owner ☐ Occupant ☐ Purchaser ☐ Other
Length of Time Associated with Site: 1.5 YRS

Please review and complete this questionnaire which will assist LFR in completing our site assessment. If sufficient space is not provided, please complete your response on a separate sheet of paper and attach it to this questionnaire.

1. Are you aware of any environmental cleanup liens against the Site that are filed or recorded under federal, tribal, state or local law?

☐ Yes

☒ No

☐ Unknown

☐ N/A

If Yes, please explain:

2. Are you aware of any activity or land use limitations, such as engineering controls (for contaminant control), land use restrictions or institutional controls, that are in place at the Site and/or have been filed or recorded in a registry under federal, tribal, state or local law?

☐ Yes

☒ No

☐ Unknown

☐ N/A

If Yes, please explain:

See attached sheet for response

See attached sheet for response

194 Forbes Road
Braintree, Massachusetts 02184
Offices Nationwide

781.356.7300 m
781.356.2211 f
www.lfr.com

(GLEN ELLYN)



3. Do you have any specialized knowledge or experience related to the Site or nearby properties? For example, are you involved in the same line of business as the current or former occupants of the Site or an adjoining property so that you would have specialized knowledge of the chemicals and processes used by this type of business?

☐ Yes☒ No☐ Unknown☐ N/A

If Yes, please explain:

4. Are you aware of commonly known or reasonably ascertainable information about the Site that would help the environmental professional to identify conditions indicative of releases or threatened releases? For example, as user,

a) Do you know the past uses of the Site?

☐ Yes☒ No☐ Unknown☐ N/A

If Yes, please explain:

b) Do you know of specific chemicals that are present or once were present at the Site?

☐ Yes☒ No☐ Unknown☐ N/A

If Yes, please explain:

c) Do you know of chemical spills that have taken place at the Site?

☐ Yes☒ No☐ Unknown☐ N/A

If Yes, please explain:

d) Do you know of any environmental cleanups that have taken place at the Site?

☐ Yes☒ No☐ Unknown☐ N/A

If Yes, please explain:

GLEN ELLYN



e) Do you know if any fill material has been imported to the Site?

☐ Yes☒ No☐ Unknown☐ N/A

If Yes, please explain:

5. Do you know of any pending, threatened, or past litigation relevant to hazardous substances or petroleum products in, on, or from the Site?

☐ Yes☒ No☐ Unknown☐ N/A

If Yes, please explain:

6. Do you know of any pending, threatened, or past administrative proceedings relevant to hazardous substances or petroleum products in, on or from the Site?

☐ Yes☒ No☐ Unknown☐ N/A

If Yes, please explain:

7. Do you know of any notices from any governmental entity regarding any possible violation of environmental laws or possible liability relating to hazardous substances or petroleum products at the Site?

☐ Yes☒ No☐ Unknown☐ N/A

If Yes, please explain:

8. Based on your knowledge and experience related to the Site are there any obvious indicators that point to the presence or likely presence of contamination at the Site?

☐ Yes☒ No☐ Unknown☐ N/A

If Yes, please explain:

GLEN ELLYN



9. Does the Site's purchase price reasonably reflect the fair market value of the property?

☐ Yes

☒ No

☐ Unknown

☐ N/A

If No, do you know the reason for lower purchase price? Is it possible that the lower purchase price is because of contamination known or believed to be present at the Site?

☐ Yes

☒ No

☐ Unknown

☐ N/A

If Yes, please explain:

APPENDIX E

Asbestos Sample Results



ENVIRONMENTAL MANAGEMENT & CONSULTING ENGINEERING

March 3, 2008

Project No. 009-11638-00

Mr. Dennis McInerney
Bank of America
Corporate Workplace Environmental Risk Department
Mailstop CT2-545-02-01
200 Glastonbury Blvd.
Glastonbury, CT 06033

Re: Technology/Equipment Installation Asbestos Survey
22W151 Butterfield Road
Glen Ellyn, IL 60137
Mail Code: IL4-003

Dear Mr. McInerney:

LFR Inc. (LFR) conducted a Comprehensive Asbestos Survey at the above-referenced retail banking facility (Site) for Bank of America. The focus of the survey was to identify if specific building materials with potential to be disturbed during the installation of new equipment are asbestos-containing building materials (ACBMs). Background information on the Site, a summary of the asbestos survey as well as the inspector's certification and license are provided below.

Background Information

The Site is a retail banking center situated in a shopping mall. The building is a single-story structure with a basement, approximately 30 years old, and is situated in a commercial area of Glen Ellyn, Illinois. There are approximately 3,000 square feet of floor space in the banking center. Construction of the Site building appeared to be wood frame with a brick exterior façade, glass windows and doors. Interior finished walls are primarily drywall with associated joint compound finished with paint or wallpaper. Ceilings are comprised of 2'x 2' suspended acoustic ceiling tiles suspended on a ceiling grid below a metal corrugated deck. The flooring is a mixture of vinyl floor tile with mastic, ceramic tile with associated grout and adhesive and/or carpeting overlaying the sub-floor. The Thermal System Insulation (TSI) observed was foam rubber pipe insulation. Spray-on fireproofing was not observed at the site.

Asbestos Survey

The survey was performed on February 21, 2008 by Mr. Benito Castillo of LFR. A copy of Mr. Castillo's Illinois Asbestos Inspector License and current Certificate are provided in Attachment A. During the inspection, a total of 20 homogeneous applications were identified for sampling and a total of 29 bulk samples were collected and submitted for laboratory analyses. The results of the asbestos survey are presented on the Homogenous Application Table in Attachment B.



The bulk sample laboratory data package and chain of custody are presented in Attachment C. A site plan denoting sample collection locations is presented in Attachment D and photographs of the homogenous applications are presented in Attachment E. The asbestos inspection Limitations and Service Constraints are presented in Attachment F.

During the survey, the following areas, which were intended to be included in the survey, were not accessible to LFR:

- Wall cavities
- The ceramic floor tile and associated grout/mastic in the lobby and restrooms, and stair treads in the stairwell were not sampled due to concerns for occupant safety and the potential to severely damage the tiles.

No unusual circumstances were observed during the survey.

Certification

The Comprehensive Asbestos Survey described herein was conducted by the undersigned of LFR. LFR's investigation consisted solely of the activities described herein and is subject to the Limitations and Service Constraints in Appendix F.

Sincerely,

A handwritten signature in black ink, appearing to read 'James J. Young', with a stylized, flowing script.


Mr. James J. Young
Project Manager
IL Asbestos Inspector No. 100-05203

Attachments

- A Certification and License
- B Asbestos Homogenous Application Table
- C Laboratory Data Package
- D Site Plan
- E Photographs
- F Limitations and Service Constraints

ATTACHMENT A

Certifications and Licenses

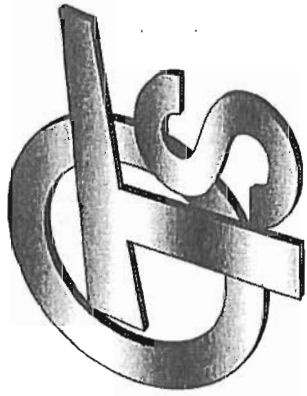

Occupational Training & Supply, Inc.

7233 Adams Street • Willowbrook, IL 60527 • (630) 655-3900


Benito Castillo

has successfully completed the 4 hour Asbestos Building Inspector Refresher course and has passed the competency exam with a minimum score of 70%. This course is accredited by the Illinois Department of Public Health and the Indiana Department of Environmental Management for purposes of accreditation in accordance with EPA 40 CFR 763, Asbestos Hazard Emergency Response Act (AHERA) and TSCA Title II.

Asbestos Building Inspector Refresher

Course Date: January 4, 2008
Expiration Date: January 4, 2009

Exam Date: January 4, 2008
Certificate: BIR0801040024


Kathy Nicholson, Director

2008

State of Michigan
Department of Labor & Economic Growth
Michigan Occupational Safety & Health Administration - Asbestos Program

Asbestos Inspector



Benito Castillo
401 South Park Road
Lombardo, IL 60148

Accreditation Number
A34630

Expiration Date
09/10/2008

DOB: 06/17/1963

Accreditation card is
not valid if altered 72735



Director, Env. Health Div.

No A110360 Issued: 08/10/2007

MDH ASBESTOS
INSPECTOR
Certified by:
State of Minnesota
Department of Health
Expires: 06/26/2008
Benito Castillo
401 South Park Rd
Lombard, IL 60148

State of Michigan
Department of Labor & Economic Growth
Michigan Occupational Safety & Health Administration - Asbestos Program

Asbestos Contractor/Supervisor



Benito Castillo
401 South Park Road
Lombardo, IL 60148

Accreditation Number
A34630

Expiration Date
09/10/2008

DOB: 06/17/1963

Accreditation card is
not valid if altered 72736



PUBLIC HEALTH

**ASBESTOS
PROFESSIONAL
LICENSE**

ID NUMBER
100 - 04240

ISSUED
4/17/2007

EXPIRES
05/15/2008

BENITO CASTILLO
401 SOUTH PARK ROAD
LOMBARD, IL 60148

Environmental Health
See Reverse for Endorsements



ATTACHMENT B

Homogeneous Application Table



ATTACHMENT C

Laboratory Data Package

STAT Analysis Corporation

2242 West Harrison St., Suite 200, Chicago, IL 60612-3766

Tel: (312) 733-0551 Fax: (312) 733-2386 STATinfo@STATAnalysis.com

AIHA Accreditation # 101160 ; NVLAP Lab Code # 101202-0

**ASBESTOS ANALYSIS BY POLARIZED LIGHT MICROSCOPY**

Method: EPA-600/M4-82-020

LFR Levine-Fricke, Inc
630 Tollgate Road Suite D
Elgin, IL 60123
Phone: 847-695-8855
Fax: 847-695-7799

Client Reference: 009-11638-00

Location: BofA 22 W 151 Butterfield Rd., Glen Ellyn

STAT Batch No.: 276416

STAT Client No.: 1369

Date Received: 02/14/2008

Date Analyzed: 02/18/2008

Date Reported: 02/18/2008

Turn Around Time: 72 Hour

Laboratory Sample	Client Sample Number	Asbestos Components (%)	Non-Asbestos Components (%)
276416001	001	ND	Binder 99-100%
276416002	002	ND	Binder 99-100%
276416003	003	ND	Cellulose 20-25% Binder 75-80%
276416004	004	ND	Cellulose 20-25% Binder 75-80%
276416005	005	ND	Cellulose 20-25% Binder 75-80%
276416006	006	ND	Binder 99-100%
276416007	007	ND	Binder 99-100%
276416008	008	ND	Binder 99-100%
276416009	009	ND	Cellulose 5-10% Binder 90-95%
276416010	010	ND	Cellulose 5-10% Binder 90-95%
276416011	011	ND	Cellulose 5-10% Binder 90-95%
276416012	012	ND	Binder 99-100%
276416013	013	ND	Binder 99-100%

ND = Asbestos Not Detected.


NA = Not Analyzed

NS = Not Submitted

The use of the NVLAP logo does not imply endorsement by NVLAP or any agency of the US Government.

The information contained in this report and any attachments is confidential information intended only for the use of the individual or entities named above. The results of this report relate only to the samples tested. If you have received this report in error, please notify us immediately by phone. This report shall not be reproduced, except in its entirety, unless written approval has been obtained from the laboratory.

Analyzed by Name :


Henry Robateau / Microscopist

STAT Analysis Corporation

2242 West Harrison St., Suite 200, Chicago, IL 60612-3766

Tel: (312) 733-0551 Fax: (312) 733-2386 STATinfo@STATAnalysis.com

AIHA Accreditation # 101160 ; NVLAP Lab Code # 101202-0

NVLAP® &

**ASBESTOS ANALYSIS BY POLARIZED LIGHT MICROSCOPY**

Method: EPA-600/M4-82-020

LFR Levine-Fricke, Inc
630 Tollgate Road Suite D

Elgin, IL 60123

Phone: 847-695-8855

Fax: 847-695-7799

Client Reference: 009-11638-00

Location: BofA 22 W 151 Butterfield Rd., Glen Ellyn

STAT Batch No.: 276416

STAT Client No.: 1369

Date Received: 02/14/2008

Date Analyzed: 02/18/2008

Date Reported: 02/18/2008

Turn Around Time: 72 Hour

Laboratory Sample	Client Sample Number	Asbestos Components (%)	Non-Asbestos Components (%)
276416014	014	ND	Binder 99-100%
276416015	015	ND	Binder 99-100%
276416016	016	ND	Binder 99-100%
276416017	017	ND	Binder 99-100%
276416018	018	ND	Binder 90-95% Glass 5-10%
276416019	019	ND	Binder 90-95% Glass 5-10%
276416020	020	ND	Binder 90-95% Glass 5-10%
276416021	021	Chrysotile 1-5%	Binder 95-99%
276416022	022	NA	
276416023	023	NA	
276416024	024	Chrysotile 1-5%	Binder 95-99%
276416025	025	NA	
276416026	026	NA	
276416027	027	ND	Binder 99-100%
276416028	028	ND	Binder 99-100%
276416029	029	ND	Binder 99-100%


ND = Asbestos Not Detected.

NA = Not Analyzed

NS = Not Submitted

The use of the NVLAP logo does not imply endorsement by NVLAP or any agency of the US Government.


The information contained in this report and any attachments is confidential information intended only for the use of the individual or entities named above. The results of this report relate only to the samples tested. If you have received this report in error, please notify us immediately by phone. This report shall not be reproduced, except in its entirety, unless written approval has been obtained from the laboratory.

Analyzed by Name: 

Henry Robateau / Microscopist

STAT Analysis Corporation

2242 W. Harrison, Suite 200, Chicago, Illinois 60612 Phone: (312) 733-0551 Fax: (312) 733-2386
e-mail address: STATInfo@STATAnalysis.com AIHA accredited 101160 NVLAP accredited 101202-0



CHAIN OF CUSTODY RECORD

Page: 1 of 1

Client: LFR Inc.
Street Address: 630 Tollgate Rd., Ste. D
City, State, Zip: Elgin, IL 60123
Phone: 847-695-8855
Fax: 847-695-7799
e-mail/Alt. Fax: james.young@lfr.com
Project Name: Bank of America
Project Number: 009-11638-00
Project Location: 22 W 151 BURTEN A. 220 RD. ELGIN
Project Manager: Jim Young
P.O. Number: _____

Turn Around: Immediate: ☐ 4 Hrs. ☐ 8 Hrs. ☐ 12 Hrs. ☐ 24 Hrs. ☐ 48 Hrs. ☒ 72 Hrs. ☐ 5 Days: ☐

Date Due: _____ Time Due: _____

Relinquished by: James Young Date/Time: 02/13/08 8-12 PM

Received by: FAO Date/Time: 02/13/08 8-12 PM

Relinquished by: _____ Date/Time: _____

Received by: _____ Date/Time: _____

Relinquished by: _____ Date/Time: _____

Received by: _____ Date/Time: _____

Relinquished by: _____ Date/Time: _____

Received by: _____ Date/Time: _____

Relinquished by: _____ Date/Time: _____

Received by: _____ Date/Time: _____

Relinquished by: _____ Date/Time: _____

Received by: _____ Date/Time: _____

Relinquished by: _____ Date/Time: _____

Received by: _____ Date/Time: _____

Relinquished by: _____ Date/Time: _____

Received by: _____ Date/Time: _____

Relinquished by: _____ Date/Time: _____

Received by: _____ Date/Time: _____

Relinquished by: _____ Date/Time: _____

Received by: _____ Date/Time: _____

Relinquished by: _____ Date/Time: _____

Received by: _____ Date/Time: _____

Relinquished by: _____ Date/Time: _____

Received by: _____ Date/Time: _____

Relinquished by: _____ Date/Time: _____

Received by: _____ Date/Time: _____

Relinquished by: _____ Date/Time: _____

Received by: _____ Date/Time: _____

Relinquished by: _____ Date/Time: _____

Received by: _____ Date/Time: _____

Relinquished by: _____ Date/Time: _____

Received by: _____ Date/Time: _____

Relinquished by: _____ Date/Time: _____

Received by: _____ Date/Time: _____

Relinquished by: _____ Date/Time: _____

Received by: _____ Date/Time: _____

Relinquished by: _____ Date/Time: _____

Received by: _____ Date/Time: _____

Relinquished by: _____ Date/Time: _____

Received by: _____ Date/Time: _____

Relinquished by: _____ Date/Time: _____

Received by: _____ Date/Time: _____

Relinquished by: _____ Date/Time: _____

Received by: _____ Date/Time: _____

Relinquished by: _____ Date/Time: _____

Received by: _____ Date/Time: _____

Relinquished by: _____ Date/Time: _____

OFFICE USE ONLY BELOW:

Batch No.: 276446

Samples Acceptable: Yes: ☒ No: ☐

Checked by (Initial/Date): JS/02/13/08

QC by (Initial/Date): JS/02/13/08

Reported By (Initial/Date/Time/Method): JS/02/13/08

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Comments: _____

Client Sample Number/Description: 29 samples per the attached field sampling log.

Date Taken: 02/12/08

Time On: _____ Off: _____

Rate (lpm): _____

Volume (Liters): _____

Area Wiped (ft²): _____

Laboratory Sample No.: _____

Other: _____

PLM Asbestos (Bulk): ☒

PLM Asbestos (Air): _____

PLM Asbestos (Gravimetric): _____

PLM Asbestos (Microvac): _____

PLM Asbestos (TEM Water): _____

PLM Asbestos (TEM): _____

PLM Asbestos (TEM): _____

PLM Asbestos (TEM): _____

PLM Asbestos (TEM): _____

PLM Asbestos (TEM): _____

PLM Asbestos (TEM): _____

PLM Asbestos (TEM): _____

PLM Asbestos (TEM): _____

PLM Asbestos (TEM): _____

PLM Asbestos (TEM): _____

PLM Asbestos (TEM): _____

PLM Asbestos (TEM): _____

PLM Asbestos (TEM): _____

PLM Asbestos (TEM): _____

PLM Asbestos (TEM): _____

PLM Asbestos (TEM): _____

PLM Asbestos (TEM): _____

PLM Asbestos (TEM): _____

PLM Asbestos (TEM): _____

PLM Asbestos (TEM): _____

PLM Asbestos (TEM): _____

PLM Asbestos (TEM): _____

Comments: Bill @ \$5 per sample per Quote # 839 - Please use progressive, or "positive stop" analysis.

276416

Homogeneous Application Table
 Mail Code: 74 G003
 Address: 3261 151 BUSTLEFIELD RD, GLEN ELLYN
 Date of Survey: 02/12/22

PG 1 of 3

Material Description				Location of HA (Where it is found in bank)				Sample Information					
HA No.	Material Type	Primary Color	Texture	Description	NESHAP Cat.	Floor	Room / Area	Location (Wall / Floor / Ceiling)	Condition	Quantity (SFA/CF)	ID	Location	Notes
1	TERAZO	BLEND	SMOOTH	TERAZO FLOOR TILE		1	10716	FLOOR	GOOD	50 200	---	ENTRY	DISTRACTIVE NOT SAMPLED
2	TEXTURED PAINT	WHITE	ROUGH	DECORATIVE CAT-1		1	11	CEILING	GOOD	50 200	001	11	
2	PAINT	WHITE	ROUGH	11	11	1	11	11	11	---	002	11	
3	CERAMIC TILE	WHITE	ROUGH	2'x2' CERAMIC TILE	Non ACM SAMPLED	1	1577	CEILING	GOOD	50 200	003	3	
3	PAINT	WHITE	ROUGH	11	11	1	50731	11	11	---	004	4	
3	PAINT	WHITE	ROUGH	11	11	1	45710	11	11	---	005	13	
4	WALL PAPER	YELLOW	ROUGH	B&G SPECTRO WALL PAPER	Non ACM SAMPLED	1	1272	WALL	GOOD	50 200	006	2	
4	PAINT	WHITE	ROUGH	11	11	1	50731	11	11	---	007	4	
4	PAINT	WHITE	ROUGH	11	11	1	16732	11	11	---	008	7	
5	CEILING WALL BOARD	WHITE	ROUGH	NA	Non ACM SAMPLED	1	1272	WALL	GOOD	50 200	009	2	
5	PAINT	WHITE	ROUGH	11	11	1	1577	11	11	---	010	3	
5	PAINT	WHITE	ROUGH	11	11	1	10716	11	11	---	011	6	

NOTE

276416

Homogeneous Application Table

Mts. Code: 160003
 Address: 620 15th, AUTUMN PINE RD, CARRVILLE IL.
 Date of Survey: 02/12/08

PG 2 of 3

Material Description				Location of HA Where it is found in bank				Sample Information					
HA No.	Material Type	Primary Color	Texture	Description	NESHAP Cat.	Floor	Room / Area	Location (Wall / Floor / Ceiling)	Condition	Quantity (S.F./L.F./C.F.)	ID	Location	Notes
6	PAINT	WHITE	RA		CAT-1	1	12x2	WALL	GOOD	30 405	012	2	
6	"	"	"		"	1	15x7	"	"	"	013	3	
6	"	"	"		"	1	10x20	"	"	"	014	6	
7	PAINT	WHITE	RA	BRUSHED	WALL	1	12x2	WALL	GOOD	30 60	015	2	
7	"	"	"	"	"	3	3x5	"	"	"	016	10	
7	"	"	"	"	"	1	45x10	"	"	"	017	13	
8	VAPOR BARRIER	BLACK	RA	VAPOR BARRIER ATTACHED TO BRICK	NESHAP CAT-1	1	12x2	WALL	GOOD	30 2240	018	2	BEFORE EXTERIOR & INTERIOR WALLS
8	"	"	"	"	"	1	50x31	"	"	"	019	4	"
8	"	"	"	"	"	1	10x20	"	"	"	020	6	"
9	PAINT	BEIGE	RA	BRUSHED	WALL	1	15x7	WALL	GOOD	30 210	---	3 & 5	BEFORE EXTERIOR & INTERIOR WALLS
10	PAINT	"	RA	BRUSHED	WALL	1	15x7	WALL	GOOD	470	---	3 & 5	"
11	PAINT	WHITE	RA	BRUSHED	WALL	1	15x7	WALL	GOOD	10 60	---	3 & 5	"

NOTES:

276416

Homogeneous Application Table

Mail Code: I L C C 0 3

Address: 2260 151st Street, R.R. 2, LYN 24

Date of Survey: 02/12/08

PG 3 of 3

Material Description				Location of HA (Where it is found in bank)				Sample Information					
HA No.	Material Type	Primary Color	Texture	Description	NESHAP Cat.	Floor	Room / Area	Location (Wall / Floor / Ceiling)	Condition	Quantity (S/L/F/F)	ID	Location	Notes
12	FIBERGLASS	YEL/WH	HA	FIBERGLASS P.O.B. W/SHAP	ASSUMED NON A.C.M.	1	—	CEILING DAMAGED	—	—	—	3-11-12	NOT SAMPLED
13	GLASS	BEIGE	HA	4'x9" BEIGE CERAMIC FLOOR TILE	NON A.C.M.	1	50x31	FLOOR	GOOD	320	—	4	CUSTOMER SERVICE NOT SAMPLED
14	VINYL FLOOR TILE	WHITE	SM	12" x 12" WHITE VINYL FLOOR TILE	NON A.C.M.	1	5x5	FLOOR	GOOD	595	021	10	CANTINA CLOSET
14	GLASS	11	11	11	11	0	45x10	11	11	—	022	13	WALKWAY BASEMENT
14	GLASS	11	11	11	11	0	45x10	11	11	—	023	11	11
15	MASTIC	BLK	HA	ASSOCIATED WITH 12" x 12" WHITE VINYL FLOOR TILE	NON A.C.M.	1	5x5	FLOOR	GOOD	995	024	10	—
15	GLASS	11	11	11	11	0	45x10	11	11	—	025	13	BASEMENT
15	GLASS	11	11	11	11	0	45x10	11	11	—	026	11	11
16	FLOOR TILE	BEIGE	SM	18" x 18" BEIGE SQUARE FLOOR TILE	NON A.C.M.	1	10x20	FLOOR	GOOD	320	027	6	—
17	MASTIC	YELLOW	HA	ASSOCIATED WITH 18" x 18" BEIGE SQUARE FLOOR TILE	NON A.C.M.	1	10x20	FLOOR	GOOD	320	028	6	—
18	WALL PAPER	YR	HA	DARK ORANGE WALL PAPER	NON A.C.M.	1	10x20	WALL	GOOD	320	029	6	—
19	FLOOR TILE	BROWN	SM	STAIR COVER	NON A.C.M.	1	22x7	FLOOR	GOOD	68	—	9	STAIRWAY DISCOUNT NOT SAMPLED

NOTES

20 MASTIC BLK HA ASSOCIATED WITH STAIR COVER

1 22x7 FLOOR 68

11

ATTACHMENT D


Site Plan

220003

6 of 8

Symbol Legend

- ADA Entry
- Men's Toilet
- Women's Toilet
- Unisex Toilet
- Emergency Exit
- Fire Extinguisher
- Fire Alarm Panel
- Sprinkler System
- Electrical Service
- Gas Service
- HVAC Systems/Controls
- Water Service
- Telecommunications

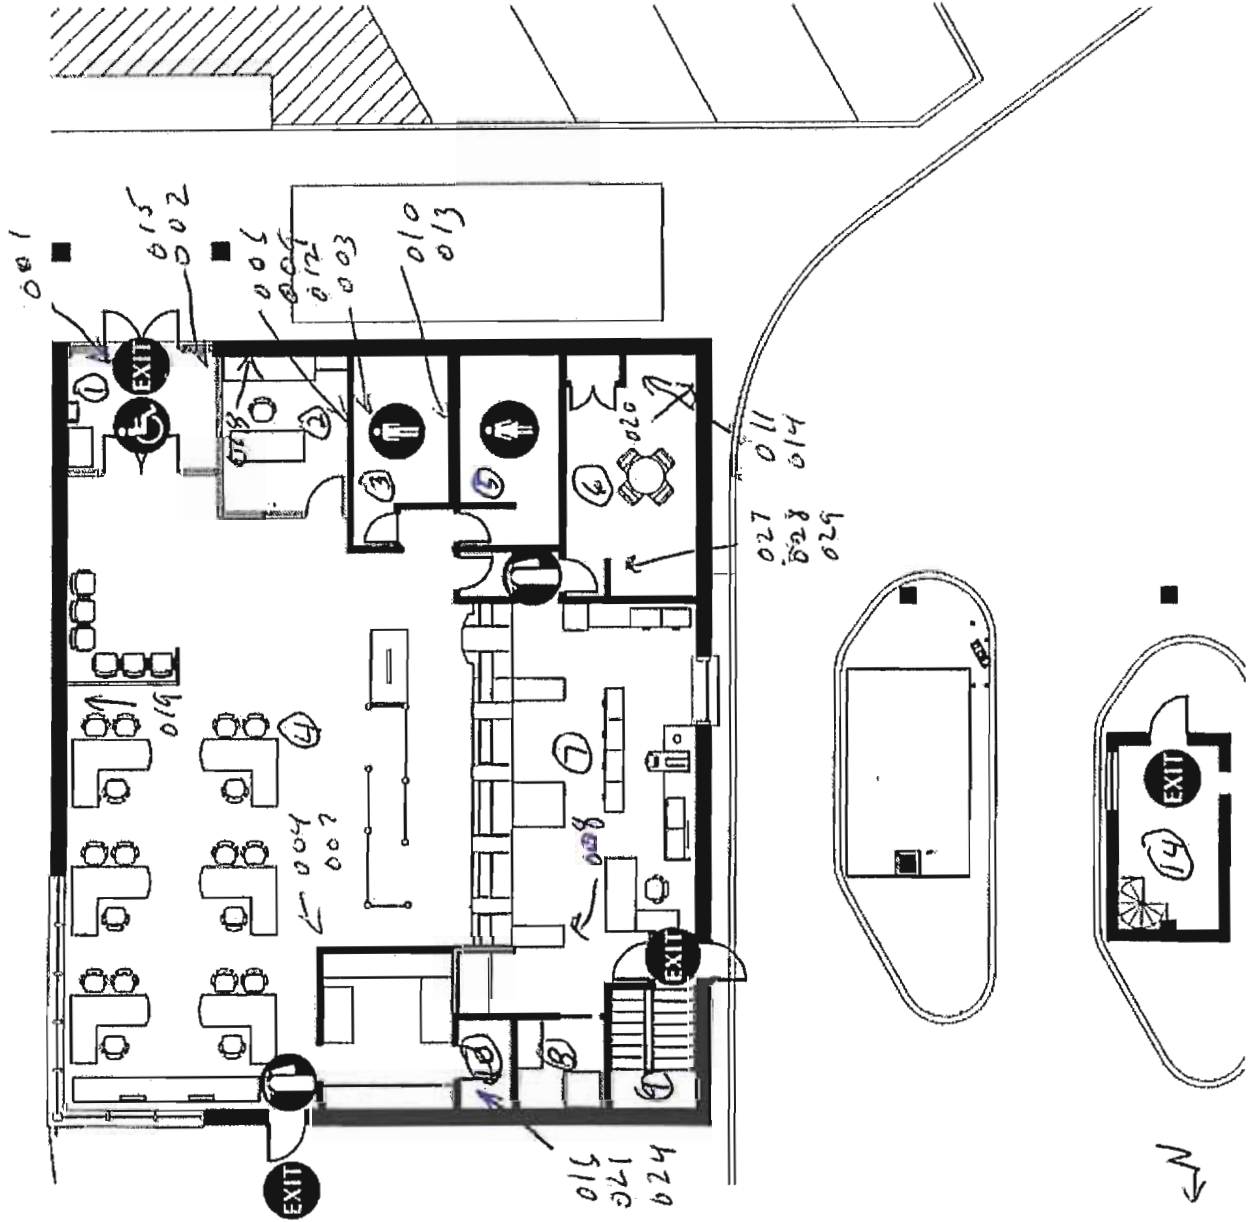

LaSalle Bank - Glen Ellyn South
First Floor

22W151 Butterfield Road - Glen Ellyn, Illinois





220003


7 of 8

Symbol Legend

- ADA Entry
- Men's Toilet
- Women's Toilet
- Unisex Toilet
- Emergency Exit
- Fire Extinguisher
- Fire Alarm Panel
- Sprinkler System
- Electrical Service
- Gas Service
- HVAC Systems/Controls
- Water Service
- Telecommunications

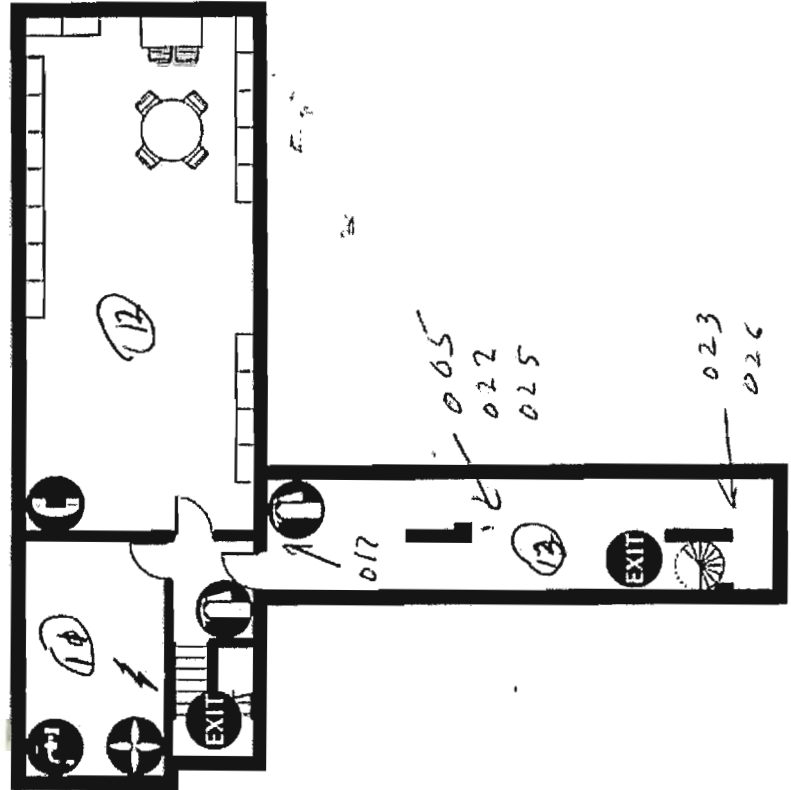

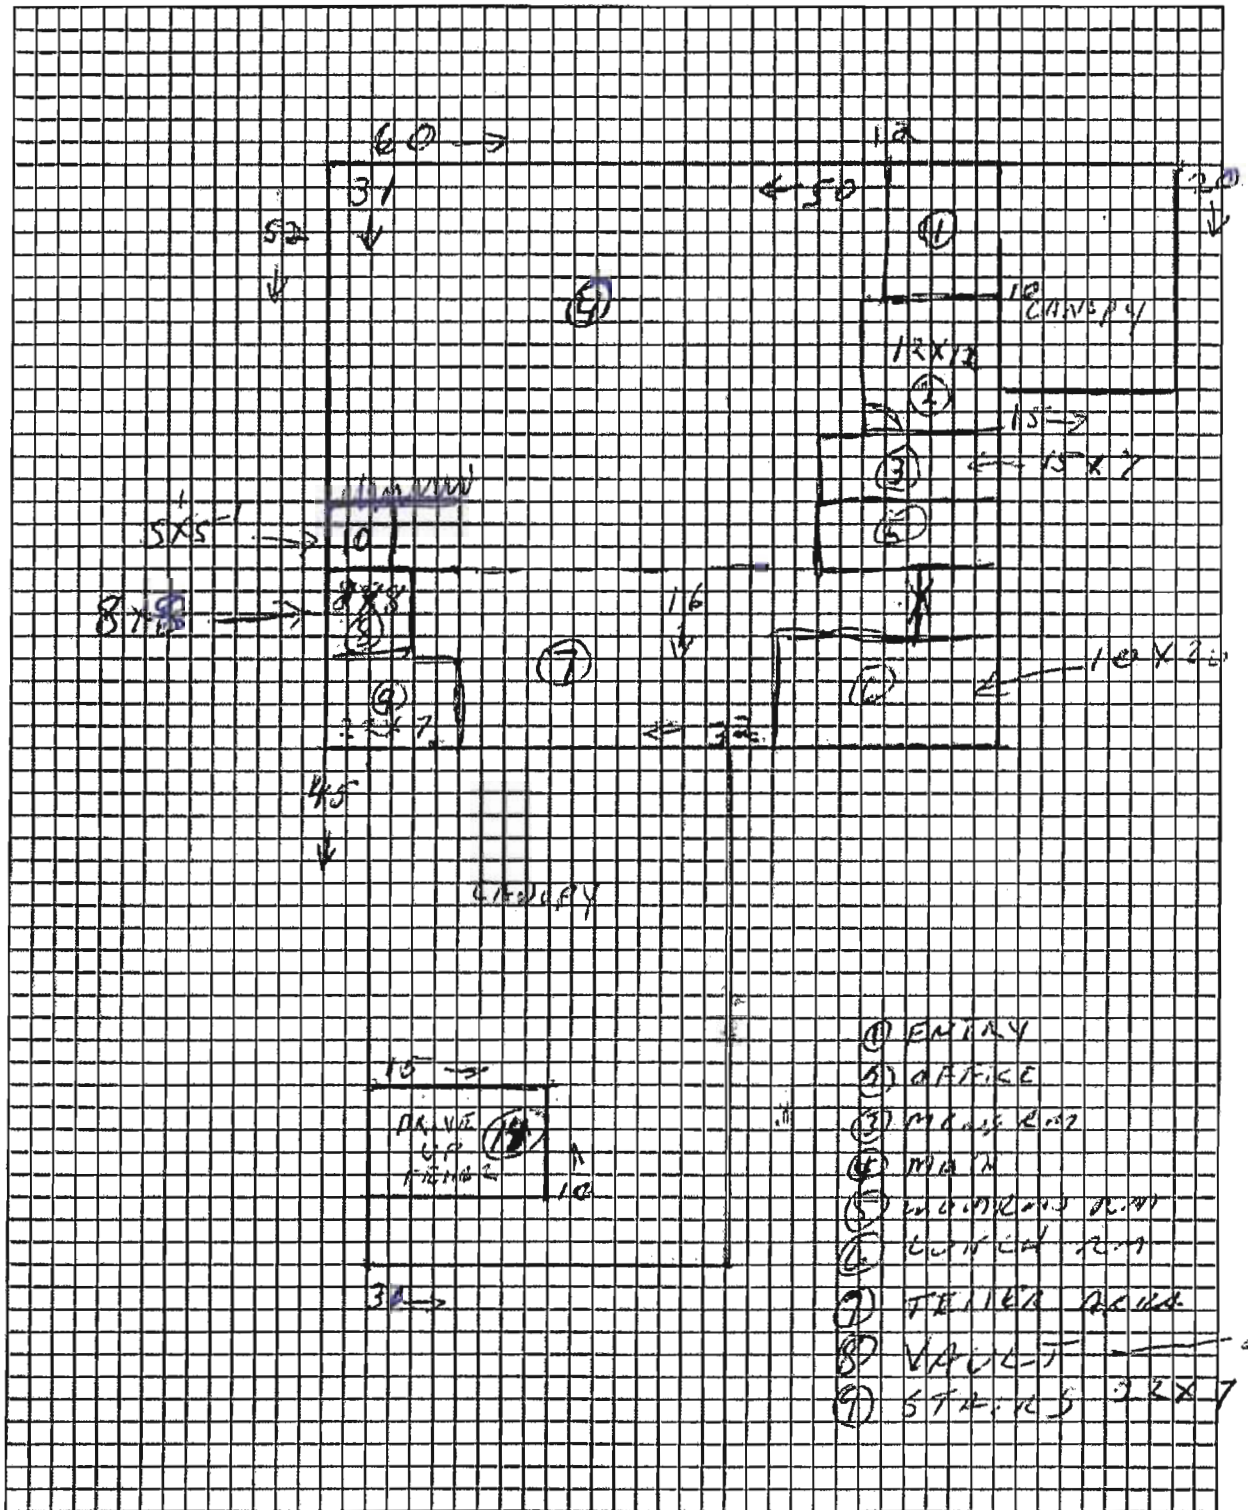

			
PROJECT NO:		BANKING CENTER NAME:	
TASK: <i>ACBM Insp.</i>		COST CENTER:	
DRAWN BY:		SITE ADDRESS:	

DATE: 02/13/08

22W 151 BUTTERFIELD RD
GLENN 21141 24

15' X 10' X 10' H
45' X 31' X 5' H. 20'

ATTACHMENT E

Photographs


IL4-003
22W 151 Butterfield Rd Glen Ellyn IL
2/13/08




HA - 1: Terrazzo floor tile




HA - 2: Decorative textured paint

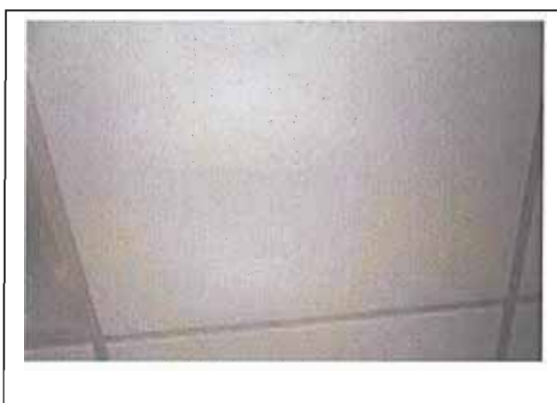


HA - 3: 2'x2' White ceiling tile

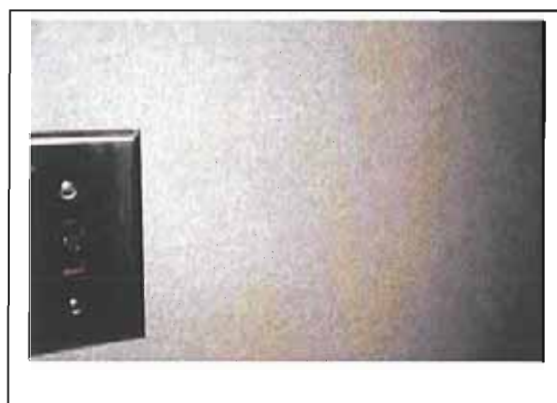

HA - 4: Beige speckled wallpaper

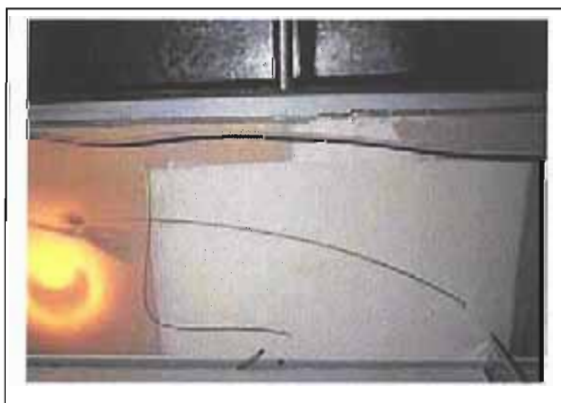

HA - 5/6: Drywall/drywall joint compound

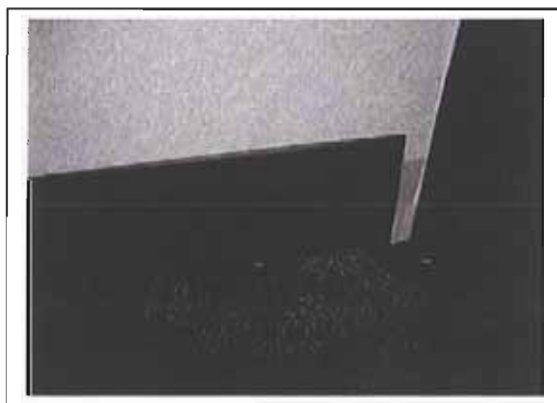

HA - 7: Yellow cove base mastic


IL4-003
22W 151 Butterfield Rd Glen Ellyn IL
2/13/08



HA - 8: Vapor barrier attached to fiberglass pipe wrap



HA - 9/10/11: Brown beige ceramic floor tile/
4"x4" white ceramic wall tile/cove base mastic

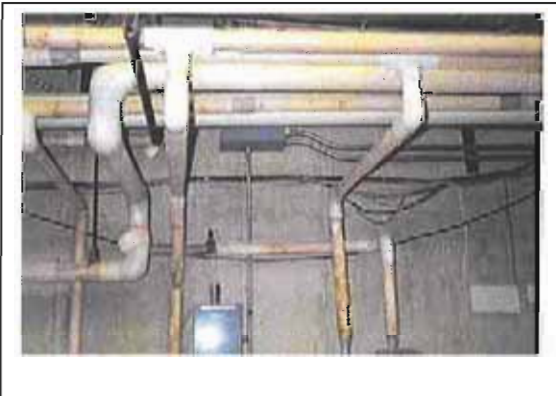

HA - 12: Fiberglass pipe wrap



HA - 13: 9"x9" beige ceramic floor tile



HA - 14/15: 12"x 12" Off white floor tile/mastic
associated with 12"x12" off white floor tile



HA - 16/17: 18"x 18" Dark beige floor
tile/mastic associated with 18"x18" beige floor
tile

IL4-003
22W 151 Butterfield Rd Glen Ellyn IL
2/13/08



HA - 18: Yellow wallpaper adhesive



HA- 19/20: Stair treads in stairwell/mastic associated with stair treads



HA - 21: Ceiling area above canopy, assumed ACM

ATTACHMENT F

Limitations and Service Constraints

LIMITATIONS AND SERVICE CONSTRAINTS

Asbestos Related Services

All professional opinions presented in this report are based on information made available to us either by review of data provided by others or data gathered by LFR personnel.

LFR affirms that data gathered and presented by LFR in this report was collected in an appropriate manner in accordance with generally accepted methods and practices. LFR cannot be responsible for decisions made by our client solely on the basis of economic factors.

Conditions described in this report are as found at the time of investigation, unless otherwise stated.

LFR analyzed only the substances, conditions and locations described in the report at the time indicated. No inferences regarding other substances, conditions, location or time can be made unless specifically stated in this report.

No recommendations were provided for materials containing less than one- percent asbestos. Materials containing less than one percent asbestos do not meet either the generally accepted industry definition of asbestos-containing material (any material containing greater than one percent asbestos) or the EPA definition of friable ACM (any material friable bulk insulation material contain greater than one percent asbestos by weight as analyzed by Polarized Light Microscopy.) LFR, however, makes no statement, implied or explicit, about the hazards of materials containing less than one percent asbestos.

This report is intended for the use listed in the section of this report described as the Introduction. The use of this report in any manner other than that listed in the Introduction requires the written consent of LFR. This report must be presented in its entirety.

APPENDIX F

Qualifications of Environmental Professionals

DOUGLAS M. LINDSAY, P.G.
Senior Project Geologist

hydrogeologic investigations
project management
LSP MCP services
soil and groundwater management

Mr. Lindsay has over 12 years of experience involving subsurface and hydrogeologic investigations, contaminated soil and groundwater management, state and federal regulatory compliance, environmental remediation programs, and American Society for Testing and Materials (ASTM) due diligence. Related projects have included the management of extensive state and federal environmental investigations, subsurface soil and groundwater precharacterization programs, asbestos assessments, lead paint screening, radon sampling, and soil, groundwater, and ambient air field screening. Mr. Lindsay has also conducted groundwater elevation surveys, fate and transport modeling, groundwater and surface water sampling, soil sampling, and soil gas sampling.

Mr. Lindsay has supervised and managed numerous projects simultaneously including operation and maintenance (O&M) of groundwater remediation systems, construction project management, contaminated soil and groundwater management, soil vapor extraction systems, dewatering systems, risk assessments, underground storage tank removals, and Massachusetts Contingency Plan (MCP) regulatory reports. Mr. Lindsay is also involved with researching and evaluating environmental liabilities and determining the cost/benefit analysis associated with applicable remedial measures. Mr. Lindsay manages field staff personnel on the completion of multiple projects.

EDUCATION

B.A. Environmental Science, Boston University, 1995

The School for Field Studies, Rainforest Ecology, Belize, Central America

REPRESENTATIVE EXPERIENCE

- **Subsurface Investigation, Soil Management and Regulatory Closure, Worcester, Massachusetts.** LFR was retained by a private developer for the proposed construction of a retail pharmacy on a property formerly occupied by a truck fueling terminal and lumber yard. Mr. Lindsay oversaw the completion of an ASTM Phase I Environmental Site Assessment and Phase II Subsurface Investigation to investigate potential impacts from former gasoline and diesel fuel aboveground and underground storage tanks. A total of 35 soil borings and 6 monitoring wells were completed to evaluate the nature and extent of soil and groundwater contamination. Based on the results of the sampling data, Mr. Lindsay coordinated the removal of 50 cubic yards of petroleum-contaminated soil for off-site recycling. Results of a site-specific risk characterization concluded that a condition of no significant risk existed. Mr.

Lindsay prepared a Class A-2 Response Action Outcome (RAO) in closure report accordance with the MCP.

- **Construction Management, Soil Disposal Coordination and Tank Removal Activities, Kuss Middle School, Fall River, Massachusetts.** LFR was retained by an earthwork contractor to provide construction management activities and soil disposal coordination during excavation activities associated with the construction of a new middle school building. The property was formerly occupied by textile mill buildings and previous soil sampling results identified contaminated urban fill material which required off-site disposal. During soil excavation activities a 1,000-gallon abandoned underground storage tank was discovered. Mr. Lindsay supervised the removal of the tank, arranged for disposal of the tank and associated soil, and prepared a tank closure report in accordance with tank closure guidance and the Massachusetts Contingency Plan. Mr. Lindsay characterized and coordinated the removal of 1,570 tons of urban fill soils to a Massachusetts Unlined Landfill and a soil recycling facility.
- **MCP and US EPA TSCA Site Closure, Hingham Shipyard – East Side Fill Area, Hingham, Massachusetts.** At the request of a private developer, LFR was retained to delineate and remove PCB-contaminated soil from an area proposed for future residential development. Following the submittal of a US EPA-approved Self-Implementing Plan and a MassDEP-approved Release Abatement Measure (RAM) Plan, Mr. Lindsay oversaw a soil precharacterization program designed to select off-site disposal facilities for the PCB soil. Confirmatory soil samples were collected from test pits at 10-foot sampling frequencies to delineate areas of PCBs containing either greater than or less than 50 mg/kg. Discrete soil samples were collected and analyzed for PCBs in the field with a US EPA-conditionally accepted Dexsil L2000 DX screening instrument. In addition, two overburden and two bedrock groundwater monitoring wells were installed and sampled to assess groundwater conditions. Following the removal of 6,910.13 tons of greater than 50 mg/kg PCB soils and 8,240.47 tons of non-hazardous PCB soil, a site-specific risk assessment concluded that remaining PCB concentrations in soil were below the most-stringent residential cleanup criteria. Mr. Lindsay prepared a Completion of Self-Implementing Plan report and a RAM Completion and Class A-2 RAO report.
- **Precharacterization Program, Readville 5 MBTA Yard, Dedham, Massachusetts.** LFR was retained by a developer interested in constructing residential properties on a former 40-acre rail yard. Mr. Lindsay assisted in the development of a soil precharacterization sampling plan in accordance with MassDEP protocol. Mr. Lindsay supervised a total of 250 test pits in GPS-surveyed locations over a two-week period. As part of the management plan, 900 soil samples were field screened in-situ for RCRA 5 metals with an XRF instrument. The depth of fill material was determined at each location and concentrations of arsenic and lead were presented through 3-D visualization software to the client. Construction management and soil remediation alternatives have been presented at public meetings and will be implemented following public and MassDEP comment.
- **Precharacterization Program, JFK School, Waltham, Massachusetts.** Prior to overseeing field activities, Mr. Lindsay prepared a Soil Management Plan, Construction Materials Management Plan, and a worker Health & Safety Plan for construction activities. Following numerous meetings with the client, Mr. Lindsay identified and selected areas to be sampled as part of a large-scale soil characterization program involved with the redevelopment of the JFK Middle School. A total of 25 test pits were excavated in areas proposed for excavation for foundations and subsurface utilities. Soil quantities were calculated and determined to be

either regulated or unregulated materials. In order to meet stringent project deadlines, facility approvals were expedited and materials transported off-site were managed and documented. A total of 4,500 cubic yards of soil was transported to unlined landfills.

- **Underground Storage Tank Closures and Immediate Response Action, Charlestown, Massachusetts.** Prior assessments performed by LFR had identified the potential for historic USTs at a former rubber manufacturing facility. Since the facility was proposed for residential development, Mr. Lindsay supervised the completion of a supplemental subsurface investigation. Following the identification of two 'benzol' USTs through a GPR survey, a closure strategy was implemented to meet client and MassDEP expedited deadlines. Following MassDEP approvals, an immediate response action was undertaken in response to petroleum contamination in the vicinity of the USTs. Mr. Lindsay oversaw the removal and disposal of the USTs and contaminated soil and groundwater in accordance with the MCP. Mr. Lindsay prepared a response action outcome closure report for site closure in accordance with the MCP.
- **Precharacterization Programs, Logan International Airport, East Boston, Massachusetts.** Mr. Lindsay oversaw four separate soil and groundwater precharacterization programs associated with the redevelopment of the Terminal A area. Activities included supervising the advancement of 80 soil borings and test pits, the installation of monitoring wells, and the collection of 200 soil and groundwater samples. Laboratory analysis results were utilized to characterize the soils and select the most appropriate, cost-effective disposal facilities for the soils. Mr. Lindsay was also responsible for managing field staff and prepared comprehensive reports documenting the findings of the investigations. A total of 270,000 tons of soil was characterized, removed, and transported to 23 Massport and MassDEP-approved facilities. Detailed coordination with the client, subcontractors, and state officials was necessary to complete the project in an organized and timely manner. Additional responsibilities included spill management, health and safety oversight, air sampling, and the operation of temporary groundwater treatment systems for isolated jet-A fuel-impacted areas.
- **Soil Disposal Management/Subcontractor Coordination, Former Mystic Station Power Generating Facility, Everett, Massachusetts.** A total of 60,000 tons of No. 6 oil-contaminated soil and 30,000 tons of urban fill material was excavated and removed from the facility throughout the project's demolition phase. Activities included coordination with seven asphalt batching facilities, two landfills, and several transportation companies. Mr. Lindsay also assisted in the pre-characterization of excavated soil to determine proper off-site disposal alternatives. Continuous management of soil volumes and contractor invoices was necessary to expedite the soil removal process and reduce delays to the project.
- **Tidal Study, Former Mystic Station Power Generating Facility, Everett, Massachusetts.** Mr. Lindsay completed a study involving the effect of tidal fluctuation on groundwater elevation in the vicinity of a large soil excavation and two one-million-gallon bulk fuel oil tanks. The tidal data and its effect on groundwater elevation were used to assess the stability of the supporting matrix beneath the bulk oil tanks. The data assisted in the determination of the type of engineering needed to protect the structural integrity of the fuel oil tanks during planned soil excavation located adjacent to the tanks. By including the tidal fluctuation data, excavation in the immediate vicinity of the tanks was conducted without jeopardizing the tanks or causing delays to the project.

- **Multiphase Investigation, Stoughton, Massachusetts.** In order to bring the property into compliance with the MassDEP, Mr. Lindsay completed an MCP Phase I and Tier Classification to address eight areas of concern. Each area of concern was associated with a release of petroleum compounds and lead from the former use of the Site as an asphalt batching facility. Existing soil and groundwater analysis data, soil removal quantities, and previous RAM Plans completed by others were used to delineate the existing areas of contamination and propose remedial alternatives. The primary sources of subsurface impacts were attributed to asphalt fill material, liquid asphalt tanks, buried drums, and a dry well. The property was classified as a Tier II disposal site and response actions were completed under a new RAM Plan which included oxygenate injections, petroleum-contaminated soil removal, and natural attenuation monitoring. A partial RAO closure report was prepared for seven of the eight areas of concern and natural attenuation monitoring of one area is ongoing.
- **PCB Release Abatement, Former Edgar Station, Weymouth, Massachusetts.** Mr. Lindsay delineated the extent and distribution of high concentrations of PCBs impacted soil and groundwater beneath several former transformers at the facility. In accordance with US EPA TSCA regulations, activities included on-site, quantitative PCB field screening of soil, groundwater, and surface wipe samples, supervision of soil excavation, and management of soil transportation to select soil disposal facilities. Several thousand tons of PCB-impacted soil was removed, risk to on-site workers was eliminated, and future project demolition milestones were completed on schedule.
- **Multiphase Investigation and Remedial Operation Status, Sharon, Massachusetts.** Mr. Lindsay conducted a Phase I and a Phase II Comprehensive Site Assessment at a former manufacturing facility. Activities included the calculation of groundwater flow and determining the extent and distribution of chlorinated solvents in groundwater. Mr. Lindsay assisted in source area location, fate and transport – mass flux calculations, and risk assessment. As part of a Phase III study, remedial alternatives were proposed to comply with stringent drinking water standards applicable to the property. Because natural attenuation and monitoring were determined to be the most cost-effective alternatives, a Phase IV Remedy Implementation Plan and Phase V Remedial Operation Status were prepared and submitted to the MassDEP. Semi-annual groundwater monitoring and status reports are generated for client and MassDEP review.
- **Multiphase Investigation, Stoughton, Massachusetts.** Mr. Lindsay completed a Phase I Site Assessment at a former trucking facility. Activities included the review of prior U.S. Environmental Protection Agency (U.S. EPA) CERCLA investigations, identification of an underground storage tank, and completion of a Tier Classification for the property. A Phase II Comprehensive Site Assessment completed by Mr. Lindsay included the installation of several soil borings and monitoring wells and removal of an underground storage tank and impacted soil in order to delineate subsurface impacts. A Method 3 risk characterization was completed utilizing all existing site data and an RAO closure report was completed.
- **RAOs and Activity and Use Limitations (AULs), Cambridge, Massachusetts.** Several subsurface investigations designed to delineate the extent of urban fill material were supervised by Mr. Lindsay on six parcels of industrial land in Cambridge. At each parcel, site-specific risk characterizations followed by the preparation of separate Activity and Use Limitations restrictive of current and future site uses were completed in order to effectively ‘close’ the parcels under the MCP.

- **Phase I and Phase II Environmental Investigations, Mesa, Arizona.** Mr. Lindsay completed Phase I and Phase II environmental investigations at a dry cleaning facility and oversaw several Geoprobe borings. Based on soil sampling results, a risk characterization was conducted in order to bring the property into compliance with State of Arizona regulations.
- **Corrective Action Plan and Underground Storage Tank Removal, Alexandria, Virginia.** Mr. Lindsay monitored and maintained a groundwater petroleum extraction system for two years at an active trucking facility. After supervising the dismantling of the groundwater extraction system, over 900 tons of petroleum-contaminated soil was removed and the property was closed in accordance with Virginia regulations.

REGISTRATIONS/CERTIFICATIONS

Professional Geologist, New Hampshire, No. 590

Massachusetts Asbestos Inspector Training

Hazardous Materials Transportation Training and Testing – US DOT

OSHA HazWOPER and Emergency Response Training – 40-hour and Annual 8-hour Refreshers

Niton X-Ray Fluorescent Analyzer (XRF) Certified

PROFESSIONAL HISTORY

LFR, Inc., Senior Project Geologist, April 1999 to present

Ransom Environmental Consultants, Inc., Project Geologist, July 1995 to April 1999

MORGAN L. VOGT
Senior Staff Geologist

*Soil and Groundwater Investigations
Underground Storage Tank Removal Oversight
Phase I and Phase II Environmental Site Assessments
Site Remediation
NEPA Compliance
Asbestos Building Inspector*

Ms. Vogt is a Senior Staff Geologist in LFR Inc.'s (LFR) Elgin, Illinois office. She has comprehensive experience in the field of geology and environmental geosciences, including Phase I and Phase II Environmental Site Assessments (ESAs), soil and groundwater monitoring, oversight of underground storage tank (UST) removal, site remediation including soil removal and soil vapor extraction (SVE) systems, National Environmental Policy Act (NEPA) compliance on roadway and water system construction and improvements, and inspecting properties for suspect asbestos-containing building materials (ACBMs).

EDUCATION

New Mexico State University: M.S. Geology, 2005
Truman State University: B.A. Biology, 2002

REPRESENTATIVE EXPERIENCE

- **Phase I Environmental Site Assessments**
Performed over 80 Phase I ESAs for various commercial clients and government agencies in Illinois, Indiana, Missouri, Michigan, Ohio, Tennessee, Georgia, West Virginia, New Mexico, Texas, and Arizona. Properties have included vacant properties, agricultural properties, commercial/retail properties, government buildings, and industrial/manufacturing plants. Phase I ESAs completed in accordance with the United States Environmental Protection Agency (USEPA) All Appropriate Inquiries (AAI) rule and the American Society for Testing and Materials (ASTM) E-1527-05 standard.
- **Phase II Environmental Site Assessments**
Managed Phase II sampling projects for various clients in Illinois, Indiana, New Mexico, Texas, and Arizona. Soil and groundwater investigations have been completed on vacant properties, agricultural properties, commercial/retail properties, industrial/manufacturing plants, and government properties. The investigations were completed to assess concentrations of volatile organic compounds (VOCs), semi-volatile organic compounds (SVOCs), concentrations of arsenic, barium, cadmium, chromium, lead, mercury, selenium, and silver, polychlorinated biphenyls (PCBs), and herbicides/pesticides.
- **Underground Storage Tank Investigations**
Oversight of the removal of USTs at sites in Illinois, New Mexico, Texas, and Arizona. Collected soil and groundwater confirmation samples as needed to demonstrate compliance with applicable regulations.

- **Soil and Groundwater Monitoring**

Oversaw the installation of monitoring wells at various sites in Illinois, Indiana, New Mexico, Texas and Arizona, including collecting soil samples, documenting soil boring lithology, drafting soil boring diagrams and monitoring well completion diagrams, and writing minimum site assessment reports. Performed groundwater monitoring, including collecting water samples, measuring depth to groundwater, gauging wells for non-aqueous phase hydrocarbon liquid (NAPL), drafting potentiometric surfaces and contaminant maps, and writing groundwater monitoring reports.

- **Site Remediation**

Experience performing SVE pilot testing, drafting conceptual remediation plans for SVE systems, and monitoring SVE systems at various sites in New Mexico. Additionally, oversaw the removal of contaminated soil and collected confirmatory soil samples at various sites in Illinois, New Mexico, Texas and Arizona.

- **NEPA Compliance**

Experience performing Federal agency consultations for NEPA compliance on environmental engineering projects in New Mexico and Arizona, such as roadway and water system construction and improvements. Wrote numerous NEPA reports for various funding agencies, including the United States Environmental Protection Agency (USEPA), the United States Department of Agriculture Rural Development (USDA RD), and the Border Environment Cooperation Commission (BECC).

- **Asbestos Inspections**

Performed asbestos inspection surveys in conjunction with Phase I ESAs at various sites in Illinois, Indiana, Missouri, Michigan, Ohio, Tennessee, Georgia, West Virginia, New Mexico, Texas, and Arizona. Performed site walk-through of multiple buildings in Illinois and Indiana to identify and collect suspected ACBMs, along with logging their locations, conditions, and quantities.

CERTIFICATIONS

40-Hour OSHA Health and Safety Training per 29 CFR 1910.120

24-Hour Asbestos Building Inspector per EPA 40 CFR 763

PROFESSIONAL HISTORY

LFR Inc., Senior Staff Geologist, 2008 – Present

Watterson Environmental Group, Environmental Specialist, 2008

Souder, Miller & Associates, Staff Geoscientist, 2006 – 2008

New Mexico State University, NSF GK-12 Director, 2005 – 2006

New Mexico State University, NSF GK-12 Fellow, 2004 – 2005

New Mexico State University, Geology Teaching Assistant, 2003 – 2004

Institute of Tectonic Studies, Research Assistant, 2002 – 2003

Argonne National Laboratory, Waste Management Intern, 1998 – 2002